

WAAS CH 56239 W34B	APP CRS 326°	Rwy Ldg TDZE 182 Apt Elev 192
--	------------------------	---

RNAV (GPS) RWY 34L



WASHINGTON MANASSAS/HARRY P DAVIS FLD (HEF)

⚠

DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH:
Climbing left turn to 3000
direct CSN VORTAC and hold.

ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8
------------------------	---	---	-------------------------

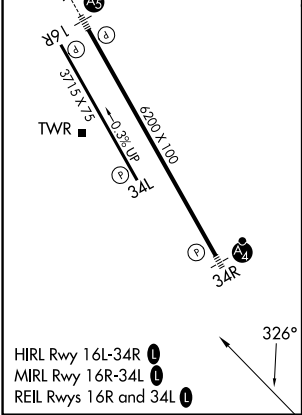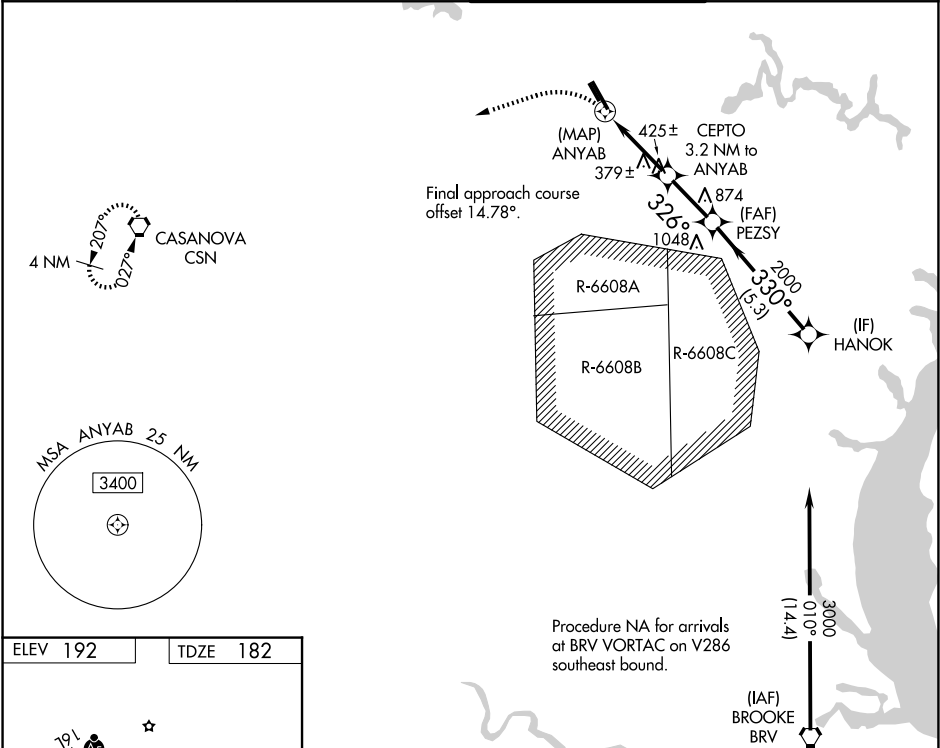

3000	CSN	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).				HANOK
		CEPTO 3.2 NM to ANYAB		PEZSY	3000	
		0.9 NM to ANYAB		326°	2000	
		ANYAB	1260	2.79°	TCH 40	
		0.4	0.9	2.4 NM	2.3 NM	5.3 NM
CATEGORY	A	B	C	D		
LP MDA	640-1	458 (500-1)	640-1 ¾	458 (500-1 ¾)		
LNAV MDA	680-1	498 (500-1)	680-1 ¾	498 (500-1 ¾)		
CIRCLING	720-1 528 (600-1)	740-1 548 (600-1)	840-1 ¾ 648 (700-1 ¾)	880-2 ¼ 688 (700-2 ¼)		