


ILS or LOC RWY 26
DENVER INTL (DEN)

Simultaneous approach authorized with Rwy 25.




MISSED APPROACH: Climb to 5900 then climbing right turn to 9000 on heading 070° and on DVV VORTAC R-019 to CEDUK INT/DVV 25.5 DME and hold.

RADAR REQUIRED

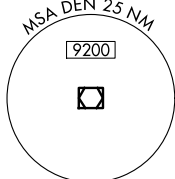

MISSED
APCH
FIX

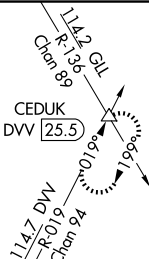

114.7 DVV  MILE HIGH
Chen 94

LOCALIZER .. 108.9
I-JOY ..
Chan 26

FEETS
JOY 3.7
RADAR


DENVER
117.9 DEN
Chan 126

GRASP IN
I-JOY 7.
RADAR

GRASP IN
I-JOY 7.
RADAR

FUZZZ INT
I-JOY 14.2

ALTERNATE
MISSED APC

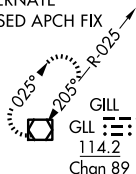


HIRL all Rwys
TDZL/RCLS Rwys 7, 16L, 16R, 17R, 26,
34L, 34R, 35L, 35R

FAF to MAP 5.2 NM

Knots	60	90	120	150	180
Min:Sec	5:12	3:28	2:36	2:05	1:44

Amdt 3A 11DEC14

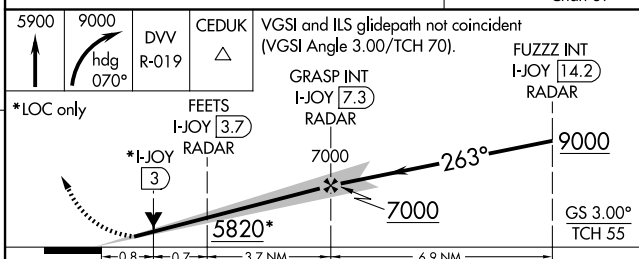

CATEGORY	A	B	C	D
S-ILS 26	5509/18 200 (100-½)			
S-LOC 26	5820/24 511 (400-½)	5820/55 511 (400-1)		
FEETS FIX MINIMUMS				
S-LOC 26	5620/24 311 (200-½)	5620/26 311 (200-½)		

DENVER INTL (DEN)

ILS or LOC RWY 26

39°52'N-104°40'W