



WAAS CH 90318 W34B	APP CRS 353°	Rwy Ldg TDZE Apt Elev	12000 5354 5434
--	------------------------	-----------------------------	--

RNAV (GPS) Y RWY 34R

DENVER INTL (DEN)

RNP APCH - GPS. ▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -26°C or above 54°C. Simultaneous approach authorized. Use of FD or AP required during simultaneous operations. LNAV procedure NA during simultaneous operations. For inop ALS, increase LNAV/VNAV all Cats visibility to 1½ SM.	ALS-2 	MISSED APPROACH: Climb to 10000 direct PIPSY and on track 315° to NIWOT and hold.
---	-----------	--

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 135.3 351.95	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	-------------------------------------	---

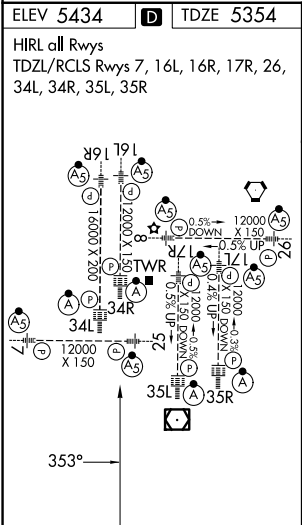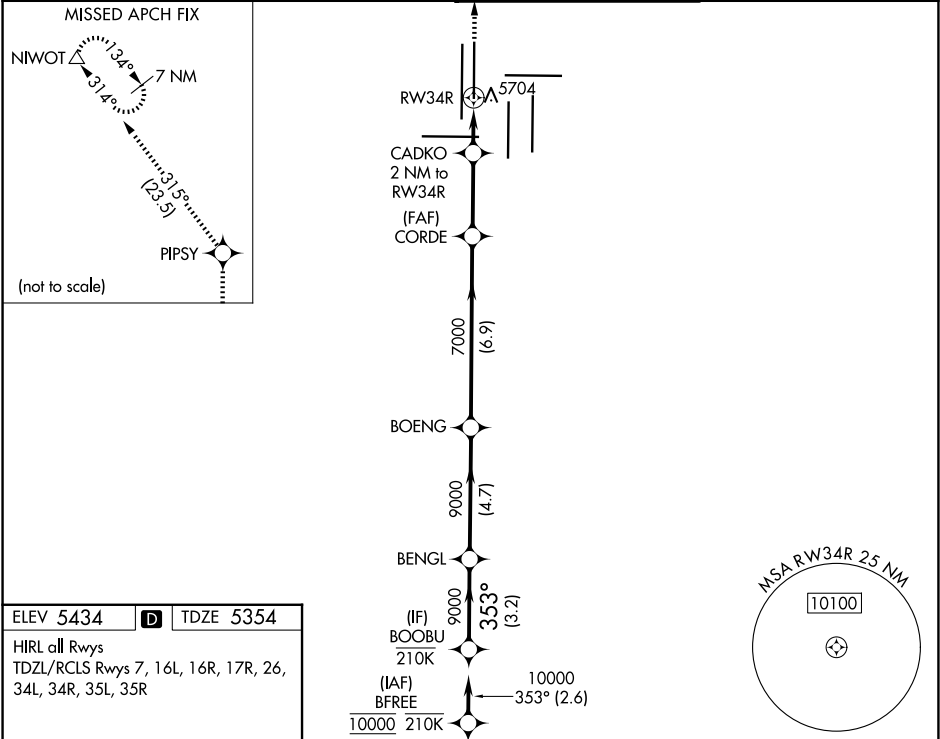

VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 63).			
BOOBU	BENG1	BOENG	10000
GP 3.00°	9000	9000	7000
TCH 55	3.2 NM	4.7 NM	6.9 NM
CATEGORY	A	B	C
LPV DA	5554/18	200 (200-½)	
LNAV/VNAV DA	5842/50	488 (500-1)	
LNAV MDA	5940/24	586 (600-½)	5940-1¼ 586 (600-1¼)