


WAAS CH 50447 W22A	APP CRS 214°	Rwy Ldg TDZE Apt Elev	13502 3606 3607
--	------------------------	-----------------------------	--

RNAV (GPS) Y RWY 22
RICK HUSBAND AMARILLO INTL (AMA)

RNP APCH - GPS.			MALSR 	MISSED APPROACH: Climb to 4020 then climbing left turn to 5000 direct CAUDE and hold.	
For inop ALS, increase LP Cats A/B visibility to 1 SM and Cats C/D/E to ½ SM. Increase LNAV Cats A/B visibility to 1 SM and Cats C/D/E to 1½ SM.					
ATIS 118.85 350.3	AMARILLO APP CON★ 119.5 307.0	AMARILLO TOWER★ 118.3(CTAF)  257.9	GND CON 121.9 348.6	CLNC DEL 121.65 239.275	UNICOM 122.95

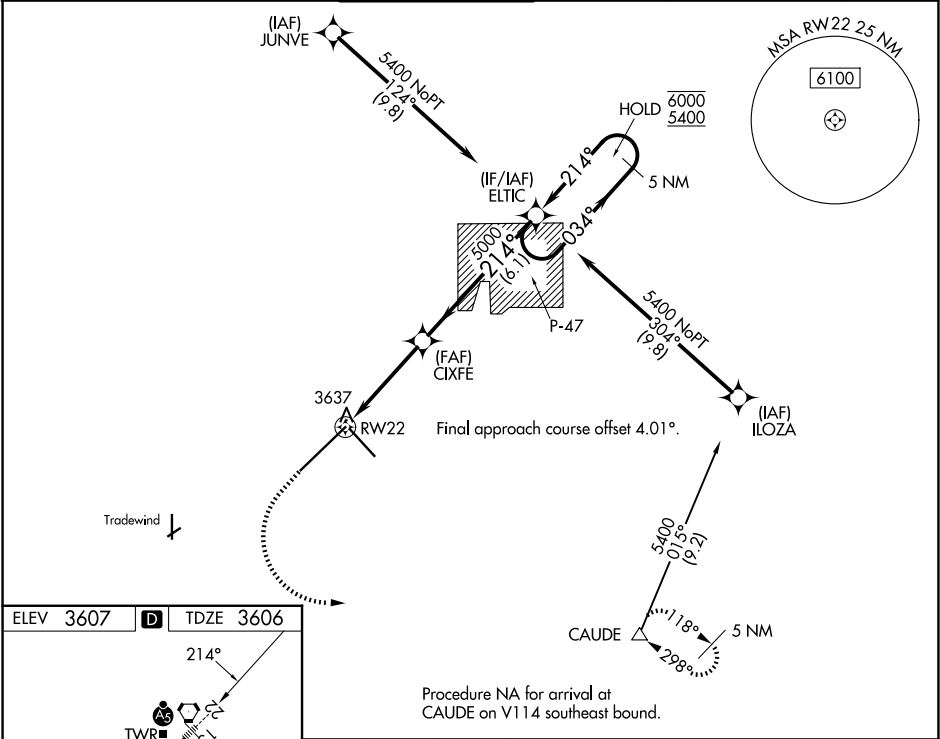

ELEV 3607	D	TDZE 3606
Procedure NA for arrival at CAUDE on V114 southeast bound.		
4020	5000	CAUDE
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 77).		
5 NM Holding Pattern		
RW22		
0.7 NM to RW22		
3.07° TCH 50		
0.7 NM 3.5 NM 6.1 NM		
CATEGORY	A	B
LP MDA	3900-¾	294 (300-¾)
LNAV MDA	4020-¾	414 (500-¾)
CIRCLING	4080-1	473 (500-1)
REIL Rwy 13 0 HIRL Rwy 4-22 and 13-31 0		