

COLUMBUS, OHIO

AL-94 (FAA)

26078

|                                                             |                        |                                                                |
|-------------------------------------------------------------|------------------------|----------------------------------------------------------------|
| LOC/DME I-CMH<br><b><u>111.75</u></b><br>Chan <b>54</b> (Y) | APP CRS<br><b>281°</b> | Rwy Ldg <b>10114</b><br>TDZE <b>815</b><br>Apt Elev <b>815</b> |
|-------------------------------------------------------------|------------------------|----------------------------------------------------------------|

**ILS RWY 28L (SA CAT I & II)**  
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.

**T** Simultaneous approach authorized.

SA CAT I, SA CAT II: Requires specific OPSPEC, MSPEC, or LOA approval.


MALS



**MISSED APPROACH:** Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.

|                 |                                    |                               |                        |
|-----------------|------------------------------------|-------------------------------|------------------------|
| D-ATIS<br>124.6 | COLUMBUS APP CON<br>125.95 371.975 | COLUMBUS TOWER<br>132.7 257.8 | GND CON<br>121.9 348.6 |
|-----------------|------------------------------------|-------------------------------|------------------------|


ALTERNATE MISSED  
APCH FIX

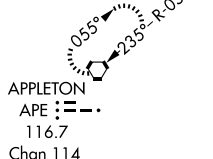

LOCALIZER 111.75  
I-CMH  $\begin{array}{c} \cdot \cdot \\ \text{---} \text{---} \cdot \\ \cdot \cdot \end{array}$   
Chan 54(Y)

APPLETON  
116.7 APE ::=-.  
Chan 114

Procedure NA for arrival on APE VORTAC  
airway radials 143 CW 264.

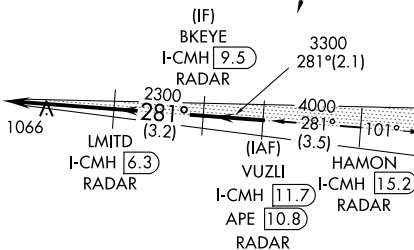



— LOM —  
BOUTN  
230 BU ::::




MSA APE 25 NM

3100

|          |          |          |
|----------|----------|----------|
| ELEV 815 | <b>D</b> | TDZE 815 |
|----------|----------|----------|

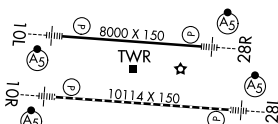

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).

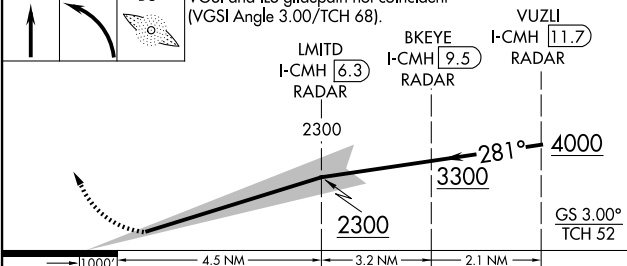

| CATEGORY  | A         | B         | C          | D |
|-----------|-----------|-----------|------------|---|
| S-ILS 28L | SA CAT I  | RA 157/14 | 150 DA 965 |   |
| S-ILS 28L | SA CAT II | RA 100/12 | 100 DA 915 |   |

SA CATEGORY I & II ILS - SPECIAL AIRCREW  
& AIRCRAFT CERTIFICATION REQUIRED

TDZL/RCLS Rwy 10R-28L  
HIRL Rwy 10R-28L and 10L-28R

COLUMBUS, OHIO  
Amdt 31 22APR21

40°00'N-82°54'W

JOHN GLENN COLUMBUS INTL (CMH)  
ILS RWY 28L (SA CAT I & II)

EC-2, 06 AUG 2026 to 03 SEP 2026