

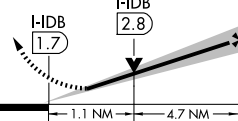
ILS or LOC RWY 23R
PIEDMONT TRIAD INTL (GSO)

Simultaneous approach authorized.

MISSED APPROACH: Climb to 1500 then climbing right turn to 3100 on heading 015° and GSO VORTAC R-360 to MAYOS INT/GSO 16.9 DME and hold.

TDZ/CL Rwys 5L, 23R and 23L
REIL Rwy 32
HIRL Rwys 14-32, 5R-23L and 5L-23R

FAF to MAP 5.8 NM

1500 ↑	3100 hdg 015°	GSO R-360	MAYOS △	HEVED INT I-IDB 7.5	054°	Remain within 10 NM
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).				2800	234°	3100
				2800	GS 3.00° TCH 55	
CATEGORY	A		B		C	D
S-ILS 23R	1064/18				200 (200-½)	
S-LOC 23R	1280/24	416 (400-½)		1280/40	416 (400-¾)	
CIRCLING	1440-1	514 (600-1)		1700-2¼ 774 (800-2¼)	1700-2½ 774 (800-2½)	