

25359

ILS RWY 22R (SA CAT I)
BILL AND HILLARY CLINTON NTL/ADAMS FLD (LIT)

Simultaneous approach authorized.
Requires specific OPSPEC, MSPEC, or LOA approval.



MISSED APPROACH: Climb to 1000 then climbing right turn to 3000 on LIT VORTAC R-247 to BEGAN INT/LIT 28.7 DME and hold.

MISSED APCH FIX


BEGAN 115.1 UT
 115.1 UT [28.7] R-247
 Chan 98

067°
 247°
 116.0 PBF
 Chan 107

(IAF) DUMPLI 11.9
 2500 NoPT
 182° hdg (3.4) and
 227° (2.9)

047°
 277°

Procedure NA for arrival on LIT VORTAC
airway radials 071 CW 162.

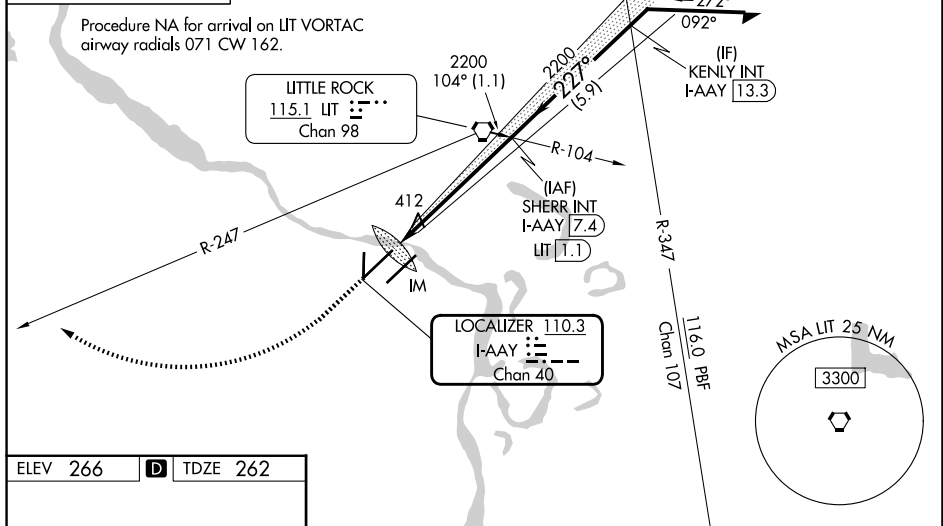

1000
↑

3000
LIT
R-247

BEGAN
△

SHERR INT
I-AAY 7.4
LIT 1.1

Remain within 10 NM

Use I-AAY DME when on the localizer course.

IM

2200

0.47°

227°


2200

GS 3.00°
TCH 59

1201'

5.9 NM

CATEGORY	A	B	C	D
S-ILS-22R	RA 169/14 150 DA 412			

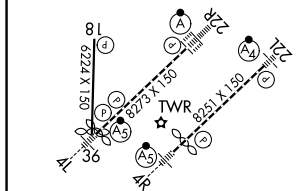

MIRL Rwy 18-36
HIRL Rwy 4R-22L and 4L-22R
TDZL/RCLS Rwy 22R

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

BILL AND HILLARY CLINTON NTL/ADAMS FLD (LIT)
34°44'N-92°13'W ILS RWY 22R (SA CAT I)