


WAAS CH 48813 W05A	APP CRS 054°	Rwy Ldg 10000 TDZE 384 Apt Elev 435
--	------------------------	--

RNAV (GPS) Y RWY 5L

RALEIGH-DURHAM INTL (RDU)

RNP APCH-GPS. ⚠ Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -12°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to RVR 5500. Use of FD or AP required during simultaneous operations.			MALSR	MISSED APPROACH: Climb to 1000 then climbing left turn to 2200 direct DUHAM and hold.	
D-ATIS 123.8	RALEIGH APP CON 127.675 307.9	RALEIGH TOWER 127.45 257.8	GND CON 121.9 348.6	CLNC DEL 120.1	CPDLC

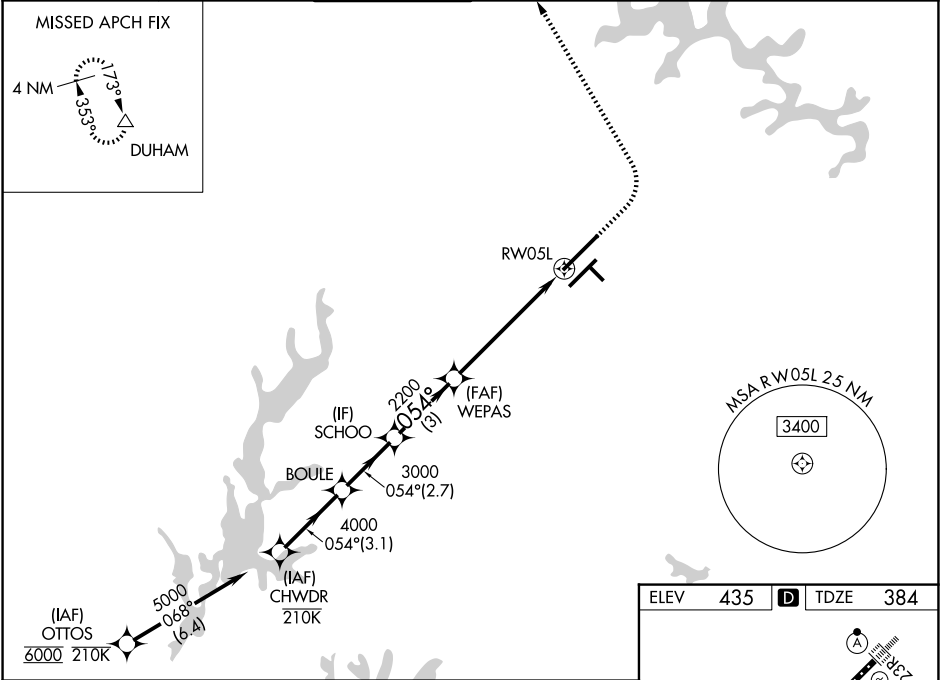

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 72).				
CATEGORY	A	B	C	D
LPV DA	598/18		214 (200-½)	
LNAV/VNAV DA	748/35		364 (400-¾)	
LNAV MDA	880/24	496 (500-½)	880/50	496 (500-1)
CIRCLING	960-1	525 (600-1)	1020-1½ 585 (600-1½)	1180-2½ 745 (800-2½)

