

LOC/DME I-DDO

110.5

Chan 42

APP CRS

005°

Rwy Ldg

10000

TDZE

88

Apt Elev

96

ILS RWY 35L (SA CAT I)

ORLANDO INTL (MCO)



RADAR required for procedure entry: DME or RADAR required.

Requires specific OPSPEC, MSPEC or LOA approval. Simultaneous approach authorized. Bright lights on highway midway between Rwy 35L and Rwy 35R may be mistaken for runway lights. When using alternate missed approach, simultaneous approach NA.

ALSIF-2

MISSED APPROACH: Climb to 3000 on heading 005° and ORL VORTAC R-049 to OVIDO INT/ORL 13 DME and hold.

D-ATIS 121.25	ORLANDO APP CON 124.8 307.0	ORLANDO TOWER 118.45 253.5 (17L/35R, 17R/35L) 124.3 253.5 (18L/36R, 18R/36L)	GND CON 126.4 (E) 121.8 (W)
------------------	--------------------------------	--	-----------------------------------

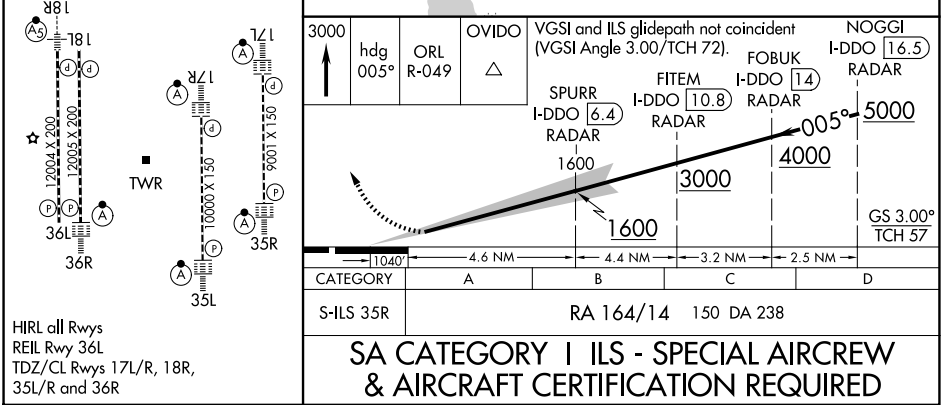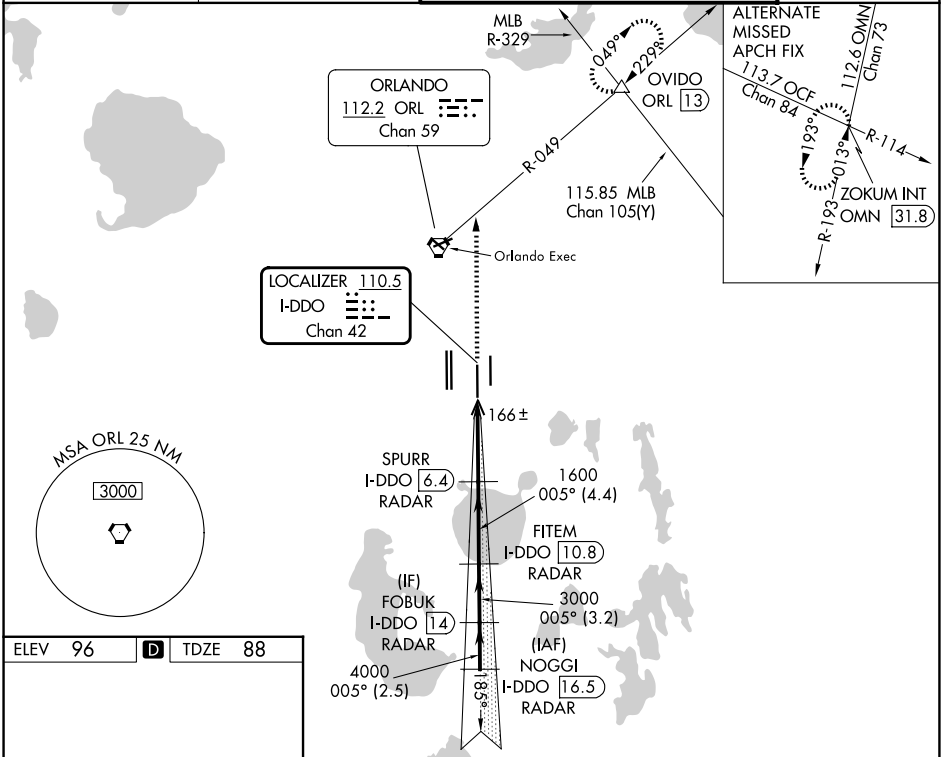

SE-3, 06 AUG 2026 to 03 SEP 2026

SE-3, 06 AUG 2026 to 03 SEP 2026