

APP CRS
329°

Rwy Ldg
10400

TDZE
121

Apt Elev
151

RNAV (RNP) RWY 33

TED STEVENS ANCHORAGE INTL (ANC) (PANC)


RNP AR APCH. RF required.

▼

For uncompensated Baro-VNAV systems,
procedure NA below -17°C or above 54°C.

MISSED APPROACH: Climb to 4000 on the RNAV
missed approach route to BGQ VORTAC and hold.

D-ATIS 135.5	ANCHORAGE APP CON 118.6 290.5	ANCHORAGE TOWER 118.3 257.8	GND CON 121.9 338.25
-----------------	----------------------------------	--------------------------------	-------------------------

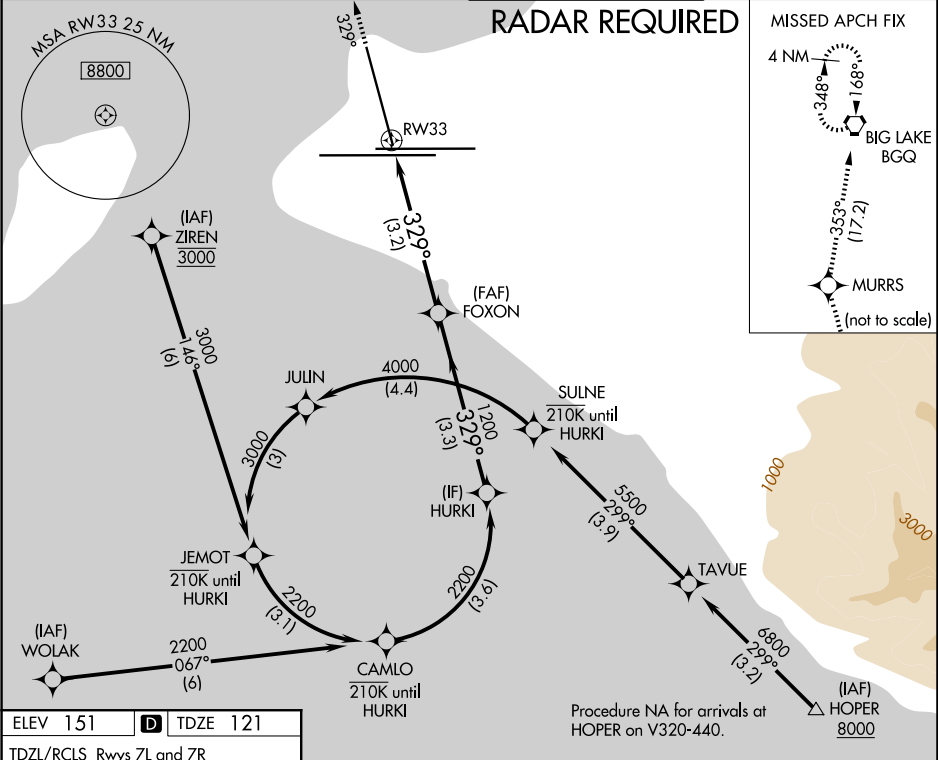

ELEV 151 D TDZE 121

TDZL/RCLS Rwy 7L and 7R
REIL Rwy 33
HIRL all rwy's

151
12400 X 200
0.4% UP

10865 X 200
0.5% DOWN

10600 X 150
0.4% DOWN

TWR

329°

4000	MURRS	tr 329°	tr 353°	BGQ
FOXON	HURKI	1200	2200	GP 3.00° TCH 60
RW33	3.2 NM	3.3 NM		
CATEGORY	A	B	C	D
RNP 0.11 DA	463-1	342 (400-1)		
RNP 0.20 DA	525-1 1/8	404 (400-1 1/8)		
RNP 0.30 DA	687-1 5/8	566 (600-1 1/8)		
AUTHORIZATION REQUIRED				