

YIGO, GUAM I, GUAM

TACAN Y RWY 24R

VORTAC UNZ 115.8 Chan T05	APCH CRS 234°	Rwy Idg TDZE Arprt Elev	10,527 617 617
---------------------------------	------------------	-------------------------------	----------------------

(USAF)


ANDERSEN AFB (PGUA)

RNAV or RADAR required for missed approach	ALSF-1	MISSED APPROACH: Climb to 1100, then climbing left turn to intercept UNZ R-054 to MDBUG and hold.
▼ * When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile. ** Circling not authorized NW of Rwy 06L-24R.	A1	

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

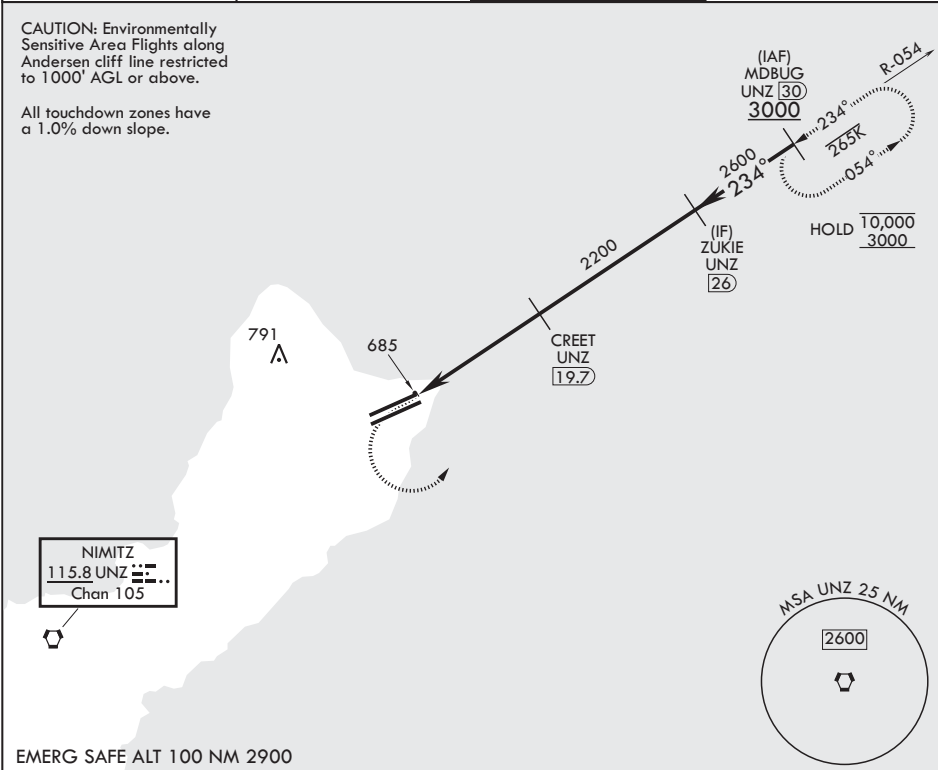

EMERG SAFE ALT 100 NM 2900

1100

UNZ

R-054

3000

UNZ

R-054

ELEV 617

TDZE 617

VORTAC

ENWHY 14.8

15.6

CREET 19.7

ZUKIE 26

234°

3000

2600

2200

≤ 2.90°

TCH 59

.1

4.9 NM

MDBUG 30

CATEGORY	A	B	C	D	E
S-24R*	940/24 323 (400-½)		940/40 323 (400-¾)		
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)

HIRL all rwys

677

H

10,537 x 200

0.7% DOWN

11,199 x 200

0.5% UP

730

BCN TWR 735

234°

142°

730

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 24R

PAC, 09 JUL 2026 to 03 SEP 2026

PAC, 09 JUL 2026 to 03 SEP 2026