

LOC/DME I-RQF

109.75

Chan 34 (Y)

APP CRS

296°

Rwy Idg

5500

TDZE

619

Apt Elev

632

ILS or LOC RWY 30

BUTLER COUNTY RGNL/HOGAN FLD (HAO)

RNP APCH - GPS

DME required.

▽

▲

Inop table does not apply to S-ILS 30.

MALS


≡

≡

≡

MISSED APPROACH: Climb to 1600 then climbing right turn to 2600 direct MIZZA and hold.

ASOS 121.425	CINCINNATI APP CON 121.0 254.25	CLNC DEL 126.25	UNICOM 123.05 (CTAF) 0
-----------------	------------------------------------	--------------------	---------------------------

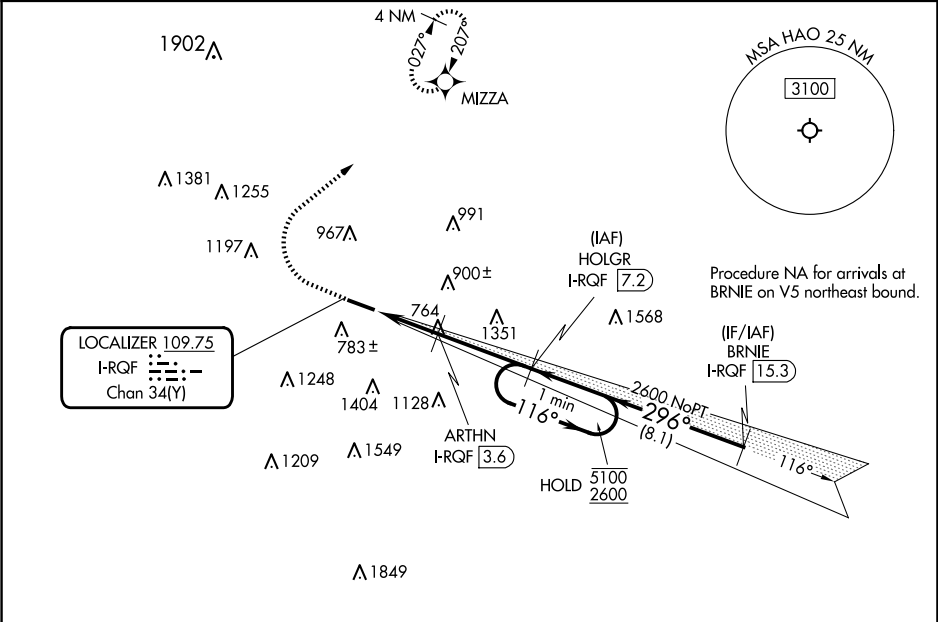

ELEV 632

TDZE 619

1600

2600

MIZZA

HOLGR I-RQF 7.2

One Minute Holding Pattern

116° $\rightarrow$ 5100

$\leftarrow$ 296° 2600

GS 3.00° TCH 46

ARHIN I-RQF 3.6

2600

1460

I-RQF 2.4

I-RQF 1.1

1.3 NM

1.2 NM

3.6 NM

MIRL Rwy 12-30 0

REIL Rwy 12 and 30 0

FAF to MAP 6.1 NM

Knots	60	90	120	150	180
Min:Sec	6:06	4:04	3:03	2:26	2:02

CATEGORY	A	B	C	D
S-ILS 30	819-3/4		200 (200-3/4)	
S-LOC 30	1080-3/4	461 (500-3/4)	1080-1 1/8	461 (500-1 1/8)
CIRCLING	1280-1	648 (700-1)	1300-1 3/4 668 (700-1 3/4)	1760-3 1128 (1200-3)