

LOC/DME I-EQY <u>109.75</u> Chan 34 (Y)	APP CRS 053°	Rwy Ldg TDZE Apt Elev	7001 683 683
---	------------------------	-----------------------------	---

ILS or LOC RWY 5
CHARLOTTE/MONROE EXEC (EQY)

DME required. RADAR required for procedure entry.



Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Inop table does not apply to S-ILS 5 all Cats. For inop ALS, increase S-LOC 5 all Cats visibility to 1 SM.

MALSR

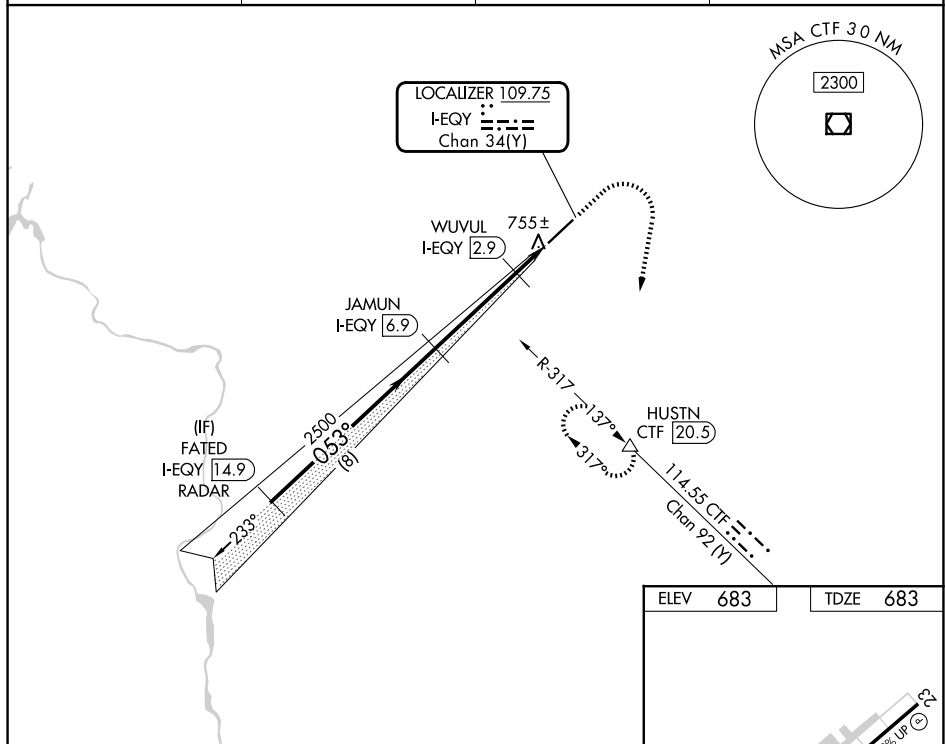


MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.

ASOS
135.775

CHARLOTTE APP CON
120.05 307.8

CLNC DEL
132.55

UNICOM
122.7 (CTAF) **L**

FATED
I-EQY 14.9
RADAR

JAMUN
I-EQY 6.9

WUVUL
I-EQY 2.9

I-EQY 2.2

I-EQY 1.3

2500

053°

2500

1220

8 NM

4 NM

0.7 NM

0.9 NM

GS 3.00°
TCH 46

1180

3000

hdg 196°

CTF R-317

HUSTN

7001 X 100

053°

HIRL Rwy 5-23

REIL Rwy 23

FAF to MAP 5.6 NM

CATEGORY	A	B	C	D
S-ILS 5		933-3/4	250 (300-3/4)	
S-LOC 5		1020-3/4	337 (400-3/4)	
CIRCLING	1220-1	537 (600-1)	1220-1 1/2 537 (600-1 1/2)	1480-2 1/2 797 (800-2 1/2)

Knots	60	90	120	150	180
Min:Sec	5:35	3:44	2:48	2:14	1:52