


VORTAC OKW 111.0 Chan 47	APP CRS 076°	Rwy Ldg TDZE 700 Apt Elev 700
--	------------------------	---

VOR RWY 5
BESSEMER NTL (EKY)

▼ ▲NA	Inoperative table does not apply. When local altimeter setting not received, use Alabaster altimeter setting and increase all MDAs 60 feet; increase S-5 Cat C visibility 1/8 SM and Circling Cat D visibility 1/4 SM.	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct OKW VORTAC and hold.
------------------	--	---

AWOS-3PT 118.825	BIRMINGHAM APP CON 124.9 351.85	CLNC DEL 123.75	UNICOM 123.0 (CTAF) 0
----------------------------	---	---------------------------	---------------------------------

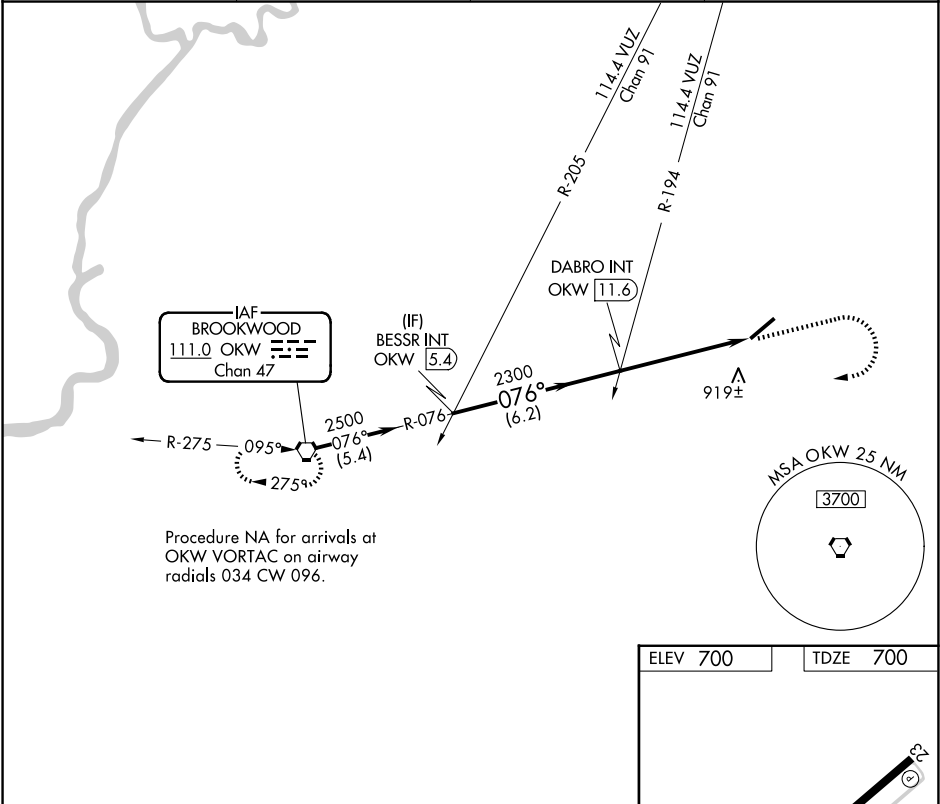

Procedure Turn NA	BESSR INT OKW 5.4		DABRO INT OKW 11.6		OKW 16.4	
	2500	076°	2300	3.02° TCH 45		
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 60).						
6.2 NM 4.9 NM						
CATEGORY	A	B	C	D		
S-5	1180-1	480 (500-1)	1180-1 3/8 480 (500-1 3/8)	1180-1 1/2 480 (500-1 1/2)		
CIRCLING	1200-1	500 (500-1)	1220-1 1/2 520 (600-1 1/2)	1320-2 620 (700-2)		

