

BRENHAM, TEXAS

AL-6271 (FAA)

19311

WAAS CH 77616 W34A	APP CRS 345°	Rwy Idg 6003 TDZE 269 Apt Elev 318
--	------------------------	---

RNAV (GPS) RWY 34
BRENHAM MUNI (11R)

RNP APCH.



For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 37°C. Rwy 34 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use College Station altimeter setting and increase all DA 52 feet, and all MDA 60 feet; increase LPV and LNAV/VNAV all Cats visibility ¼ SM. VDP and Baro-VNAV NA with College Station altimeter setting.


MISSED APPROACH: Climb to 3100 direct DUDYA and hold.

AWOS-3 121.125	HOUSTON APP CON 134.3 360.85	UNICOM 123.075 (CTAF) 0
--------------------------	--	-----------------------------------


MISSED APCH FIX



RADAR REQUIRED

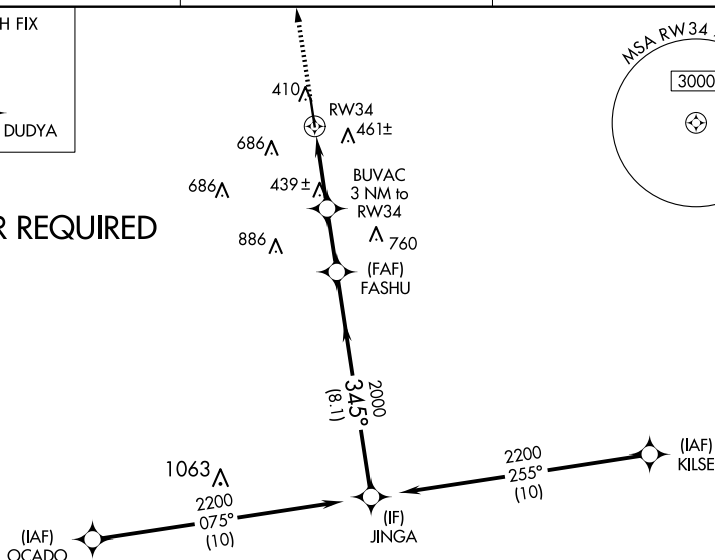

ELEV 318		TDZE 269
----------	--	----------

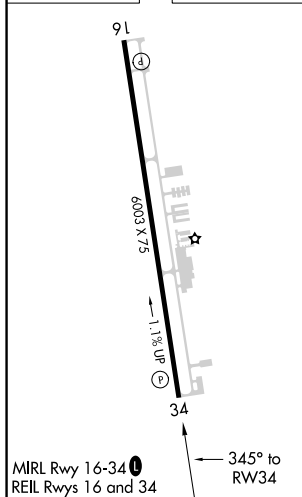

3100 DUDYA VGS1 and RNAV glidepath not coincident (VGS1 Angle 3.50/TCH 48).

* RNAV only.

1.1 NM 1.9 2.3 NM 8.1 NM

RW34 1240 2000 2200

345°

JINGA

GP 3.00° TCH 45

BRENNHAM, TEXAS
Amdt 2B 07NOV19

30°13'N-96°22'W

BRENNHAM MUNI (11R)
RNAV (GPS) RWY 34

SC-5, 06 AUG 2026 to 03 SEP 2026