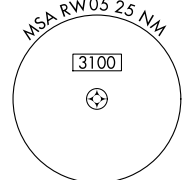


RNAV (GPS) RWY 5  
ADDINGTON FLD (EKX)

**T**  
**A** For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C.

**MISSED APPROACH:** Climb to 3000  
direct ZIBET and on track 104° to  
HERMS and hold.

UNICOM  
123.075 (CTAF) 

R-3704 A/B

ZIBET

RW05 

(FAF)  
CIHAD

(IF/IAF

2500 NoPT  
087°  
(10.3)

(IAF)  
OSINE

HOLD  $\overline{6000}$   
2500  4 NM

MISSED APCH FIX  
HERMS  
104°  
284°  
4 NM

4 NM  
Holding Pattern

RISZO

## CIHAD

3000  
▲

ZIBET

| tr |

HERMS

$$\begin{array}{r} \overline{6000} \quad \leftarrow 230^\circ \\ \underline{2500} \quad \quad \quad 050^\circ \\ \hline \text{GP 3.00} \\ \text{TCH 49} \end{array}$$

050°  
2500

0.3 N  
RW05

W05



\* LNAV only


\*1.3 NM to  
PW05

Diagram illustrating a 1D lattice structure with a defect. The lattice is divided into segments with lengths 6 NM, 4 NM, and 1.3 NM. A black rectangular block is shown at the end of the 1.3 NM segment, with an arrow pointing left towards it.

| CATEGORY      |     | A                     | B                     | C                             | D                      |
|---------------|-----|-----------------------|-----------------------|-------------------------------|------------------------|
| LPV           | DA  | 968-3/4               |                       | 200 (200-3/4)                 |                        |
| INAV/<br>VNAV | DA  | 1053-7/8              |                       | 285 (300-7/8)                 |                        |
| INAV          | MDA | 1200-1 432 (500-1)    |                       | 1200-1 1/4 432 (500-1 1/4)    |                        |
| CIRCLING      |     | 1240-1<br>464 (500-1) | 1260-1<br>484 (500-1) | 1420-1 3/4<br>644 (700-1 3/4) | 1760-3<br>984 (1000-3) |

|      |     |
|------|-----|
| ELEV | 776 |
|------|-----|

TDZE 768

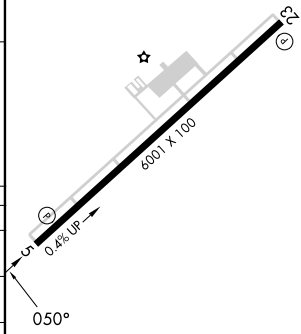

MIRL Rwy 5-23 **L**  
REIL Rwy 5 **L**