

WAAS CH 69418 W25A	APP CRS 247°	Rwy Idg TDZE Apt Elev	3434 8 9
--	------------------------	-----------------------------	-------------------------------------

RNAV (GPS) RWY 25

BEAUFORT EXEC (A.R.W)



⚠

ASR

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Beaufort MCAS (Merritt Fld) altimeter setting and increase LPV DA to 226, LNAV/VNAV DA to 352, and all MDA 20 feet. VDP and Baro-VNAV NA when using Beaufort MCAS (Merritt Fld) altimeter setting.

MISSED APPROACH:
Climb to 2000 direct
EROMY and hold.

AWOS-3 119.675	BEAUFORT APP CON★ 125.125 292.125	UNICOM 122.7 (CTAF) 0
--------------------------	---	---------------------------------

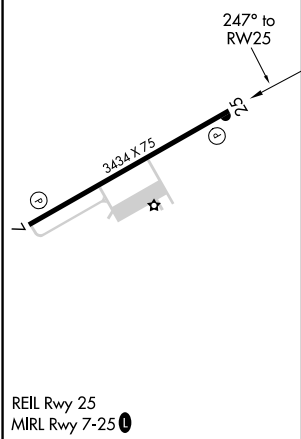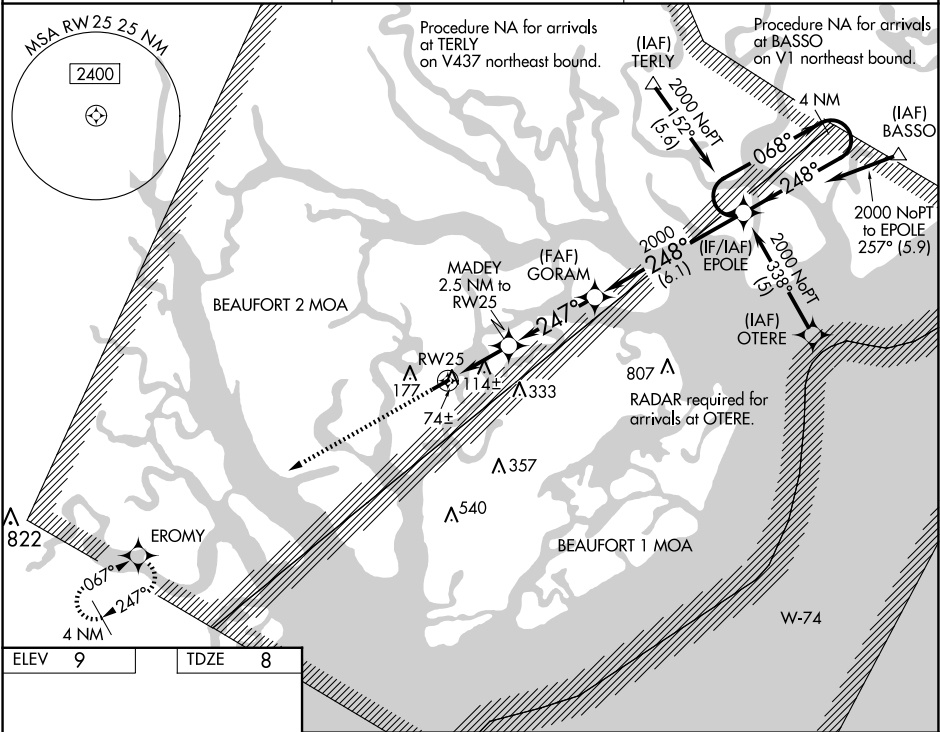

2000 ↑ EROMY		VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 25).			
*LNAV only.		GORAM 2000			
MADEY 2.5 NM to RW25		EPOLE 4 NM Holding Pattern			
*1.1 NM to RW25		2000 068° → ← 248°			
RW25		GP 3.00° TCH 40			
-1.1		-1.4		-3.5 NM	
				6.1 NM	
CATEGORY		A		B	
LPV DA		208-1		200 (200-1)	
LNAV/ VNAV DA		334-1¼		326 (400-1¼)	
LNAV MDA		380-1		372 (400-1)	
CIRCLING		480-1		640-1¾ 631 (700-1¾)	