

LOC RWY 9
TELLURIDE RGNL (TEX)


MISSED APPROACH: Climb to 11800 then climbing right turn to 13500 on ETL R-104 to ETL VOR/DME and hold.

UNICOM
123.0 (CTAF) **L**



IAF
CONES
116.95 ETL $\dot{\bar{z}}$
Chan 116(Y)

LOCALIZER .. 109.3
I-TEX ::...
Chan 30
LOC offset 3.00°

DME REQUIRED

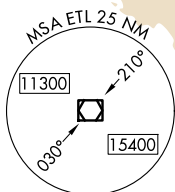

VGSI and descent angles not coincident
(VGSI Angle 3.55/TCH 46).

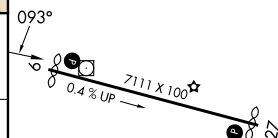

	5.6 NM		5.2 NM		1 NM
CATEGORY	A	B	C	D	
S-9	11340-1¼ 2303 (2300-1¼)	11340-1½ 2303 (2300-1½)		NA	
CIRCLING	11340-1¼ 2270 (2300-1¼)	11340-1½ 2270 (2300-1½)		NA	

HIRL Rwy 9-27 **L**
REIL Rwy 9 and 27 **L**