

WAAS CH 40428 W25A	APP CRS 263°	Rwy Ldg 12000 TDZE 5355 Apt Elev 5434
--	------------------------	--

RNAV (GPS) Y RWY 25
DENVER INTL (DEN)

DENVER INTL (DEN)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C (-13°F) or above 46°C (116°F). Simultaneous approach authorized with Rwy 26. DME/DME RNP-0.3 NA. Use of FD or AP providing track guidance required during simultaneous operations. LNAV procedure NA during simultaneous operations. For inoperative MALSR, increase LNAV/VNAV all Cais visibility to RVR 4500. # RVR 1800 authorized with use of FD or AP or HUD to DA.

MALSR



MISSED APPROACH: Climb to 10000 direct GIVTE and on track 315° to HYGEN and hold.

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 377.3 (S)	DENVER TOWER 128.75 273.55	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	--------------------------------------	---

MISSED APCH FIX

HYGEN 

RADAR REQUIRED


MSA RW25 25 NM

9800

ELEV 5434	D	TDZE 5355
-----------	----------	-----------

D

TDZE 5355

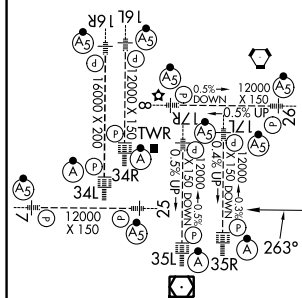

HIRL all Rwys

TDZL/RCLS Rwys 7, 16L, 16R, 17R, 26,
34L, 34R, 35L, 35R

10000

GASTE

ETHAL

10000

263°

7000

7000

1.1 NM to RW25

1.1 NM

3.8 NM

10 NM

GP 3.00°

TCH 55°

*LNAV only

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).

CATEGORY	A	B	C	D
LPV DA#	5555/24 200 (200-½)			
LNAV/ VNAV DA	5700/30 345 (300-⅝)			
LNAV MDA	5800/24 445 (400-½)		5800/45 445 (400-⅞)	

DENVER, COLORADO

Amdt 1B 07DEC17

39°52'N-104°40'W

DENVER INTL (DEN)

RNAV (GPS) Y RWY 25