


LOC/DME I-MRY 110.7 Chan 44	APP CRS 098°	Rwy Ldg 7000 TDZE 198 Apt Elev 257
---	------------------------	---

ILS or LOC RWY 10R
MONTEREY RGNL (MRY)

DME required.	MALSR	MISSED APPROACH: Climb to 600 then climbing left turn to 5000 on heading 030° and on SNS VORTAC R-243 to SNS VORTAC and hold, continue climb-in-hold to 5000. # Missed approach requires minimum climb of 265 feet per NM to 1360.
⚠ Circling NA south of Rwy 10R-28L. For inop ALS, increase S-ILS 10R all Cats visibility to RVR 6000, and increase S-LOC 10R Cat C and D visibility to 2 SM.		

ATIS 119.25	NORCAL APP CON 133.0 251.15 (001°-135°) 127.15 307.125 (136°-360°)	MONTEREY TOWER ★ 118.4 (CTAF) 257.8	GND CON 120.875 348.6	UNICOM 122.95
-----------------------	--	--	---------------------------------	-------------------------

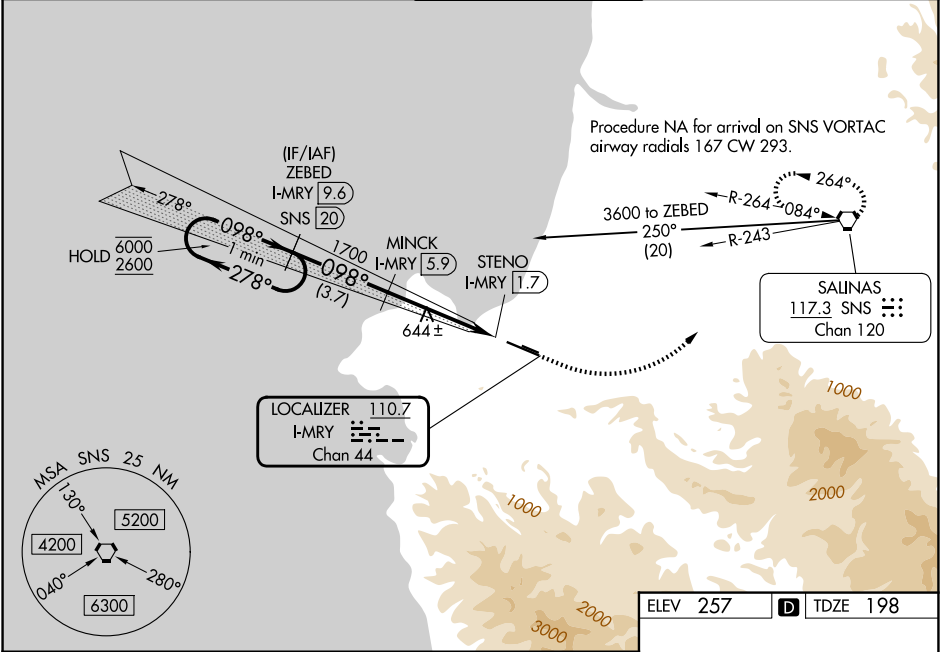

ILS unusable from 1.7 DME inbound.		ELEV 257		D TDZE 198	
One Minute Holding Pattern		ZEBED I-MRY 9.6		MINCK I-MRY 5.9	
6000 ← 278°		1700		STENO I-MRY 1.7	
2600 ← 098°		1700		0.5	
GS 3.00°		3.7 NM		2.5 NM	
TCH 45		1.7 NM		0.5	
CATEGORY	A	B	C	D	
S-ILS 10R#	398/24 200 (200-½)				
S-ILS 10R	583/35 385 (400-¾)				
S-LOC 10R	920/24 722 (700-½)		920-1½ 722 (700-1¾)		
CIRCLING	920-1 663 (700-1)		1280-3 1023 (1100-3)		NA
MIRL Rwy 10L-28R		HIRL Rwy 10R-28L		REIL Rwy 28L	
REIL Rwy 10L and 28R					