

VORTAC RIC 114.1 Chan 88	APP CRS 188°	Rwy Ldg 6607 TDZE 168 Apt Elev 168
---------------------------------------	------------------------	---


VOR RWY 20
RICHMOND INTL (RIC)

RADAR required for procedure entry. DME or RADAR required.

MISSED APPROACH: Climbing right turn to 2000 on RIC R-223 to MATOX INT/RIC 16.3 DME and hold.

T Rwy 20 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

ATIS 119.15 263.025	POTOMAC APP CON 126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	RICHMOND TOWER 121.1 257.8	GND CON 121.9 348.6
------------------------	--	-------------------------------	------------------------

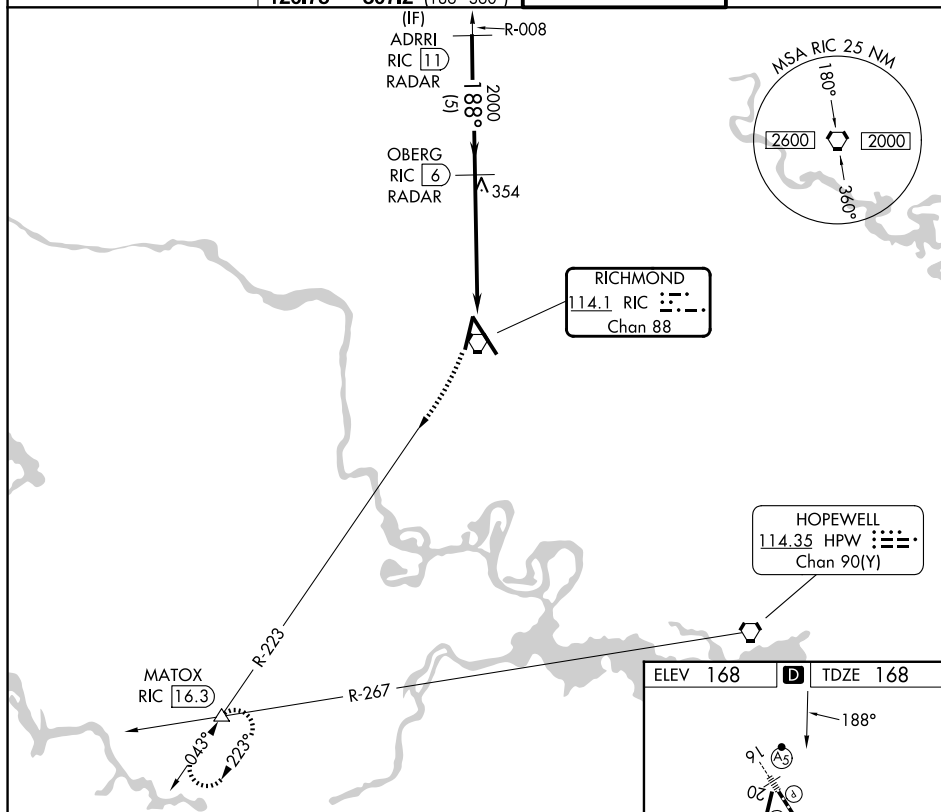

CATEGORY	A	B	C	D
S-20	660-1 492 (500-1)		660-1½ 492 (500-1½)	
CIRCLING	660-1 492 (500-1)		700-1½ 532 (600-½)	720-2 552 (600-2)

