
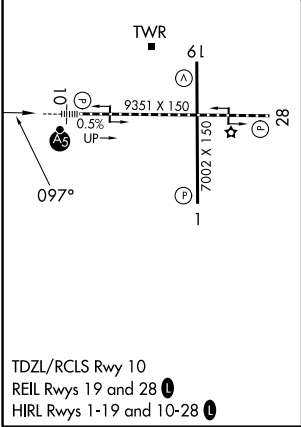


LOC I-SAV 111.35	APP CRS 097°	Rwy Ldg TDZE 30
Chan 50(Y)		Apt Elev 50

ILS or LOC RWY 10
SAVANNAH/HILTON HEAD INTL (SAV)

DME required.	MALSR	MISSED APPROACH: Climb to 800 then climbing left turn to 4000 on heading 330° and SAV VORTAC R-001 to TILLS INT/SAV 20 DME and hold.
For inop ALS, increase S-LOC 10 Cat C/D visibility to 1 3/8 SM.		

ATIS 123.75	SAVANNAH APP CON★ 125.3 371.875	SAVANNAH TOWER★ 125.975 (CTAF) 0 257.8	GND CON 121.9 348.6	UNICOM 122.95
-----------------------	---	--	-------------------------------	-------------------------

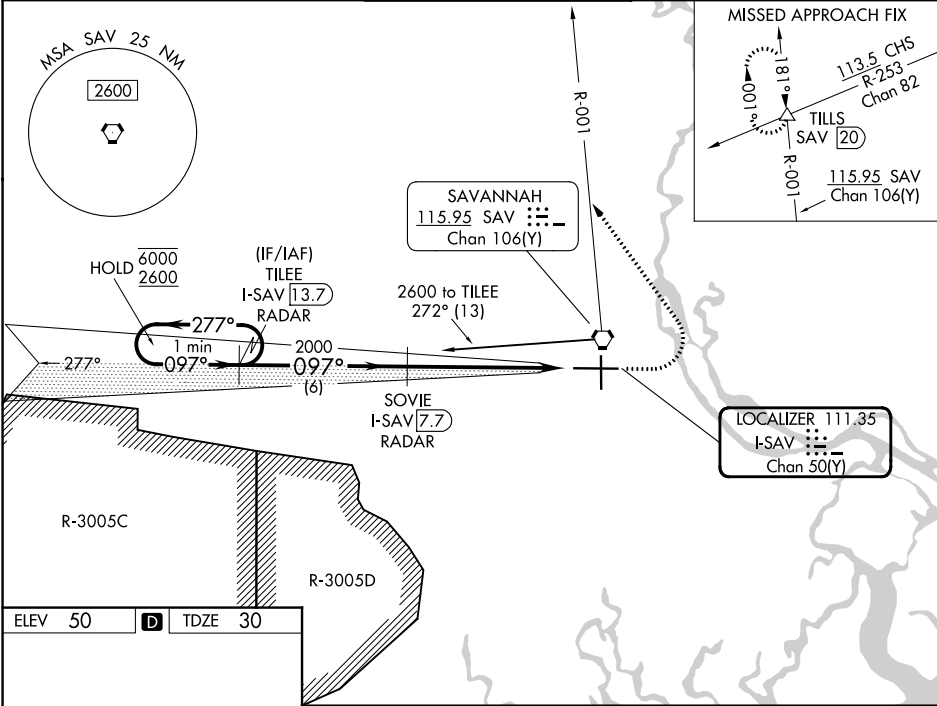

One Minute Holding Pattern	TILEE I-SAV [13.7] RADAR	SOVIE I-SAV [7.7] RADAR	800 4000 hdg 330°	SAV R-001	TILLS △
6000 2600 277° 097°	2000 097°	2000	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 69).		
GS 3.00° TCH 50			*I-SAV [3]	*I-SAV [1.7]	*LOC only
	6 NM	4.7 NM	1.3 NM		
CATEGORY	A	B	C	D	
S-ILS 10	230/18 200 (200-1/2)				
S-LOC 10	500/24	470 (500-1/2)	500/50	470 (500-1)	
CIRCLING	520-1	470 (500-1)	740-2 690 (700-2)	740-2 1/4 690 (700-2 1/4)	

SE-4, 03 SEP 2026 to 01 OCT 2026

SE-4, 03 SEP 2026 to 01 OCT 2026