

YIGO, GUAM I, GUAM

TACAN Y RWY 06R

VORTAC UNZ 115.8 Chan T05	APCH CRS 054°	Rwy Idg TDZE 557 Arprt Elev 617
---	-------------------------	---

(USAF)

ANDERSEN AFB (PGUA)

⚠ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles.
** Circling not authorized NW of Rwy 6L-24R.





MISSED APPROACH: Climb to 3000, intercept UNZ R-053 to HAAMR and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
--------------------------------	--	-----------------------------	-------------------------------

CAUTION: Environmentally Sensitive Area Flights along Anderson cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

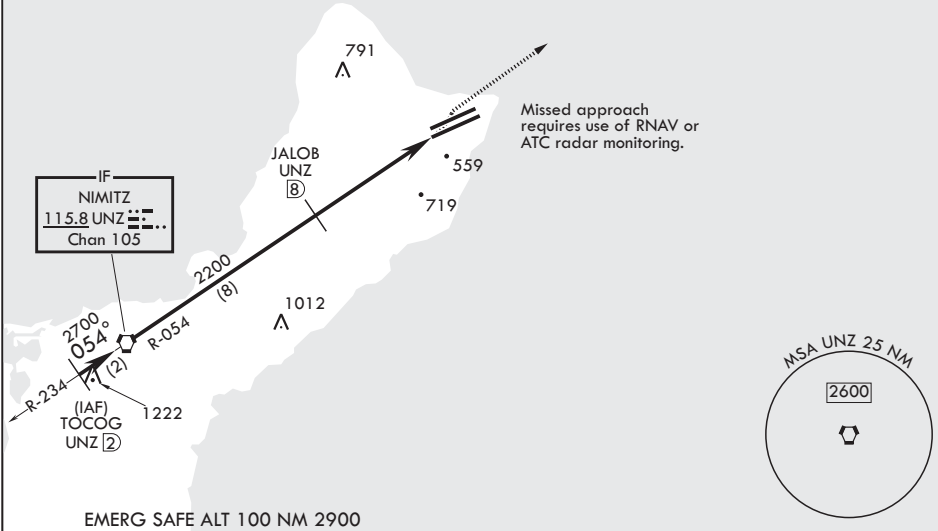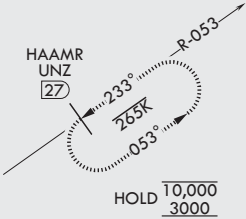

TOCOG 2	VORTAC 2700	JALOB B	CCOOK 12.9	3000 UNZ R-053	HAAMR UNZ 27	ELEV 617	TDZE 557
2700	054°	2200	11.5	4.9 NM			
3.07° TCH 44							
CATEGORY	A	B	C	D	E		
S-6R*	1060/24 503 (500-½)		1060/55 503 (500-1)				
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)		

Diagram of the final approach and landing area showing the runway (RWY 06R), taxiway (TAXI), and holding pattern. It includes the BCN TWR 735 and the HIRL all rwys.

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Y RWY 06R

PAC, 03 SEP 2026 to 29 OCT 2026

PAC, 03 SEP 2026 to 29 OCT 2026