

|                                        |                        |                                                               |
|----------------------------------------|------------------------|---------------------------------------------------------------|
| WAAS<br>CH <b>49211</b><br><b>W16B</b> | APP CRS<br><b>159°</b> | Rwy Ldg <b>8500</b><br>TDZE <b>320</b><br>Apt Elev <b>346</b> |
|----------------------------------------|------------------------|---------------------------------------------------------------|

RNAV (GPS) RWY 16R  
JACKSON-MEDGAR WILEY EVERS INTL (JAN)

RNP APCH.

**T** For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -7°C or above 54°C. Circling  
**A** NA for Cat E southwest of Rwy 16R-34L. When local altimeter setting not received, use Hawkins Fld  
ASR altimeter setting and increase all DA 19 feet and all MDA 20 feet, increase LNAV/VNAV all Cats  
and LNAV Cat C/D/E visibility  $\frac{1}{8}$  SM. Rwy 16R helicopter visibility reduction below  $\frac{3}{4}$  SM NA.  
VDP and Baro-VNAV NA when using Hawkins Fld altimeter setting.


**MISSED APPROACH:**  
Climb to 3000 direct  
FAVIN and hold.

ATIS  
**121.05**


JACKSON APP CON★  
123.9 317.7

JACKSON TOWER ★  
120.9 (CTAF) **L** 352.0

GND CON  
121.7 348.6

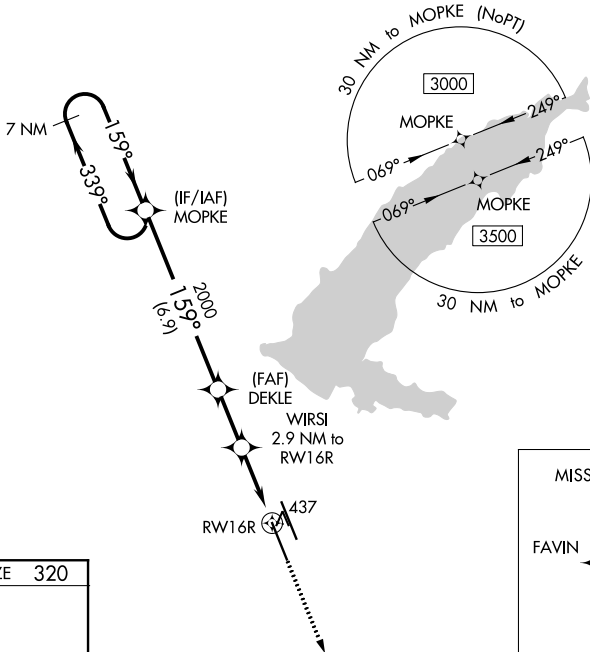UNICOM  
122.95

MISSED APCH FIX

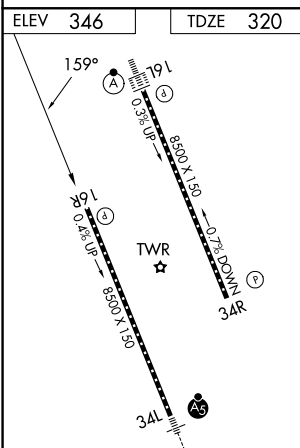

TDZL/RCLS Rwys 16L and 34L  
REIL Rwys 16R and 34R **L**  
HIRL Rwys 16L-34R and 16R-34L **L**

