

RNAV (GPS) RWY 23
WAUKEGAN NTL (UGN)


MALSR

A5

MISSED APPROACH: Climb to 2400 direct FOVOJ and hold.

GND CON
121,65

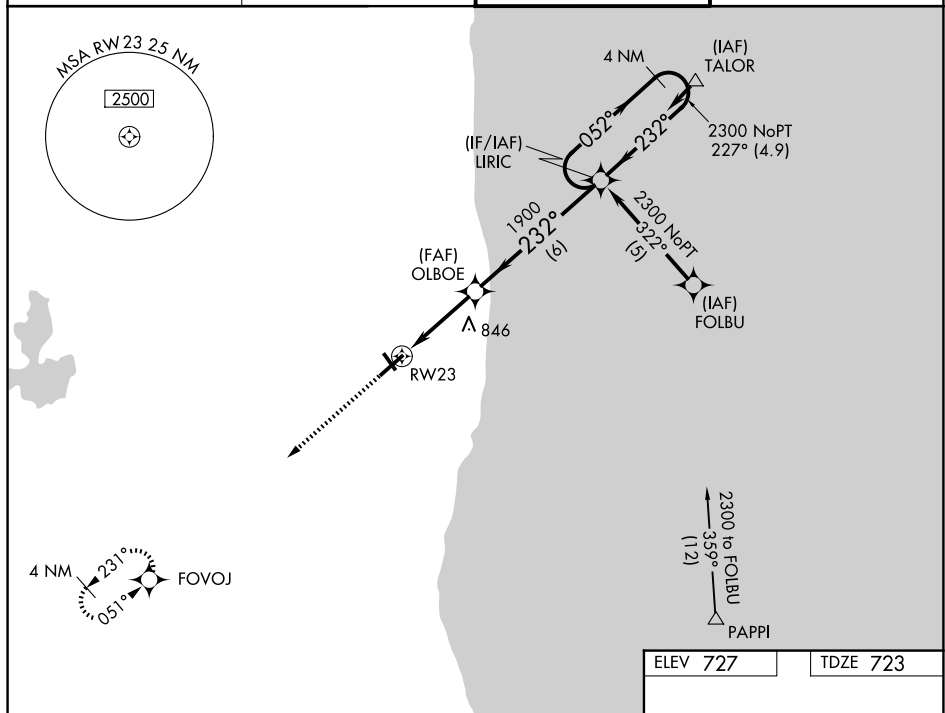

2400	FOVOJ
	


VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 52).

4 NM
Holding Pattern


* LNAV only

*1.3 NM

GP 3.00°
TCL 52



CATEGORY	A	B	C	D
LPV DA	980- $\frac{1}{2}$ 257 (300- $\frac{1}{2}$)			
RNAV/ VNAV DA	1020- $\frac{1}{2}$ 297 (300- $\frac{1}{2}$)			1020- $\frac{3}{4}$ 297 (300- $\frac{3}{4}$)
RNAV MDA	1160- $\frac{1}{2}$ 437 (500- $\frac{1}{2}$)		1160- $\frac{3}{4}$ 437 (500- $\frac{3}{4}$)	1160-1 437 (500-1)
CIRCLING	1220-1 493 (500-1)		1220-1 $\frac{1}{2}$ 493 (500-1 $\frac{1}{2}$)	1400-2 $\frac{1}{4}$ 673 (700-2 $\frac{1}{4}$)

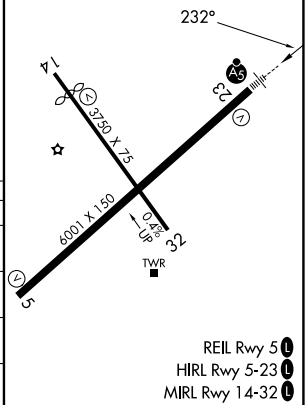

WAUKEGAN NTL (UGN)

RNAV (GPS) RWY 23