

LOC I-LQG <u>111.7</u>	APP CRS 073°	Rwy Ldg TDZE Apt Elev	5002 793 793
----------------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 7
LORAIN COUNTY RGNL (LPR)

T For inoperative MALS, increase S-LOC 7 Cats C/D visibility to 1 $\frac{3}{8}$ mile.
A VDP NA with Cleveland-Hopkins Intl altimeter setting. When local altimeter setting not received, use Cleveland-Hopkins Intl altimeter setting and increase all DA 36 feet and all MDA 40 feet.




MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 on heading 270° then left turn direct DJB VOR/DME and hold.

ASOS 118.925	CLEVELAND APP CON 125.35 346.325	CLNC DEL 125.7	UNICOM 122.7 (CTAF) 0
------------------------	--	--------------------------	---------------------------------

DME REQUIRED

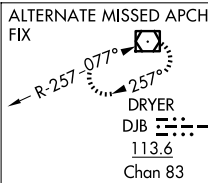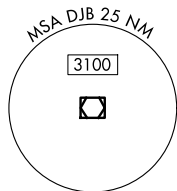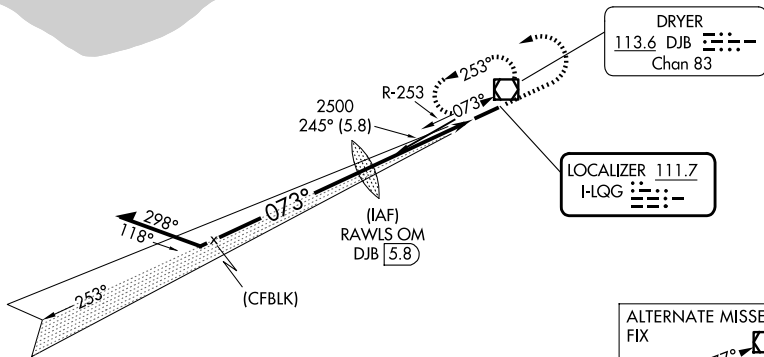

ELEV	793	TDZE	793
------	-----	------	-----

073°


5002 X 100

REIL Rwy 25

HIRL Rwy 7-25

FAF to MAP 4.4 NM

Knots	60	90	120	150	180
Min:Sec	4:24	2:56	2:12	1:46	1:28

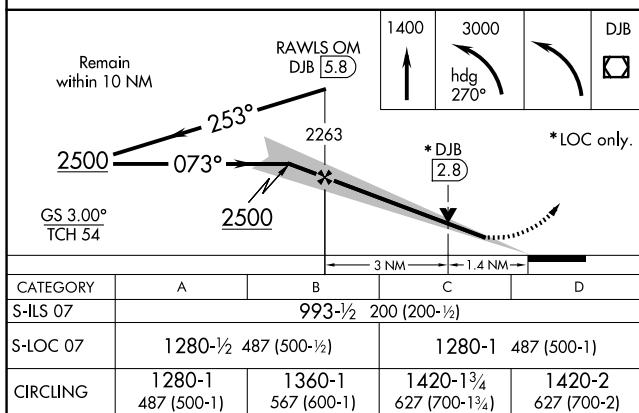

LORAIN/ELYRIA, OHIO LORAIN COUNTY RGNL (LPR)
 Amdt 7 05MAR15 41°21'N-82°11'W ILS or LOC RWY 7