

LOC/DME I-EQY <u>109.75</u> Chan 34 (Y)	APP CRS 053°	Rwy Ldg TDZE Apt Elev	7001 683 683
---	------------------------	-----------------------------	---

ILS or LOC RWY 5
CHARLOTTE/MONROE EXEC (EQY)

DME required. RADAR required for procedure entry.



Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Inop table does not apply to S-ILS 5 all Cats. For inop ALS, increase S-LOC 5 all Cats visibility to 1 SM.

MALSR

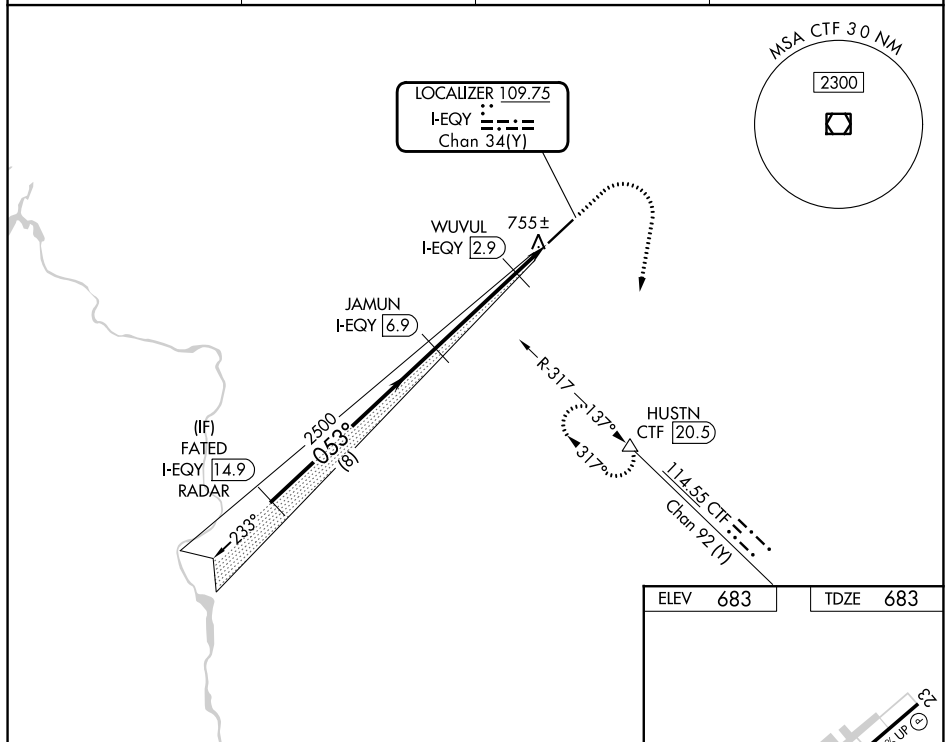


MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.

ASOS
135.775

CHARLOTTE APP CON
120.05 307.8

CLNC DEL
132.55

UNICOM
122.7 (CTAF) **L**

ELEV	683				TDZE	683			
HIRL Rwy 5-23 L REIL Rwy 23 L									
FAF to MAP 5.6 NM									
Knots	60	90	120	150	180				
Min:Sec	5:35	3:44	2:48	2:14	1:52				

FATED I-EQY 14.9 RADAR		JAMUN I-EQY 6.9		1180 ↑		3000 hdg 196°		CTR R-317		HUSTN △	
2500 GS 3.00° TCH 46		053°		2500		1220 WUVUL I-EQY 2.9		I-EQY 2.2		I-EQY 1.3	
8 NM		4 NM		0.7 NM		0.9 NM					
CATEGORY S-ILS 5		A		B		C		D			
S-LOC 5		933- ³ / ₄		250 (300- ³ / ₄)							
CIRCLING		1220-1 537 (600-1)		1220-1½ 537 (600-1½)		1480-2½ 797 (800-2½)					