

**FORT ANN****HARRIS** (83K) 2 W UTC-5(-4DT) N43°24.59' W73°31.96'

261 NOTAM FILE BTV

**RWY 04-22:** 2200X50 (TURF) 1.7% up SW**RWY 04:** Tree. Rgt tfc.**RWY 22:** Tree.**AIRPORT REMARKS:** Unattended. No flying west of rwy over houses. Upslope at thld Rwy 22.**AIRPORT MANAGER:** (518) 361-1380**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Albany Apch at 518-862-2299.

NEW YORK

**FRANCIS S GABRESKI** (See WESTHAMPTON BEACH on page 255)**FRANKFORT-HIGHLAND** (See UTICA/FRANKFORT on page 251)**FREEHOLD** (115) 1 NW UTC-5(-4DT) N42°21.84' W74°03.90'

440 NOTAM FILE BTV

**RWY 12-30:** H2275X22 (ASPH) 0.7% up NW**RWY 12:** Fence.**RWY 30:** Brush.**AIRPORT REMARKS:** Attended Apr-Dec 1400Z±-dusk. Extensive glider activity, especially on weekends. Rwy 12-30 sfc broken and spalling for entire length. Ctc arpt manager for fld conditions Dec 1-Apr 1, 518-966-8503. Rgt tfc for gliders Rwy 12 only. Rwy 12-30 100' by 2640' turf rwy adjacent to paved rwy (south edge) beginning at 735' from Rwy 30 thld.**AIRPORT MANAGER:** 518-966-8503**COMMUNICATIONS:** CTAF 122.85**CLEARANCE DELIVERY PHONE:** For CD ctc Albany Apch at 518-862-2299.

NEW YORK

**FRIKK** N40°46.59' W73°28.95' NOTAM FILE FRG.**NDB (LOM)** 407 FR 146° 4.3 NM to Republic. 153/14W.**FULTON****OSWEGO CO** (FZY)(KFZY) 3 NE UTC-5(-4DT) N43°21.05' W76°23.28'

475 B NOTAM FILE FZY

**RWY 15-33:** H5196X100 (ASPH-GRVD) S-30 HIRL 0.6% up SE**RWY 15:** REIL. Pole.**RWY 33:** REIL. PAPI(P4L)—GA 3.55° TCH 38'. Thld dsplcd 414'. Fence.**RWY 06-24:** H3997X100 (ASPH-GRVD) S-38, D-70 MIRL

0.3% up NE

**RWY 06:** REIL. Trees.**RWY 24:** REIL. Pole.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 33:** TORA-5196 TODA-5196 ASDA-5196 LDA-5196**SERVICE:** S4 FUEL 100LL, JET A LGT HIRL Rwy 15-33 and PAPI Rwy

33 preset low ints SS-SR, to increase ints ACTIVATE—CTAF.

ACTIVATE REIL Rwy 15-33, MIRL Rwy 06-24, PAPI Rwy 33—CTAF.

**AIRPORT REMARKS:** Attended Mon-Fri 1230-2100Z±, Sat-Sun

1300-2130Z±. Attendance other hrs, call arpt manager. Rwy

conditions may not be monitored or reported when arpt is unattended.

During periods of snow removal operations Nov 1 thru Apr 1 acft must

ctc arpt on freq 123.0 10 minutes prior to ldg. Deer and birds on or

invof arpt. Ultralight activity on and invof arpt. Acft de-icing avbl, ctc

arpt manager at 315-591-9130. Rwy 33 designated calm wind rwy.


Grass cutting equipment operations adjacent to all operational surfaces daylight hours May thru Oct.

**AIRPORT MANAGER:** 315-591-9130**WEATHER DATA SOURCES:** ASOS 119.275 (315) 598-8773.

NEW YORK

H-11C, 12I, L-32F

IAP, AD

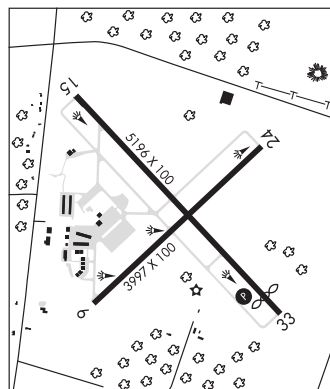

CONTINUED ON NEXT PAGE

COMMUNICATIONS: CTAF/UNICOM 123.0

① SYRACUSE APP/DEP CON 126.125

CLEARANCE DELIVERY PHONE: For CD ctc Syracuse Apch at 315-455-6218.

RADIO AIDS TO NAVIGATION: NOTAM FILE SYR.

SYRACUSE (H) VORTACW 117.0 SYR Chan 117 N43°09.63' W76°12.27' 336° 14.0 NM to fld. 453/11W.

TACAN AZIMUTH & DME unusable:

Byd 35 NM blo 4,000'

VOR unusable:

010°-025°

067°-077° byd 30 NM

134°-144° byd 19 NM

FALLN NDB (LOMW) 220 FZ N43°17.25' W76°18.28' 329° 5.3 NM to fld. 417/13W. NOTAM FILE FZY.

ILS/DME 110.9 I-FZY Chan 46 Rwy 33. Class IT. LOM FALLN NDB.

**FULTON CO** (See JOHNSTOWN on page 214)

**GALLUPVILLE**

**BLUE HERON** (N25) 3 NE UTC-5(-4DT) N42°41.84' W74°11.97'

NEW YORK

1200 NOTAM FILE BTV

RWY 09-27: 2600X70 (TURF)

RWY 09: Road.

RWY 27: Trees.

AIRPORT REMARKS: Attended Apr-Oct dawn-dusk. Ctc arpt manager for fld conditions during winter and Apr-May. Rwy 27; +40'-100' trees, across thld.

AIRPORT MANAGER: 518-872-2638

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.

**GANSEVOORT**

**HEBER AIRPARK** (K3Ø) 2 SE UTC-5(-4DT) N43°11.00' W73°37.99'

NEW YORK

230 NOTAM FILE BTV

RWY 06-24: H2200X24 (ASPH) MIRL(NSTD)

RWY 06: Thld dsplcd 200'. Road. Rgt tfc.

RWY 24: Tree.

SERVICE: LGT ACTIVATE NSTD MIRL Rwy 06-24—CTAF.

AIRPORT REMARKS: Unattended. Birds and wildlife on and invof arpt. 25' dropoff 10' from Rwy 24 thld. Rwy 24 uphill grade exceeds 2% up. Recommended Idg Rwy 24, tkf Rwy 06. Skydiving on and invof arpt May-Oct. Lgt colored full width conc pavement section 144' from Rwy 24 thld, 20' long. Golf course adjacent to rwy both sides.. Rwy 06-24 NSTD MIRL due to spacing, 33' from rwy edge on 3' wood posts. Rwy 06-24 NSTD dsplcd thld, no bar.

AIRPORT MANAGER: 518-793-8983

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.

**GANSE** N43°15.30' W73°36.31' NOTAM FILE GFL.

NEW YORK

NDB (LOMW) 209 GF 011° 5.2 NM to Floyd Bennett Mem. 228/14W.

**GARNSEYS** (See SCHUYLERVILLE on page 245)

**GASPORT**

**ROYALTON** (9G5) 1 SE UTC-5(-4DT) N43°10.92' W78°33.47'

DETROIT

628 NOTAM FILE BUF

RWY 07-25: H2530X35 (ASPH) MIRL

RWY 07: Road.

RWY 25: Thld dsplcd 300'. Tree.

SERVICE: FUEL 100LL, MOGAS LGT ACTIVATE MIRL Rwy 07-25—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z±. Ultralghts on and invof arpt.

AIRPORT MANAGER: 716-804-6857

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

**GENESEE CO** (See BATAVIA on page 188)