

DUBUQUE RGNL (DBQ)(KDBQ) 7 SW UTC-6(-5DT) N42°24.12' W90°42.57'

1077 B ARFF Index—See Remarks NOTAM FILE DBQ

RWY 13-31: H6502X100 (CONC-GRVD) S-75, D-125, 2S-159, 2D-215 PCN 57 R/C/X/T HIRL**RWY 13:** MALS. PAPI(P4R)—GA 3.0° TCH 44'.**RWY 31:** MALS. PAPI(P4L)—GA 3.0° TCH 57'. Pole.**RWY 18-36:** H6327X150 (CONC-GRVD) S-75, D-173, 2S-175, 2D-275 PCN 59 R/C/X/T HIRL 0.6% up N**RWY 18:** PAPI(P4L)—GA 3.0° TCH 34'. RVR-R**RWY 36:** MALS. PAPI(P4L)—GA 3.0° TCH 51'. RVR-T**LAND AND HOLD—SHORT OPERATIONS**

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 31	18-36	4800
RWY 36	13-31	4900

RUNWAY DECLARED DISTANCE INFORMATION**RWY 13:** TORA-6502 TODA-6502 ASDA-6502 LDA-6502**RWY 18:** TORA-6327 TODA-6327 ASDA-6327 LDA-6327**RWY 31:** TORA-6502 TODA-6502 ASDA-6502 LDA-6502**RWY 36:** TORA-6327 TODA-6327 ASDA-6327 LDA-6327**SERVICE:** S4 FUEL 100LL, JET A1+ OX 1, 3 LGT When twr clsd

ACTIVATE HIRL Rwy 13-31 and Rwy 18-36, MALS Rwy 13, MALS Rwy 31 and Rwy 36 and PAPI Rwy 13, Rwy 18, Rwy 31 and Rwy 36—CTAF.

AIRPORT REMARKS: Attended continuously. Fuel svc avbl 24 hrs. For fuel 0400-1100Z† call 563-589-4136. 100LL self service fuel station avbl at T-hangars 24 hrs. Waterfowl on and invof arpt. Cold temperature restricted arpt. Altitude correction required at or below -34°C/-29°F. Class I, ARFF Index A. PPR for unscheduled air carrier ops call arpt manager 563-589-4136. ARFF Index B level equipment is provided. Act departing Rwy 36, the apch ends of Rwy 31 and Rwy 18 are not visible for approximately the first 3000' of tkf roll.**AIRPORT MANAGER:** 563-589-4136**WEATHER DATA SOURCES:** ASOS (563) 557-2579 LAWRS.**COMMUNICATIONS:** CTAF 119.5 ATIS 127.25 UNICOM 122.95

RCO 122.05 (FORT DODGE RADIO)

Ⓡ CHICAGO CENTER APP/DEP CON 133.95

TOWER 119.5 (1200-0200Z†) GND CON 121.8

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Chicago ARTCC at 630-906-8921.**AIRSPACE:** CLASS D svc 1200-0200Z†; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DBQ.

(H) VORTACW 115.8 DBQ Chan 105 N42°24.09' W90°42.54' at fld. 1051/4E.

TACAN AZIMUTH unusable:

170°-265° blo 17,500'

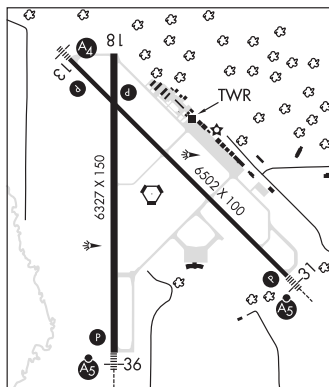
DME unusable:

171°-199°

ZILOM NDB (LOMW) 341 DB N42°19.38' W90°35.92' 310° 6.8 NM to fld. 964/4E.

LOC/DME 108.7 I-DBQ Chan 24 Rwy 31. LOM ZILOM NDB. Unmonitored when ATCT clsd. Backcourse unusable wi 1.1 NM; byd faf abv 3,100' or 1.3 NM fm thr abv 1,700'; byd 21° right of course. DME unusable byd 10 NM.

ILS/DME 110.9 I-FUQ Chan 46 Rwy 36. Class IE.

COMM/NAV/WEATHER REMARKS: Emergency frequency 121.5 not avbl at twr.CHICAGO
H-5D, L-28G
IAP, AD**DYERSVILLE AREA** (IA8) 2 NW UTC-6(-5DT) N42°29.77' W91°10.79'

980 NOTAM FILE FOD

RWY 11-29: 2700X120 (TURF) LIRL(NSTD) 0.4% up W**RWY 11:** Thld dsplcd 200'. Ground.**RWY 29:** Thld dsplcd 175'. Road. Rgt ttc.**SERVICE:** LGT ACTIVATE LIRL Rwy 11-29—CTAF. Rwy 11-29 NSTD LIRL, cones with lights.**AIRPORT REMARKS:** Unattended. Remote controlled aircraft invof arpt. Rwy 11-29 NSTD markings, rwy edges marked with yellow cones, dsplcd thlds marked with 3 yellow cones each side.**AIRPORT MANAGER:** 563-875-7121**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago ARTCC at 630-906-8921.

CHICAGO