

**BANGOR**

**BANGOR INTL** (BGR)(KBGR) P (ANG ARNG) 3 W UTC-5(-4DT) N44°48.45' W68°49.69'  
 192 B TPA—See Remarks LRA ARFF Index—See Remarks NOTAM FILE BGR

**HALIFAX**  
**H-110, L-321**  
**IAP, DIAP, AD**

**RWY 15-33:** H11440X200 (ASPH-GRVD) S-100, D-210, 2D-400  
 PCN 120R/A/W/T HIRL CL

**RWY 15:** ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 55'. RVR-TMR 0.4% down.

**RWY 33:** MALSR. PAPI(P4L)—GA 3.0° TCH 57'. RVR-TMR Trees.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 15:** TORA-11440 TODA-11440 ASDA-11440 LDA-11440

**RWY 33:** TORA-11440 TODA-11440 ASDA-11440 LDA-11440

**SERVICE:** S4 FUEL 100LL, JET A OX 2, 4 MILITARY—JASU 1(MD-3) 1(MC-11) (MA-1A) FUEL A++ (Mil), A, A+ (C207-992-4600)

(NC-100LL) FLUID SP PRESAIR LPOX LOX – Foreign mil only: On-base LOX svc unavl. Off-base contracted LOX avbl H24-rqr 24 hr notice.

**OIL** O-133-148(Mil) **TRAN ALERT** Opr 1130-0200Z† Mon–Thu, 1130-1900Z‡ Fri, clsd weekend and hol. Unavl outside of ANG Tran Alert opr hrs without prior coord.

**AIRPORT REMARKS:** Attended continuously. TPA for turbo jet acft is 2000(1808) unless otherwise instructed. ARFF Index B with Index E capabilities avbl 24/7. Flight Notification Service (ADCUS) available.

**MILITARY REMARKS:** Transient acft may be diverted to civilian side during non-duty hrs & weekends. Fee required; no ANG transient alert.

**CAUTION** Bash Phase II period Sep–Nov, Apr–May. Expect increased bird activity. Ctc Base Ops/Command Post/SOF for current bird watching conditions. **MISC** Rwy 15-33 grooved. **ANG** Opr 1100-1930Z‡ Mon–Fri, clsd weekends and hol. PPR rqr for ANG ramp. Ctc afd mgmt DSN 698-7232, C207-404-7232 for PPR dur opr hrs. Pre-coord all transportation requirements and and haz cargo with PPR rqr. PPR valid +/- 1 hr unless prior coord. 3 hr out call, 30 min out call 311.0 to CFM customs/AG and tran svc. Comd post C207-404-7788 24 hrs. **ARNG** Opr 1230-2100Z† Mon–Fri exc hol. Ltd maint. J8. PPR May–Oct svc DSN 626-1100.

**AIRPORT MANAGER:** 207-992-4600

**WEATHER DATA SOURCES:** ASOS 127.75 (207) 561-2515.

**COMMUNICATIONS:** ATIS 127.75 (207-561-2524) UNICOM 122.95

RCO 122.2 (BANGOR RADIO)

Ⓡ APP/DEP CON 118.925 124.5

TOWER 120.7 GND CON 121.9 CLNC DEL 135.9

**AIRSPACE:** CLASS C svc ctc APP CON.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE BGR.


(H) VORTACW 114.8 BGR Chan 95 N44°50.51' W68°52.44' 155° 2.8 NM to fld. 360/19W.

ILS/DME 109.5 I-JVH Chan 32 Rwy 15. Class IIIE. DME also serves Rwy 33.

ILS/DME 109.5 I-BGR Chan 32 Rwy 33. Class IIE. DME also serves Rwy 15. DME unusable byd 26° r of course.

ASR

HELIPAD H1: H100X100 (CONC)

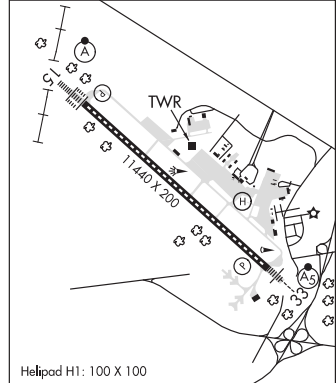

**LUCKY LANDING MARINA AND SPB SPB** (Ø6B) 7 N UTC-5(-4DT) N44°54.42' W68°48.30'  
 115 NOTAM FILE BGR

**HALIFAX**

**WATERWAY 02W-20W:** 15000X4000 (WATER)

**WATERWAY 02W:** Rgt tfc.

**SERVICE:** S2 FUEL 100LL

**SEAPLANE REMARKS:** Attended Apr–Oct dalgt hrs, unattended Nov–Mar. To verify conditions and for fuel after hrs call

207-951-2406. Water ldg area not marked. Rwy 02W wires on shore marked.

**AIRPORT MANAGER:** (207) 951-2406

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Bangor Apch at 207-561-2521.

**BANKS** (See SWANS ISLAND on page 83)