

PRESQUE ISLE INTL (PQI)(KPQI) 1 NW UTC-5(-4DT) N46°41.34' W68°02.69'

HALIFAX

534 B LRA ARFF Index—See Remarks NOTAM FILE PQI MON Airport

H-11D, L-32I

RWY 01-19: H7441X150 (ASPH) S-100, D-150, 2D-240

IAP

PCN 94 F/A/W/T HIRL 1.1% up N

RWY 01: MALSR.

RWY 19: REIL. PAPI(P4L)—GA 3.7° TCH 50'. Trees.

RWY 10-28: H6000X100 (ASPH) S-100, D-150, 2D-240

PCN 94 F/A/W/T MIRL

RWY 28: PAPI(P4L)—GA 3.0° TCH 45'. Railroad.

SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTIVATE MALSR Rwy 01, REIL Rwy 19, PAPI Rwys 19 and 28, HIRL Rwy 01-19, MIRL Rwy 10-28—122.6.

AIRPORT REMARKS: Attended 1100-0000Z. ARFF Index clsd to unscheduled air carrier ops with more than 30 passenger seats, exc PPR call arpt manager 207-764-2550. PAEW adjacent to rwys and twys (mowing) May 1 thru Nov 1. Cold temperature rstd arpt. Altitude correction required at or blo -30°C. Caution small UAS activity fm sfc to 400-AGL (1040-MSL) 3.5 NM south of afld dur dalgt hrs. Flight Notification Service (ADCUS) available.

AIRPORT MANAGER: 207-764-2550

WEATHER DATA SOURCES: AWOS-3PT 118.025 (207) 764-7248.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **BOSTON CENTER APP/DEP CON** 124.75 **CLNC DEL** 121.6

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

AIRSPACE: CLASS E svc 1000-0200Z Mon-Sat, 1300-0200Z Sun; other times CLASS G.


RADIO AIDS TO NAVIGATION: NOTAM FILE PQI.

(H) **VORW/DME** 116.4 PQI Chan 111 N46°46.45' W68°05.67' 179° 5.5 NM to fld. 592/21W.

DME portion unusable:

180°-200° byd 30 NM blo 3,400'

ILS 108.7 I-PQI Rwy 01. Class IE. Unmonitored indef.

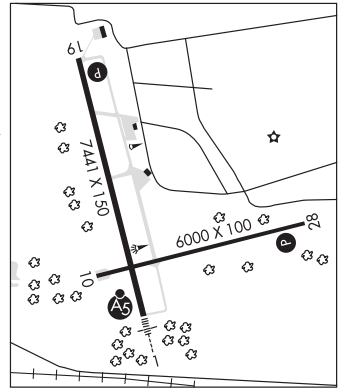

PRESQUE ISLE N46°46.45' W68°05.67' NOTAM FILE PQI.

HALIFAX

(H) **VORW/DME** 116.4 PQI Chan 111 179° 5.5 NM to Presque Isle Intl. 592/21W.

H-11D, L-32I

DME portion unusable:

180°-200° byd 30 NM blo 3,400'

PRINCETON MUNI (PNN)(KPNN) 2 S UTC-5(-4DT) N45°12.04' W67°33.86'

HALIFAX

265 B LRA NOTAM FILE BGR

L-32I

RWY 15-33: H4007X75 (ASPH) S-31, D-38 MIRL 0.3% up NW

IAP

RWY 15: PAPI(P4L)—GA 3.5° TCH 44'.

RWY 06-24: H3998X150 (ASPH)

RWY 06: Trees.

RWY 24: Thld dspclcd 503'. Trees.

SERVICE: **FUEL** 100LL **LGT** ACTVT MIRL Rwy 15-33 and PAPI Rwy 15—CTAF.

AIRPORT REMARKS: Unattended. Rwy 06-24 CLOSED to acct indef—pavement unusable. Fuel avbl 24 hrs with major credit card. Wildlife on or invof arpt. Rwy 06-24 mkd with yellow closure at both ends and middle of rwy. Other mkg are not visible. Flight Notification Service (ADCUS) available.

AIRPORT MANAGER: 207-214-5144

WEATHER DATA SOURCES: AWOS-AV 122.7.

COMMUNICATIONS: CTAF/AUNICOM 122.7

BOSTON CENTER APP/DEP CON 124.25

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.

(L) **DME** 114.3 PNN Chan 90 N45°19.75'

W67°42.25' 142° 9.7 NM to fld. 398/OE.

DME unusable:

300°-330° byd 25 NM blo 4,500'

COMM/NAV/WEATHER REMARKS: Automated UNICOM; 3 clicks.

