

DILLINGHAM

DILLINGHAM (DLG)(PADL) 2 W UTC-9(-8DT) N59°02.68' W158°30.33'
82 B ARFF Index—See Remarks NOTAM FILE DLG

KODIAK
H-1B, 2J, L-2J, 3C
IAP

RWY 01-19: H6400X150 (ASPH-GRVD) S-116, D-186, 2D-300,
2D/2D2-726 PCN 54 F/C/X/T HIRL

RWY 01: PAPI(P4L)—GA 3.0° TCH 45'.

RWY 19: ODALS. REIL. VASI(V4L)—GA 3.0° TCH 57'. Trees. Rgt tfc.


RUNWAY DECLARED DISTANCE INFORMATION

RWY 01: TORA-6400 TODA-6400 ASDA-6400 LDA-6400

RWY 19: TORA-6400 TODA-6400 ASDA-6400 LDA-6400

SERVICE: S2 **FUEL** 100LL, **JET A** **LGT** When DLG FSS clsd, ACTVT
ODALS Rwy 19; PAPI Rwy 01; VASI Rwy 19; HIRL Rwy
01-19—CTAF. Rotg bcn lctd on twr at ARFF bldg; opers unmonitored
when DLG FSS unmanned.

AIRPORT REMARKS: Attended 1700-0330Z†. TSA regulated arpt. See 49
CFR 1542. Increased migratory bird activity during the spring and fall
season. All gates and doors must be secured at all times. Transient or
unfamiliar pilots contact arpt mgr with questions. Sn removal, wildlife
ctl, cond rprtng, and other afld maint svcs only avbl and valid dur arpt
attendance duty hrs. Ctc arpt mgmt for any after hrs req for afld svcs.
For fuel call 907-842-1234 or 907-842-2400. After hrs call
907-843-1590 or 907-252-7625. PPR only for arpt hazard
reporting rwy, twy or ramp snow ctl. Class I, ARFF Index B. CLOSED
to air carrier ops with more than 30 pax seats exc PPR in writing to arpt mgr Box 250 Dillingham AK 99576. Tlks and
ldgs on twys and ramp prohibited. ARFF eqpt staffed dur periods of air carrier activity only. Personnel and eqpt may be
working on the rwy at any time. Rwy lghts are 30" high. Rwy 19 trees in apch 1300' from thld. Ltd transit facility parking.
Tran parking designated with green cones. Rwy safety area dimensions on south 3600' (3600' x 300'), north 3289'
(3289' x 200'). Arpt sand larger gradation than FAA recommended/see AC150/5200-30. Lock wheeled turns prohibited
on any sfc. When the wind is from the southwest, the AWOS wind reading may be unreliable due to trees in close proximity
to the sensors.

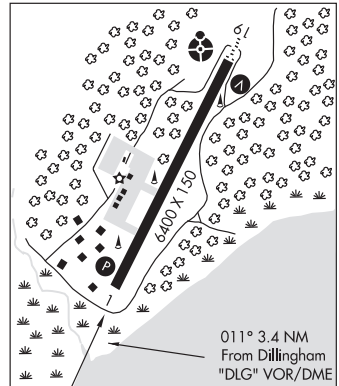

AIRPORT MANAGER: 907-842-5511

WEATHER DATA SOURCES: AWOS-3P 125.0 (907) 842-2137. AWOS-3p avbl when dlg fss clsd. (WX CAM)

COMMUNICATIONS: CTAF 123.6 AFIS 125.0 (1645-0645Z† OT ctc Kenai FSS)

FSS DLG (DILLINGHAM) 1645-0645Z† OT ctc Kenai FSS.

DILLINGHAM RADIO 121.5 122.3 (LAA 123.6)

RCO 121.5 122.3 123.6 (KENAI RADIO)

ANCHORAGE CENTER APP/DEP CON 132.75 282.35

AIRSPACE: CLASS E svc 1645-0845Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DLG.

(H) (H) **VOR/DME** 116.4 DLG Chan 111 N58°59.65' W158°33.13' 011° 3.4 NM to fld. 81/15E.

WOOD RIVER NDB (MHW) 429 BTS N58°59.98' W158°32.90' 011° 3.0 NM to fld. 134/15E.

LOC/DME 111.9 I-DLG Chan 56 Rwy 19. LOC unusable within 0.7 NM (1.8 DME) inbound.

COMM/NAV/WEATHER REMARKS: For a local call to Dillingham FSS dial 907-842-5275. For a toll free call to Kenai FSS dial
1-866-864-1737. AFIS operd by DLF FSS when open, OT Kenai FSS.

NUSHAGAK (AK21) PVT 22 N UTC-9(-8DT) N59°07.96' W157°46.63'

KODIAK

40 NOTAM FILE Not insp.

RWY 16-34: 1000X50 (TURF)

AIRPORT REMARKS: Unattended. Rwy 16-34 soft during break-up and when wet.

AIRPORT MANAGER: 907-688-2084

COMM/NAV/WEATHER REMARKS: For a local call to Dillingham FSS dial 907-842-5275. For a toll free call to Kenai FSS dial
1-866-864-1737.