


CONCORD MUNI (CON)(KCON) P (ARNG) 2 E UTC-5(-4DT) N43°12.16' W71°30.14'
 342 B NOTAM FILE CON

NEW YORK
 H-11D, 12K, L-32H
 IAP, AD

RWY 17-35: H6005X100 (ASPH) S-43, D-60 HIRL
RWY 17: PAPI(P4L)—GA 3.0° TCH 50'. Thld displd 641'. Tree.
RWY 35: MALSR. VASI(V4L)—GA 3.0° TCH 50'. Trees.
RWY 12-30: H3200X75 (ASPH) S-30 MIRL
RWY 12: PAPI(P2L)—GA 3.32° TCH 52'. Trees.
RWY 30: Trees.

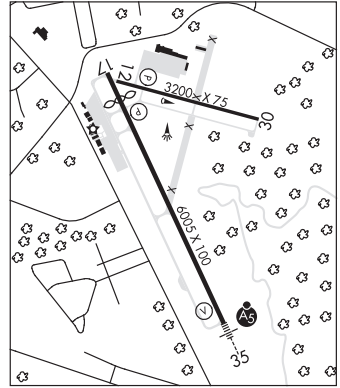

SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTIVATE MALSR Rwy 35, HIRL Rwy 17-35, MIRL Rwy 12-30—CTAF. **MILITARY—FUEL** J8(Mil)—PPR (NC-100LL - Avbl H24 with credit card; A - Avbl 1230-2200Z±, OT fone C603-228-2267 and flw prompts.)

AIRPORT REMARKS: Attended 1200-2200Z±, exc Thanksgiving, Christmas, and New Years Day. Wildlife on and invof arpt. Hvy hel act 1 NM ESE of arpt 800 ft & blw. Self serve 100LL avbl 24 hrs with credit card. For Jet A aft hrs call 603-228-2267 & flw prompts. Rwy 35 designated calm wind rwy. Day & ngt VFR hel ops to & fm New Hampshire State Police hngr. Ops on National Guard twy & ramp prohibited wo prior cdm due to scety. Mil twy & ramp PCN R/A/W/T. Ops off paved sfcs prohibited due to conservation mgmt acts. Compass rose calibrated 2014.

AIRPORT MANAGER: 603-228-2267
WEATHER DATA SOURCES: ASOS 132.325 (603) 224-6558.
COMMUNICATIONS: CTAF/UNICOM 122.7

- RCO 122.2 (BANGOR RADIO)
- Ⓡ BOSTON APP/DEP CON 127.35
- CLNC DEL 133.65

CLEARANCE DELIVERY PHONE: For CD ctc Boston Apch at 603-594-5552.
AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE CON.
 (L) (L) VORW/DME 112.9 CON Chan 76 N43°13.19' W71°34.53' 123° 3.4 NM to fld. 715/15W.

- VOR unusable:
 - 022°-032° byd 20 NM blo 8,000'
 - 190°-210° byd 12 NM blo 4,000'
 - 318°-326° byd 30 NM blo 12,000'
- DME unusable:
 - 022°-032° byd 20 NM blo 8,000'
 - 082°-110° byd 30 NM blo 5,000'
 - 190°-210° byd 12 NM blo 4,000'
 - 290°-300° byd 30 NM blo 7,000'
 - 318°-326° byd 30 NM blo 12,000'

EPSOM NDB (LOM) 216 CO N43°07.13' W71°27.16' 353° 5.5 NM to fld. NDB unusable byd 20 NM.
 ILS 108.7 I-CON Rwy 35. Class IA. LOM EPSOM NDB. NDB unusable byd 20 NM.

DEAN MEML (See HAVERHILL on page 151)

DILLANT/HOPKINS (See KEENE on page 152)

EPSOM N43°07.13' W71°27.15' NOTAM FILE CON.
NDB (MHW/LOM) 216 CO 353° 5.5 NM to Concord Muni. 355/16W.
 NDB unusable:
 Byd 20 NM

NEW YORK
 L-32H, 33D

ERROL (ERR)(KERR) 1 NW UTC-5(-4DT) N44°47.53' W71°09.87'
 1248 TPA—2048(800) NOTAM FILE BGR
RWY 15-33: 3600X60 (GRVL) 0.3% up SE
RWY 15: Trees.
RWY 33: Trees.

MONTREAL

AIRPORT REMARKS: Unattended. For arpt information and conditions, call 603-482-3320. Wildlife on and invof arpt. Regular construction vehicle tfc on roadway at Rwy 33 end. 1:1 clearance slope. Rwy soft in spring. Large patches of grass on rwy.
AIRPORT MANAGER: 214-724-5127
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

HELIPAD H1: H61X61 (ASPH)
HELIPORT REMARKS: ACTIVATE helipad flood lgt and lighted windcone—CTAF.