

SPICEWOOD (88R) 2 E UTC-6(-5DT) N30°28.43' W98°07.29'

SAN ANTONIO

830 NOTAM FILE SJT

L-19C

RWY 17-35: H4185X38 (ASPH) S-12.5**RWY 17:** Thld dspclcd 464'. Tree.**RWY 35:** Trees.**SERVICE:** FUEL 100LL, JET A LGT No runway or twy lighting.**AIRPORT REMARKS:** Attended irregularly. Arpt clsd at night exc for hel, medevac and mil flts. Arpt clsd to jet and turbo jet acft, exc for very light jets. Arpt clsd to tgl, ultralights and hang gldrs. Arpt clsd to acft over 12,500 GWT. Be alert for deer on and invof arpt. Arpt/rwy not perimeter fenced. Narrow rwy with soft, unimproved edges. Non-paved sfc extremely soft ground. Vehicular tfc on twys. No line of sight btn rwy ends. Rwy 17 calm wind rwy. No rotocraft ops less than 500 AGL north of Rwy 17 thr to avoid residential area. No rotocraft ops practice or autorotation ops allowed. Rotocraft arr and dep fly dctly to and fm prkg to avoid unec low-level txx.**AIRPORT MANAGER:** 830-201-3111**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Austin Apch at 512-369-7865.**RADIO AIDS TO NAVIGATION:** NOTAM FILE AUS.**CENTEX (H) (H) VORTACW** 112.8 CWK Chan 75 N30°22.71' W97°31.79' 275° 31.2 NM to fld. 593/6E.**STAMFORD****ARLEDGE FLD** (F56) 4 SE UTC-6(-5DT) N32°54.63' W99°44.05'

DALLAS-FT WORTH

1561 B NOTAM FILE FTW

L-17B

RWY 17-35: H3707X60 (ASPH) S-4 MIRL

IAF

RWY 17: Road.**RWY 08-26:** 2211X50 (TURF)**RWY 08:** Road.**RWY 13-31:** 1702X50 (TURF-GRVL) 0.3% up NW**RWY 13:** Road.**RWY 31:** Road.**SERVICE:** S4 FUEL 100LL LGT Actvt MIRL Rwy 17-35-CTAF.**AIRPORT REMARKS:** Unattended. Farm equipment invof arpt. Rwys 08-26 and 13-31 have rough sfc.**AIRPORT MANAGER:** 325-773-2591**COMMUNICATIONS:** CTAF/UNICOM 122.8**ABILENE APP/DEP CON** 127.2**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ABI.**ABILENE (VH) (H) VORTACW** 113.7 ABI Chan 84 N32°28.88' W99°51.81' 004° 26.5 NM to fld. 1809/10E.

VOR unusable:

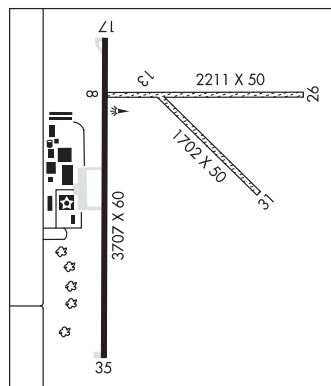
163°-236° byd 40 NM blo 18,000'

237°-247° byd 40 NM blo 7,000'

237°-255° byd 77 NM blo 18,000'

251°-255° byd 46 NM blo 18,000'

251°-261° byd 40 NM blo 4,500'

**STANTON MUNI** (63F) 3 NW UTC-6(-5DT) N32°10.41' W101°49.35'

DALLAS-FT WORTH

2731 NOTAM FILE SJT

L-6H

RWY 16-34: H4240X60 (ASPH) S-14**RWY 16:** Road. Rgt tfc.**RWY 34:** Road.**SERVICE:** LGT Bcn OTS indefly.**AIRPORT REMARKS:** Unattended. Parachute Jumping. Nmrs 389' wind turbines 1.25-3 mi NW, NE and E of arpt. Rwy 16-34 extensive cracking and loose stones.**AIRPORT MANAGER:** 432-756-3301**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc midland Apch at 432-563-2123. when Apch clsd ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MAF.**MIDLAND (L) (L) VORTACW** 114.8 MAF Chan 95 N32°00.56' W102°11.42' 051° 21.2 NM to fld. 2860/11E.

VOR unusable:

010°-020° byd 8 NM blo 8,000'

STEPHENS CO (See BRECKENRIDGE on page 254)