

**MICHAEL J SMITH FLD** (See BEAUFORT on page 285)

**MID-CAROLINA RGNL** (See SALISBURY on page 332)

## MOCKSVILLE

**TWIN LAKES** (8A7) 5 NE UTC-5(-4DT) N35°54.89' W80°27.41'

818 B NOTAM FILE RDU

**RWY 09-27:** H2943X50 (ASPH) S-12.5 RWY LGTS(NSTD)

1.5% up E

**RWY 09:** PAPI(P2L)—GA 3.5° TCH 49'. Trees.

**RWY 27:** Trees.

**SERVICE:** S4 FUEL 100LL OX 4

**AIRPORT REMARKS:** Attended 1300-2200Z±. For after hrs svc ctc 336-998-2126. Fuel 24 hr self svc with credit card. Deer/migratory birds occasionally on arpt. Rwy 09 18' drop-off 150' from thld left and rgt of centerline. Rwy 09 uphill grade. Rwy 09-27 markings nonstandard due to size and location.

**AIRPORT MANAGER:** 336-998-8101

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ GREENSBORO APP/DEP CON 124.35

**CLEARANCE DELIVERY PHONE:** For CD ctc Greensboro Apch at 336-333-5119.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE GSO.

**GREENSBORO (H) (H) VORTAC** 116.2 GSO Chan 109 N36°02.74'

W79°58.58' 255° 24.7 NM to fld. 908/3W.


TACAN AZIMUTH unusable:

255°-290° byd 10 NM blo 6,000'

CHARLOTTE

L-25D, 36F

IAP

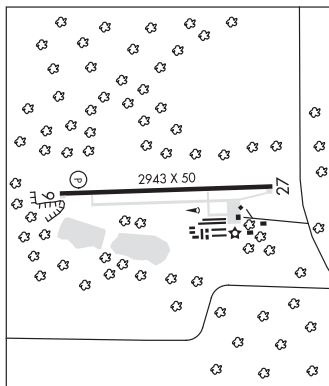

## MONROE

**CHARLOTTE/MONROE EXEC** (EQY)(KEQY) 5 NW UTC-5(-4DT) N35°01.04' W80°37.32'

683 B NOTAM FILE EQY

**RWY 05-23:** H7001X100 (ASPH) S-35, D-68.5 HIRL 0.3% up SW

**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 46'. Trees.

**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 40'. Trees.

**SERVICE:** S4 FUEL 100LL, JET A1+ OX 3, 4 LGT Actvt MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23—CTAF. All lights oper dusk-0500Z±. After 0500Z±, actvt—122.7. PAPI Rwy 05 & 23 oper consly.

**AIRPORT REMARKS:** Attended 1100-0300Z±. Deer, wildlife, and birds on and invof arpt. Fuel 24 hr credit card svc avbl. Arpt phone number 704-226-2300. Right side of Twy A at Rwy 23 has steep shoulder drop-off btn rwy and Twy A.

**AIRPORT MANAGER:** 704-226-2300

**WEATHER DATA SOURCES:** ASOS 135.775 (704) 283-5185.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ CHARLOTTE APP/DEP CON 120.05

CLNC DEL 132.55

**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.

(L) (L) VOR/DME 115.0 CLT Chan 97 N35°11.42'

W80°57.11' 127° 19.3 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

203°-220°

270°-350° byd 20 NM blo 5,000'

VORDME controlled by charlotte ATCT

VOR unusable:


203°-220°

ILS/DME 109.75 I-EQY Chan 34(Y) Rwy 05. Class IB. LOC unmonitored 2200-1300Z±. LOC unusable byd 30° left of course.

CHARLOTTE

H-9B, 12G, L-25D, 36E

IAP

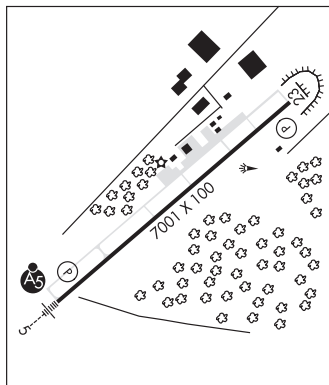

**MONTGOMERY CO** (See STAR on page 338)

**MOORE CO** (See PINEHURST/SOUTHERN PINES on page 324)