

WINSTON SALEM

SMITH REYNOLDS (INT)(KINT) 3 NE UTC-5(-4DT) N36°08.02' W80°13.32'

CINCINNATI

969 B LRA ARFF Index—See Remarks NOTAM FILE INT

H-9B, 12H, L-25D, 36F

RWY 15-33: H6655X150 (ASPH-GRVD) S-120, D-211, 2S-175,

IAP, AD

2D-342, 2D/2D2-802 PCN 60 F/C/W/T HIRL 1.0% up NW
RWY 15: REIL. PAPI(P4L)—GA 3.0° TCH 38'. RVR-R Thld dsplcd
585'. Bldg.

RWY 33: MALSR. PAPI(P4L)—GA 3.0° TCH 58'. RVR-T

RWY 04-22: H3938X150 (ASPH) S-18, D-25 PCN 6 F/C/Y/T MIRL
0.3% up NE

RWY 04: Trees.

RWY 22: PAPI(P2L)—GA 3.0° TCH 39'. Trees.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 33	04-22	6010

RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-3938 TODA-3938 ASDA-3938 LDA-3938

RWY 15: TORA-6655 TODA-6655 ASDA-6655 LDA-6069

RWY 22: TORA-3938 TODA-3938 ASDA-3938 LDA-3938

RWY 33: TORA-6655 TODA-6655 ASDA-6655 LDA-6655

ARRESTING GEAR/SYSTEM

RWY 15: EMAS

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT When twr clsd

ACTIVATE MALSR Rwy 33; REIL Rwy 15; PAPI Rwy 33; HIRL Rwy 15-33—CTAF. MIRL Rwy 04-22 unavbl when twr clsd.

AIRPORT REMARKS: Attended continuously. Rwy 04-22 CLOSED to air carrier ops exc tax. Arpt sfc conditions not reported daily 2130-1330Z‡ (1630-0830L), or on weekends and hol. Class IV, ARFF Index A. ARFF Index B coverage avbl, call arpt mgr 336-767-6361. Flight Notification Service (ADCUS) avbl.

AIRPORT MANAGER: 336-607-6120

WEATHER DATA SOURCES: ASOS (336) 661-3096 LAWRS.

COMMUNICATIONS: CTAF 123.75 ATIS 121.3 UNICOM 122.95

WINSTON SALEM RCO 122.6 (RALEIGH RADIO)

® GREENSBORO APP/DEP CON 124.35

WINSTON-SALEM TOWER 123.75 (1145-0230Z‡) GND CON 128.25

AIRSPACE: CLASS D svc 1145-0230Z‡; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE GSO.


GREENSBORO (H) (H) VORTAC 116.2 GSO Chan 109 N36°02.74' W79°58.58' 297° 13.1 NM to fld. 908/3W.

TACAN AZIMUTH unusable:

255°-290° byd 10 NM blo 6,000'

REENO NDB (LOMW) 317 IN N36°04.26' W80°10.01' 332° 4.6 NM to fld. 862/7W. NOTAM FILE INT.

ILS 110.3 I-INT Rwy 33. Class IE. LOM REENO NDB. Glideslope unusable byd 7° left and byd 4° right of course.

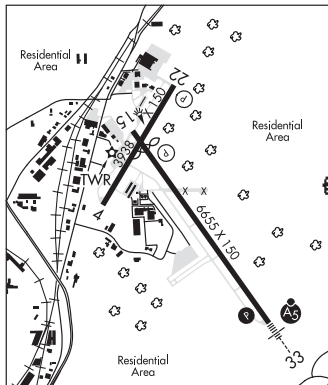

WINTERVILLE

SOUTH OAKS AERODROME (Ø5N) 5 SE UTC-5(-4DT) N35°28.93' W77°21.35'

CHARLOTTE

50 NOTAM FILE RDU

RWY 07-25: 1850X50 (TURF)

RWY 07: Trees.

RWY 25: Trees.

AIRPORT REMARKS: Unattended. Daytime use only. Provided VFR ops and pvt use. Rwy 07-25 marked with yellow cones. Rwy 25 has 15 ft +/- road 150 ft +/-- fm thr both side of cntrln and 10 ft +/-- driveway 25 ft +/-- fm thr offset 5 ft +/-- right of cntrln.

AIRPORT MANAGER: 252-714-0514

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

WOODVILLE N36°15.78' W76°17.88' NOTAM FILE ECG.

WASHINGTON

NDB (MHW) 254 LLW 101° 6.0 NM to Elizabeth City Cg Air Station/Rgnl. 18/10W.

L-35C

WRIGHT BROTHERS N35°55.23' W75°41.82' NOTAM FILE MQI.

CHARLOTTE

(T) (T) VORW/DME 111.6 RBX Chan 53 at Dare Co Rgnl. 10/8W. VOR/DME unmonitored 2300-1300Z‡.

L-35D

VOR unusable:

281°-318° blo 8,000'

319 blo 4,000'

320°-280°