

ELLCOTT

COLORADO SPRINGS EAST (CO4) 3 NW UTC-7(-6DT) N38°52.46' W104°24.59'

DENVER

6145 NOTAM FILE COS

L-10F

RWY 17L-35R: 4500X40 (GRVL-DIRT)

RWY 17L: Berm.

RWY 35R: Road.

RWY 17R-35L: H4500X42 (ASPH) S-6000 MIRL

RWY 17R: Fence.

RWY 35L: Road. Rgt tfc.

RWY 08-26: 3440X60 (GRVL-DIRT) S-60

RWY 08: Tree. Rgt tfc.

RWY 26: Road.

SERVICE: FUEL 100LL LGT ACTVT MIRL RWY 17R-35L—CTAF.

AIRPORT REMARKS: Unattended. Fee for commercial acft ctc amgr 719-352-6965. Fuel by appt only. For fuel services ctc amgr at 719-352-6965. Rwy 26 has 2" bump at intxn of Rwy 17R-35L. Rwy 17R-35L mkd on both sides with white reflectors. Rwy 17R-35L CLSD to hel. PCL avbl for Rwy 17R-35L only. Glider activity invof of arpt. Nstd segmented circle marked with white rocks. Nstd wind tpe made fm barrels. No twin tandem rotary helicopters allowed. Be alert: Intensive USAF student trng invof Colorado Springs and Pueblo Colorado. Rwy 08 has 5 ft rigid lgt pole right side of Rwy 35L 115 ft fm thld btn thld and PAPI. Rwy 08 +35' powerline 1500' from thld OB. Rwy 08 has +4' fence 125' fm cntrn north of rwy west of Rwy 17R-35L intersection. Rwy 17R-35L gwt rstd to 6000 lbs. Rwy 26 has +4' fence 260' fm thld OB. Rwy 26 has +15' bldg 130' left of thld; +15' road 240' fm thld OB. Rwy 17L has +5' berm 50' fm thld OB; +5' berm 150' fm thld OB. Rwy 17R has +4' fence 375' from rwy end on both sides. -2' terrain 280' from rwy end on both sides. Rwy 17R has +4' fence 100' right of rwy for first 2500'. Thld marked with red/green reflectors. Rwy 35L +4' fence 260' from thld OB. Rwy 35L has +15' road 250' fm thld OB; thld marked with red/green reflectors. Rwy 35R has +4' concrete box 100' fm thld 50 right of cntrn. Rwy 35L has 5 ft rigid lgt pole, rt side btn thld and PAPI 115 ft fm rwy thld.

AIRPORT MANAGER: (719) 306-3021

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Colorado Springs Apch at 719-556-9105.

EMPIRE OCO N39°47.67' W105°45.78' /12493

DENVER

AWOS-3 134.325

L-9E

ERIE MUNI (EIK)(KEIK) 3 S UTC-7(-6DT) N40°00.62' W105°02.89'

CHEYENNE

5119 B NOTAM FILE DEN

L-10F, A

RWY 15-33: H4700X60 (CONC) S-12.5 MIRL 0.9% up S

IAP

RWY 15: REIL. PAPI(P2L)—GA 3.0° TCH 58'. Tree. Rgt tfc.

RWY 33: PAPI(P2L)—GA 3.0° TCH 52'. Hill.

SERVICE: S4 FUEL 100LL, JET A OX3, 4 LGT ACTVT REIL Rwy 15;

PAPI Rwy 15 and 33; MIRL Rwy 15-33—CTAF.

AIRPORT REMARKS: Attended Mon-Sat 1500-0000Z, Sun

1500-2100Z. Aft hr emerg—303-870-5659. Fuel: 100LL: Self svc avbl H24 with credit card. Twy A lgt. Rwy 15-33 -2 ft trrn 60-70 ft E of cntrn full len. Rwy 15 has -2 to -6 ft ditch wi 700 ft of rwy end various locations. Rwy 33 30 ft road 1350 ft fm thr both sides; -6 to -12 ft ditch 60 ft L of cntrn parl to first 750 ft of rwy.

AIRPORT MANAGER: 303-664-0633

WEATHER DATA SOURCES: AWOS-3 133.825 (303) 604-4339.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ DENVER APP/DEP CON 125.12

CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.

RADIO AIDS TO NAVIGATION: NOTAM FILE BJC.

JEFFCO (H) (H) VORW/DME 115.4 BJC Chan 101 N39°54.78' W105°08.34' 025° 7.2 NM to fld. 5737/11E.

VOR portion unusable:


226°-245° byd 36 NM blo 17,000'

246°-278° byd 30 NM blo 19,000'

279°-300° byd 34 NM blo 18,000'

DME unusable:

246°-278° byd 30 NM

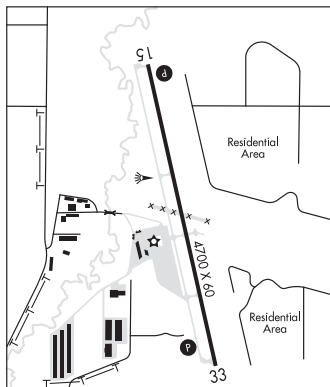

FALCON N39°41.41' W104°37.26' NOTAM FILE DEN.

DENVER

(H) (H) VORTACW 116.3 FQF Chan 110 225° 12.8 NM to Centennial. 5780/11E.

H-3F, 5A, L-10G, A

TACAN & DME unusable:

068°-088° byd 10 NM blo 11,500'