

ERWINNA

VANSANT (9N1) 2 SW UTC-5(-4DT) N40°29.06' W75°05.98'

NEW YORK

390 TPA—See Remarks NOTAM FILE IPT

RWY 07-25: 3058X120 (TURF)

RWY 07: Thld dsplcd 365'. Road.

RWY 25: Tree.

RWY 05G-23G: 1340X200 (TURF)

SERVICE: S4 FUEL 100LL

AIRPORT REMARKS: Attended 1330Z±-dark. Arpt CLOSED dusk to dawn. Rwy 05 ldg and tkf prohibited. Arpt clsd to tran tfc Dec thru Apr. Heavy glider tfc. Glider TPA-1190(800), Power Plane TPA-1390(1000). Power plane tfc remain outside glider tfc pat and avoid flying directly over arpt. Gliders occasionally use power plane rwy for lDgs to the West. Rwy 23 gliders only. Rwy 07-25 marked with white tires, dsplcd thld marked with white tires. Powered prcht ops not permitted.

AIRPORT MANAGER: 610-847-8494

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Allentown Apch at 800-728-6322.

ESSINGTON

PHILADELPHIA SPB (9N2) 1 S UTC-5(-4DT) N39°51.54' W75°17.98'

WASHINGTON

00 TPA-300(300) NOTAM FILE IPT

WATERWAY 11W-29W: 9100X250 (WATER)

WATERWAY 11W: Rgt tfc.

SEAPLANE REMARKS: Unattended. Call 610-521-3530 prior to arrival. No night ops. Check Philadelphia TAC chart for lDg area. Transient tfc ctc Philadelphia App Con for tfc advisories. Debris invof gravel ramp.

AIRPORT MANAGER: 610-521-3530

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Philadelphia Apch at 800-354-9884.

FACTORYVILLE

SEAMANS FLD (9N3) 2 N UTC-5(-4DT) N41°35.36' W75°45.36'

NEW YORK

1209 B NOTAM FILE IPT

RWY 04-22: H2500X50 (ASPH) LIRL

RWY 22: Tree.

SERVICE: FUEL 100LL

AIRPORT REMARKS: Attended 1400-2200Z±. For svc aft hrs ctc 570-945-5125. Cold temperature rstd arpt. Altitude correction required at or below -22C.

AIRPORT MANAGER: 570-575-7170

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ **WILKES-BARRE APP/DEP CON** 120.95

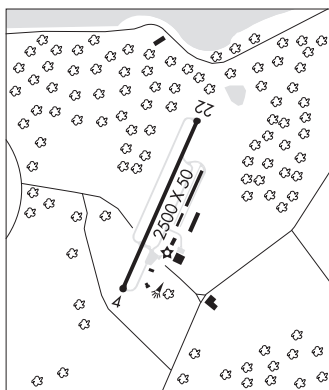
CLEARANCE DELIVERY PHONE: For CD ctc Wilkes-Barre Apch at 570-655-2084.

RADIO AIDS TO NAVIGATION: NOTAM FILE AVP.

WILKES-BARRE (L) (L) VORTACW 111.6 LVZ Chan 53 N41°16.37' W75°41.37' 001° 19.2 NM to fld. 2118/10W.

VOR unusable:

290°-305° byd 15 NM blo 6,000'

L-30K, 33A
IAP

FAIRFIELD

MID ATLANTIC SOARING CENTER (W73) 2 SE UTC-5(-4DT) N39°45.42' W77°21.08'

WASHINGTON

573 NOTAM FILE IPT

RWY 15-33: H2700X50 (ASPH) S-12.5, D-12.5

RWY 15: Tree.

RWY 33: Thld dsplcd 900'. Tree. Rgt tfc.

AIRPORT REMARKS: Attended Sat-Sun dalgt hrs. Unattended Mon-Fri. Arpt ops rstd, in accordance with Temporary Flight Restriction rules, when P-40 expanded to 10 NM radius. Rwy 15 CLOSED for lDgs. Extensive glider opns. Gliders occasionally land on turf area adjacent to Rwy 15-33. Rwy 15 not marked with thld or magnetic heading.

AIRPORT MANAGER: 717-642-9886

COMMUNICATIONS: CTAF 123.3

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-709-4993.

COMM/NAV/WEATHER REMARKS: Multicom 123.3 used during glider activity.