

**WESTWINDS** (D17) 4 W UTC-7(-6DT) N38°45.51' W108°08.91'

**DENVER**  
L-9E

5000 NOTAM FILE DEN

**RWY 04-22:** H4100X40 (ASPH)

**RWY 22:** Trees.

**RWY 13-31:** 2000X70 (GRVL-DIRT)

**RWY 13:** Hill.

**RWY 31:** Road.

**AIRPORT REMARKS:** Attended 1500-0000Z. Rwy 04-22 CLOSED to acft 8,500 lbs or more. Wildlife on and in/ov arpt. +100' to 300' mountains lctd north, west and east of arpt at varying distances. Rwy 22 has 180' mountain 1500' from rwy end, apch slope 7:1. Rwy 13-31 soft when wet. Rwy 31 has +10' trees 150' from thld OB. +40' tree 60' from thld 50' rgt of cntrln. Rwy 04 has +120' terrain 2700' from thld 380' left of cntrln.

**AIRPORT MANAGER:** 303-829-1696

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE MTJ.

**MONTROSE (VH) (H) VOR/DME** 117.1 MTJ Chan 118 N38°30.39' W107°53.96' 310° 19.1 NM to fld.  
5713/12E. vDME unmonitored.

DME unusable:

011°-090° byd 26 NM blo 15,000'

190°-250° byd 25 NM blo 15,000'

VOR unusable:

001°-167° byd 40 NM

060°-090° byd 26 NM blo 16,000'

167°-178° byd 50 NM

168°-178° byd 40 NM blo 16,300'

179°-251° byd 40 NM

190°-250° byd 25 NM blo 15,000'

252°-262° byd 40 NM blo 13,000'

252°-262° byd 51 NM blo 15,500'

252°-262° byd 72 NM

263°-295° byd 40 NM

313°-360° byd 40 NM

**DENVER**

**CENTENNIAL** (APA)(KAPA) 15 SE UTC-7(-6DT) N39°34.21' W104°50.96'

**DENVER**  
H-3F, 5A, L-10F, A  
IAP, AD

5885 B NOTAM FILE APA

**RWY 17L-35R:** H10001X100 (ASPH-GRVD) S-56, D-75, 2S-95

PCN 26 F/C/X/T MIRL

**RWY 17L:** PAPI(P4L)—GA 3.0° TCH 47'. 1.0% up.

**RWY 35R:** MALSR. PAPI(P4L)—GA 3.0° TCH 49'. P-line. Rgt tfc. 0.8% down.

**RWY 17R-35L:** H7001X75 (ASPH-GRVD) S-30 PCN 23 F/C/X/T MIRL 0.9% up S

**RWY 17R:** REIL. PAPI(P4L)—GA 3.0° TCH 42'. Rgt tfc.

**RWY 35L:** REIL. PAPI(P4R)—GA 3.0° TCH 37'. Fence.

**RWY 10-28:** H4800X75 (ASPH-GRVD) S-12.5 PCN 17 F/A/Y/T MIRL 0.6% up W

**RWY 10:** PAPI(P2L)—GA 3.0° TCH 44'. Thld displcd 400'.


**RWY 28:** REIL. PAPI(P2L)—GA 3.0° TCH 41'. Pole.

**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2

**NOISE:** Noise abatement proc in efct; noise office—303-790-0598. Rwy 35R crosswind/base leg N of Lincoln Ave; Rwy 17L crosswind/base leg S of Arapahoe Road; Rwy 17R-35L clsd tfc remain S of Arapahoe Road and E of Interstate 25; Rwy 10-28 avoid noise sensitive area 1 mi S and E of rwy.

**AIRPORT REMARKS:** Attended continuously. 100LL: Self serve fuel avbl.

Waterfowl on and in vicinity of arpt. Mult lrg pwr lines appxly 3 NM S of Rwy 35R and Rwy 35L. Numerous cranes in/ov arpt. Nmrs flood lgts 1/2 SM N of thr; SS-0700Z. Adzy density alt displ lctd C-1, A-1, and A-18. +109' twr located 1800' east/northeast of Rwy 17L thld. All acft blo cert 70,000 lb max gross tkof wt and Stage III acft up to cert 75,000 lb max gross tkof wt may opr; one-time exception auzd by Exec Dir. Heli ops ctc FBO for Indg zone lctn; heli ops on front ramp not advised. User fee arpt: H24 U.S. Customs—303-768-0309. CTN: Ensure proper rwy alnmt; close spaced parl rwy. Arpt safety video—[https://www.faa.gov/airports/runway\\_safety/videos/apa/](https://www.faa.gov/airports/runway_safety/videos/apa/). See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

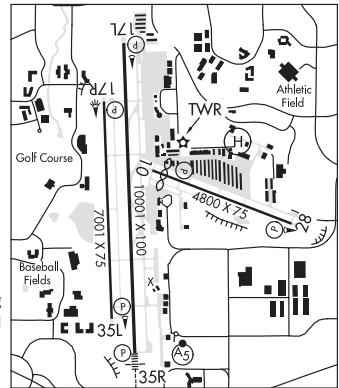

CONTINUED ON NEXT PAGE

## CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: 303-790-0598

WEATHER DATA SOURCES: ASOS (720) 873-2799

COMMUNICATIONS: ATIS 120.3 303-799-6722 UNICOM 122.95

DENVER RCO 122.2 (DENVER RADIO)

DENVER APP/DEP CON 132.75

TOWER 118.9 GND CON 121.8 CLNC DEL 128.6

AIRSPACE: CLASS D svc continuous.

VOR TEST FACILITY (VOT) 108.2

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

FALCON (VH) (H) VORTACW 116.3 FQF Chan 110 N39°41.41' W104°37.26' 225° 12.8 NM to fld. 5780/11E.

TACAN AZIMUTH unusable:

068°-088° byd 10 NM blo 11,500'

DME unusable:

068°-088° byd 10 NM blo 11,500'

VOR unusable:

132°-157° byd 40 NM

158°-168° byd 40 NM blo 18,000'

169°-191° byd 40 NM

192°-203° byd 40 NM blo 12,000'

192°-203° byd 76 NM blo 18,000'

192°-230° byd 49 NM blo 16,200'

204°-212° byd 40 NM

215°-231° byd 40 NM blo 13,800'

215°-231° byd 47 NM blo 15,000'

215°-231° byd 58 NM blo 16,400'

215°-231° byd 81 NM blo 18,000'

232°-236° byd 40 NM

247°-259° byd 40 NM blo 16,500'

247°-259° byd 73 NM blo 18,000'

281°-285° byd 40 NM

301°-311° byd 40 NM blo 13,500'

301°-311° byd 60 NM blo 16,000'

301°-311° byd 74 NM

ILS/DME 111.3 I-APA Chan 50 Rwy 35R. Class IT. LOC unusable byd 13 NM blo 9,000'.

COMM/NAV/WEATHER REMARKS: Emerg frequency 121.5 not avbl at twr. Advise GND CON when ready for dep. GND CON will advise when to monitor the twr frequency.

•  
HELIPAD H1: H50X50 (CONC) PERIMETER LGTS

HELIPORT REMARKS: Helipad H1: TLOF 50X50 ft; FATO 50X50 ft; ingress/egress 270. Helipad H1: H24 heli  
svc—303-799-0079.