

**ROSEBUD SIOUX TRIBAL** (SUO)(KSUO) 2 S UTC-6(-5DT) N43°15.51' W100°51.57'

OMAHA  
L-12G  
IAP

2724 B NOTAM FILE HON

**RWY 16-34:** H4801X75 (CONC) S-125 MIRL 0.9% up S

**RWY 16:** PAPI(P2L)—GA 3.0° TCH 42'. Hill.

**RWY 34:** PAPI(P2L)—GA 3.0° TCH 30'. Hill.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 16:** TORA-4800 TODA-4800 ASDA-4800 LDA-4800

**RWY 34:** TORA-4800 TODA-4800 ASDA-4800 LDA-4800

**SERVICE:** LGT Actvt PAPI Rwy 16 and 34; MIRL Rwy 16-34—CTAF.

**AIRPORT REMARKS:** Unattended.


**AIRPORT MANAGER:** 605-828-1280

**WEATHER DATA SOURCES:** AWOS-3P 119.075 (605) 747-2392.

**COMMUNICATIONS:** CTAF 122.9

Ⓡ DENVER CENTER APP/DEP CON 127.95

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.

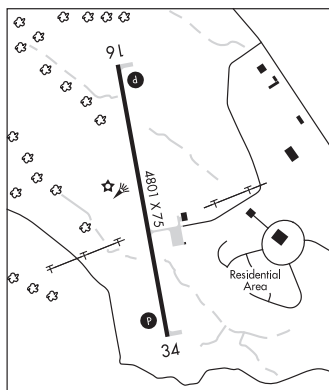

## SIOUX FALLS

**JOE FOSS FLD** (FSD)(KFSD) P (ANG) 3 NW UTC-6(-5DT) N43°34.92' W96°44.52'

OMAHA  
H-5C, L-12I  
IAP, AD

1430 B LRA Class I, ARFF Index B NOTAM FILE FSD MON Airport

**RWY 03-21:** H9000X150 (CONC-GRVD) S-200, D-200, 2S-175,

2D-444 PCN 60 R/B/W/T HIRL CL

**RWY 03:** MALSR. PAPI(P4L)—GA 3.0° TCH 54'. RVR-T Road.

**RWY 21:** MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 49'. RVR-T Railroad.

**RWY 15-33:** H8000X150 (CONC-GRVD) S-100, D-180, 2S-175,

2D-400 PCN 70 R/B/W/T HIRL

**RWY 15:** REIL. PAPI(P4L)—GA 3.0° TCH 48'. Tree.

**RWY 33:** REIL. PAPI(P4L)—GA 3.0° TCH 45'. Tree.

**RWY 09-27:** H3151X75 (CONC-WC) S-30 PCN 60 R/B/W/T MIRL

**RWY 09:** Tree.

**RWY 27:** Pole.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 03:** TORA-8999 TODA-8999 ASDA-8999 LDA-8999

**RWY 15:** TORA-8000 TODA-8000 ASDA-8000 LDA-8000

**RWY 21:** TORA-8999 TODA-8999 ASDA-8999 LDA-8999

**RWY 33:** TORA-8000 TODA-8000 ASDA-8000 LDA-8000

**ARRESTING GEAR/SYSTEM**

**RWY 03** BAK-14 BAK-12B(B) (1540).

BAK-14 BAK-12B(B) (1500). **RWY 21**


**RWY 15** BAK-14 BAK-12B(B) (1550). **RWY 33**

BAK-14 BAK-12B(B) (1500). **RWY 33**

**SERVICE:** S4 FUEL 100LL, JET A OX 1, 3 LGT ACTVT MALSR Rwy 03 and 21; REIL Rwy 15 and 33; HIRL Rwy 03-21 and 15-33; MIRL Rwy 09-27. When ATCT clsd MALSR Rwy 03 and 21 preset on low intst, to incr intst—CTAF. PAPI Rwy 03, 21, 15, 33 opr consly. Rwy 15 PAPI unusable byd 6° left and 5° right of rwy centerline. Rwy 33 PAPI unusable byd 9° right of rwy centerline. **MILITARY—A GEAR** Rwy 15-33 and Rwy 03-21 A-GEAR not nmllly up, rqr 30 min PN, only avbl dur nml ANG duty hr (Oct-Apr). **JASU** 1(MD-3) 3(MA32A-60) **FUEL** A++(Mil). For mil fuel, ctc ANG DSP N98-7754, C605-988-5754. A+(C605-336-7791)(NC-100LL, A) **FLUID** SP PRESAIR LPOX LOX OIL O-128 SOAP

**AIRPORT REMARKS:** Attended continuously. Waterfowl, birds and deer on and invof arpt. Migratory birds within 25 NM primarily between Mar-Nov. Sfc conds not monitored 0600-1030Z† (0000-0430 local). ATCT has limited visibility on Twy H, Twy G and Twy J between the east cargo ramp and Twy B. Twy C clsd except mil acft. East general aviation ramp restricted to 60,000 pounds. Rwy 09-27 not avbl for skedd acr opns with more than 9 psgr seats or unskedd acr at least 31 psgr seats excp for taxi. BE ALERT: Marv Skie-Lincoln County airport (Y14) located 7.2 miles sw of FSD and 2 miles east of Rocky has heavy VFR traffic. Flight Notification Service (ADCUS) avbl Mon-Fri 1400-2200Z† call 605-338-4384, after hrs call 605-373-3523 prior to departure. Cold temperature airport. Altitude correction required at or below -31C.

**MILITARY REMARKS:** ANG Numerous NSTD mrk on the ANG prk apron. Comsec storage unavbl. BASH Phase II Ops eff Mar-Apr, Sep-Oct; exp incr bird act; ctc ANG Base Ops.

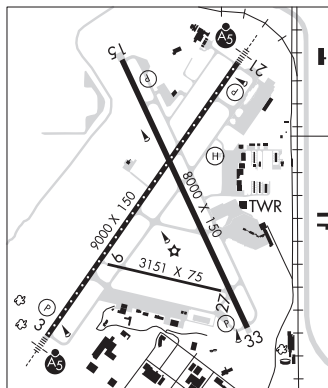

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: 605-336-0762

WEATHER DATA SOURCES: ASOS (605) 331-7833 LLWAS.

COMMUNICATIONS: CTAF 118.3 ATIS 126.6 UNICOM 122.95

SIoux FALLS RCO 122.2 (HURON RADIO)

Ⓡ SIoux FALLS APP/DEP CON 125.8 (1100-0600Z‡)

Ⓡ MINNEAPOLIS CENTER APP/DEP CON 132.050 (0600-1100Z‡)

SIoux FALLS TOWER 118.3 (1100-0600Z‡) GND CON 121.9

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd, ctc FSS. If una, ctc Minneapolis ARTCC at 651-463-5588.

AIRSPACE: CLASS D svc 1100-0600Z‡; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE FSD.

SIoux FALLS (VH) (H) VORTACW 115.0 FSD Chan 97 N43°38.97' W96°46.87' 148° 4.4 NM to fld. 1571/9E.

VOR unusable:

055°-068° blo 9,000'

055°-075° byd 15 NM

069°-075° blo 2,900'

314°-324° byd 40 NM blo 5,000'

314°-324° byd 69 NM

320°-000° byd 20 NM blo 4,000'

325°-334° byd 40 NM

335°-350° byd 40 NM blo 4,000'

335°-350° byd 46 NM

ROKKY NDB (HW/LOM) 245 FS N43°29.64' W96°49.74' 031° 6.5 NM to fld. 1528/5E.

ILS 109.9 I-FSD Rwy 03. Class IT. LOM ROKKY NDB. COMLO unmonitored. LOC unusable byd 30° left of course.

LOC and glideslope unmonitored when ATCT clsd.

ILS 111.1 I-JOU Rwy 21. Class IT. Unmonitored when ATCT closed.

ASR (1100-0500Z‡)

• • • • • HELIPAD H1: H50X50 (ASPH) PERIMETER LGTS

• • • • • HELIPORT REMARKS: Perimeter lgts.

SISETON MUNI (8D3) 3 E UTC-6(-5DT) N45°40.17' W96°59.62'

TWIN CITIES

1162 B NOTAM FILE HON

L-14G

RWY 16-34: H3400X60 (ASPH) S-12 MIRL

IAP

RWY 16: PAPI(P2L)—GA 3.0° TCH 30'. Road.

RWY 34: PAPI(P2L)—GA 3.0° TCH 28'. Fence.

RWY 04-22: 1914X150 (TURF) 0.6% up SW

RWY 04: Pole.

RWY 22: Tree.

SERVICE: FUEL 100LL Actvt PAPI Rwy 16 and 34; MIRL Rwy

16-34—CTAF.

AIRPORT REMARKS: Unattended. Rwy 04-22 CLOSED winter months.

Waterfowl and gulls on and invof arpt. Fuel avbl 24 hrs with credit card. Rwy 04-22 marked with black and white cones.

AIRPORT MANAGER: (605) 880-1796

COMMUNICATIONS: CTAF 122.9

Ⓡ MINNEAPOLIS CENTER APP/DEP CON 128.5

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at

651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE ATY.

WARTERTOWN (L) TACAN Chan 113 ATY (116.6) N44°58.78'

W97°08.50' 360° 41.9 NM to fld. 1763/9E.

