

CALHAN (5V4) 1 N UTC-7(-6DT) N39°02.90' W104°17.58'

DENVER

6450 TPA—7250(800) NOTAM FILE DEN

RWY 17-35: 4565X50 (TURF-GRVL) LIRL(NSTD)**RWY 17:** TRCV(TRIL). Road.**RWY 35:** Trees. Rgt tfc.**SERVICE:** S2 **LGT** Rwy 17-35 NSTD LIRL, north 3000' rwy lgtd. ACTIVATE NSTD LIRL Rwy 17-35 and VASI Rwy 17 CTAF.**AIRPORT REMARKS:** Attended irregularly. Vehicles crossing rwy. Rwy 17-35 width varies from 50' to 100'. Rwy 17 first 1250' 45' wide artificial turf. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Aerobatic practice area 1/2 mile west of Rwy 17-35 300' AGL to 10,000' MSL. South end rwy has side slope. -6' ditch 40' west of centerline. Ground raises on east side of rwy. Rwy 17 has 25' P-pole 400' from thld, 110' R of centerline. Rwy 17-35 has +15' road 110' from and parallel to rwy centerline W side of rwy full length. Rwy 35 has +4' fence 200' from thld obstruction, aprx +20' trees 70' west of centerline for first 500' of rwy, approx +25' P-line 850' from thld obstruction, aprx 2' burm at rwy thld. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.**AIRPORT MANAGER:** 719-338-2149**COMMUNICATIONS:** CTAF/UNICOM 122.725**CLEARANCE DELIVERY PHONE:** For CD ctc Colorado Springs Apch at 719-556-9105.**CANON CITY****FREMONT CO** (1V6) 6 E UTC-7(-6DT) N38°25.71' W105°06.41'

DENVER

5442 B TPA—6500(1058) NOTAM FILE DEN

H-3F, 5A, L-10F

RWY 11-29: H5399X75 (ASPH) S-26, D-26 MIRL 1.1% up NW

IAP

RWY 11: REIL. PAPI(P2L)—GA 3.0° TCH 23'.**RWY 29:** REIL. PAPI(P2L)—GA 3.0° TCH 40'.**RWY 17-35:** 1800X35 (TURF-GRVL) 1.2% up N**RWY 17:** Bldg.**SERVICE:** S4 **FUEL** 100LL, JET A **OX 1, 2** **LGT** ACTVT REIL Rwy 11 and Rwy 29, PAPI Rwy 11 and Rwy 29, MIRL Rwy 11-29—CTAF. Apron areas lgtd.**AIRPORT REMARKS:** Attended 1500-0000Z. Parachute Jumping. Gldr ops and towing on and invof arpt. CTN: USAF student trng invof Colorado Springs and Pueblo Arpt. Rwy 17, +32' hngr 1495' fm thr 100' R of extrnd cntrln. Rwy 17 has a 20' building 66' left of rwy centerline, 105' remaining from rwy end. 2 ft trrn W of Rwy 17-35 and first 250 ft S of Rwy 11-29. Rwy 17-35 crosses asph twy and rwy. Rwy 17-35 vrbt 35' to 45'. Rwy 17-35 prairie dog holes thrut. Paved twys mkd with blue and white reflectors. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.**AIRPORT MANAGER:** 719-784-3816**WEATHER DATA SOURCES:** AWOS-3 120.025 (719) 784-2014.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® DENVER APP/DEP CON 120.1 (1300-0500Z)

® DENVER CENTER APP/DEP CON 128.375 (0500-1300Z)

CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.**RADIO AIDS TO NAVIGATION:** NOTAM FILE PUB.**PUEBLO (VH) (H) VORTACW** 116.7 PUB Chan 114 N38°17.66' W104°25.77' 276° 33.0 NM to fld. 4756/8E.

VOR unusable:

000°-030° byd 40 NM

215°-227° byd 40 NM blo 16,000'

215°-227° byd 62 NM

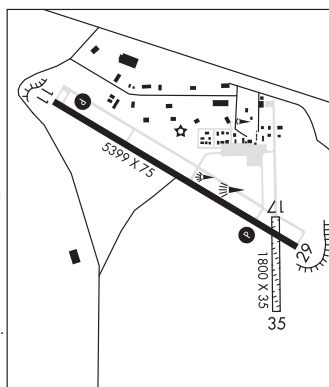
228°-240° byd 40 NM blo 18,000'

280°-340° byd 40 NM

341°-348° byd 40 NM blo 18,000'

349°-359° byd 40 NM blo 9,000'

349°-359° byd 61 NM

**CENTENNIAL** (See DENVER on page 332)