

## CONTINUED FROM PRECEDING PAGE

**AIRSPACE:** CLASS D svc 1600–0800Z†; other times CLASS E.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE EIL.

(H) **TACAN** Chan 98 EIL (115.1) N64°39.23' W147°05.64' at fld. 542/19E. TACAN unmonitored when twr clsd.

roughness May be expected on all radials

DME unlocks May occur within 4 nm, unlocking is only likely when interrogation is made by high powered /11 kw or greater/ airborne equipment

no NOTAM preventive maint schedule Tue 0700–1000Z†

**TACAN AZIMUTH unusable:**

015°–145° byd 30 NM blo 9,000'

205°–230° byd 20 NM blo 4,400'

210°–220° byd 10 NM blo 2,500'

210°–259° byd 30 NM blo 10,000'

260°–265° byd 20 NM

266°–315° byd 30 NM blo 10,000'

**DME unusable:**

205°–230° byd 20 NM blo 4,400'

**ILS 110.5 I-EIL** Rwy 14. Unmonitored when twr clsd. No NOTAM preventive maint schedule Mon, Wed and Thu 0700–1000Z†. Opr 1600–0800Z† daily.

**ILS 109.9 I-EAF** Rwy 32.

**COMM/NAV/WEATHER REMARKS:** Fairbanks FSS LC 474–0137. For flt advisories or status of rstd and mil opr areas, ctc Eielson Range Control on SUAIS radio 125.3 or telephone 1–800–758–8723. Wx svc avbl H24 exc dur afld/twr closure.

D377–1160/3140, C907–377–1160/3140; AN/FMQ–19 automated obs sys augmented by human obsn. FMQ19

907–377–5846. Tsnt ctc 15 OWS durg afld closure for wx briefing D576–9755/C618–256–9755; if psbl 3 hr PN.

**EKUK** (KKU) PVT 0 S UTC–9(–8DT) N58°48.67' W158°33.53'

**KODIAK**

30 NOTAM FILE Not insp.

**RWY 01–19:** 1200X40 (GRVL–DIRT)

**RWY 01:** Road.

**RWY 19:** Bluff.

**AIRPORT REMARKS:** Unattended. Rwy condition not monitored. Recommend fly over. Rwys not maintained. Rwys soft when wet.

**AIRPORT MANAGER:** 907-842-3842

**COMMUNICATIONS:** CTAF 122.9

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1–866–864–1737.

**EKWOK** (KEK) 0 NNW UTC–9(–8DT) N59°21.41' W157°28.27'

**KODIAK**

141 B NOTAM FILE DLG

**L–21, 3C**

**RWY 02–20:** 3300X75 (GRVL) MIRL 0.6% up N

**RWY 02:** Brush.

**RWY 20:** Brush.

**SERVICE:** LGT ACTVT MIRL Rwy 02–20 and rotating bcn—CTAF.

**AIRPORT REMARKS:** Unattended. Rwy condition not monitored; recommend visual inspection prior to use. Be alert: vehicles cross rwy.

**AIRPORT MANAGER:** 907-842-5511

**COMMUNICATIONS:** CTAF 122.9

**KEMUK MOUNTAIN RCO** 122.55 (DILLINGHAM RADIO) Opr

1645–0845Z†, other times ctc Kenai FSS.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DLG.


**DILLINGHAM (H) (H) VORW/DME** 116.4 DLG Chan 111

N58°59.65' W158°33.13' 041° 39.9 NM to fld. 81/15E.

**COMM/NAV/WEATHER REMARKS:** For a local call to Dillingham FSS dial

907–842–5275. For a toll free call to Kenai FSS dial

1–866–864–1737.

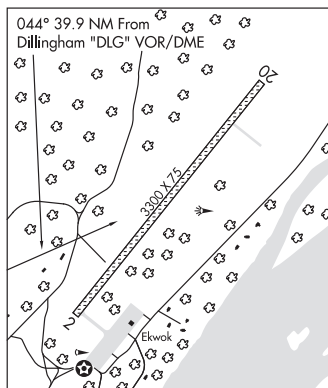

**EL CAPITAN LODGE SPB** (See CRAIG on page 90)

**ELEPHANT** N58°10.26' W135°15.48' NOTAM FILE JNU.

**JUNEAU**

**NDB (HW)** 391 EEF 22/20E.

**L–1C**

**ELFEE** N55°17.77' W162°47.35' NOTAM FILE CDB.

**COLD BAY**

**NDB (HW)** 341 ELF 148° 5.8 NM to Cold Bay. 32/10E.

**H–21, L–21**