

LEONARDTOWN

ST MARY'S CO RGNL (2W6) 4 NE UTC-5(-4DT) N38°18.92' W76°33.01'

WASHINGTON
L-29E, 34E, 36I, A
IAF

142 B NOTAM FILE DCA

RWY 11-29: H4150X75 (ASPH) S-12.5 MIRL 0.4% up W

RWY 11: REIL. PAPI(P2L)—GA 3.0° TCH 37'. Hill.

RWY 29: REIL. PAPI(P2L)—GA 3.0° TCH 32'. Trees.

SERVICE: S4 **FUEL** 100LL, **JET A** **LGT** ACTIVATE MIRL **Rwy 11-29,**
REIL **Rwys 11 and 29—CTAF.**

AIRPORT REMARKS: Attended 1300-2200Z. Deer on & in/ov **Rwy 11-29** SS-SR. Glider, UAS, and ultralight activity on and in/ov arpt. Mil acct on instr apch to Pax River NAS may overfly arpt at 1600' MSL & not mon CTAF. When Pax **Rwy 14** in use, 2W6 acct cross apch path at or blw 1000' or above 3000'. Mil helo ops in/ov arpt. Self serve 100LL avbl with credit card. **Rwy 29** 15 ft depression (downslope) 300 ft m thr 150 ft R-125 ft L. **Rwy 11-29** unfilled cracks, vegetative growth, oxidation, ravelling. **Rwy 29** markings faded. When R-4007 in effect, acct operating VFR at arpt must remain within 1.5 NM of arpt, at or blw 1500 MSL, and above 700' AGL. All VFR fit ops conducted within R-4007 shall be at or blw 1000' MSL. IFR and VFR apchs within R-4077 will be coordinated with Patuxent Apch on 121.0 or by phone 301-342-3740.

AIRPORT MANAGER: (301) 475-4200

WEATHER DATA SOURCES: AWOS-3 119.575 (301) 373-6514.

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ **PATUXENT APP/DEP CON** 121.0 (1200-0400Z Mon-Sun. Other times by NOTAM) other time ctc

Ⓡ **POTOMAC APP/DEP CON** 135.625

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE SBY.

SALISBURY (L) (L) VORTACW 111.2 SBY Chan 49 N38°20.70' W75°30.63' 280° 49.1 NM to fld. 48/12W.

VOR unusable:

007°-026° byd 20 NM blo 7,000'

027°-089° byd 13 NM blo 5,000'

090°-110° byd 20 NM blo 5,000'

111°-113° byd 19 NM blo 5,000'

114°-120° byd 16 NM blo 5,000'

261°-285° blo 6,000'

294°-007° blo 5,000'

TACAN AZIMUTH unusable:

009°-055° byd 20 NM

261°-285° blo 6,000'


294°-007° blo 5,000'

DME unusable:

009°-055° byd 20 NM

261°-285° blo 6,000'

294°-007° blo 5,000'

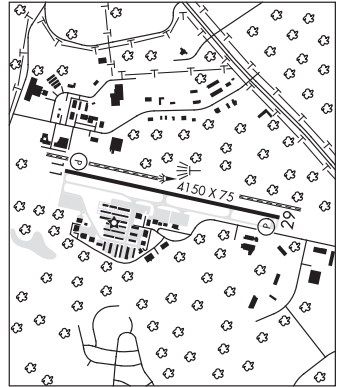

MARTIN STATE (See BALTIMORE on page 95)

MARYLAND (See INDIAN HEAD on page 106)

MASSEY AERODROME (MD1) 2 E UTC-5(-4DT) N39°17.96' W75°47.96'

WASHINGTON

73 NOTAM FILE DCA

RWY 02-20: 3000X100 (TURF)

RWY 20: Thld dspcld 120'. P-line.

AIRPORT REMARKS: Attended 1500-2200Z. Gliders, hang-gliders, powered prchts, ultralight act, on and in/ov arpt. **Rwy thr** and sides marked with white cones. **Rwy 20** dspcld thr marked with 3 white cones on both sides.

AIRPORT MANAGER: 410-928-5270

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Philadelphia Apch at 800-354-9884.

MEXICO FARMS (See CUMBERLAND on page 100)

MONTGOMERY CO AIRPARK (See GAITHERSBURG on page 104)