

STERLING MUNI (STK)(KSTK) 3 W UTC-7(-6DT) N40°36.86' W103°15.86'

CHEYENNE
H-5A, L-10G
IAP

4038 B NOTAM FILE DEN

RWY 15-33: H5201X75 (ASPH) S-30 MIRL

RWY 15: REIL. PAPI(P2L)—GA 3.0° TCH 44'. Tree.

RWY 33: REIL. PAPI(P2L)—GA 3.0° TCH 44'.

RWY 04-22: 2809X150 (TURF-GRVL)

RWY 04: Road.

RWY 22: Tree.

SERVICE: FUEL 100LL, JET A LGT When ATCT CLSD ACTVT REIL RWY 15 and RWY 33; MIRL RWY 15-33—CTAF. PAPI RWY 15 and RWY 33 OPR consly. INCR MIRL INTST—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z†. For after hrs svc call 970-520-2325. Aerobatic OPS on and INVOF ARPT. Be alert; intensive USAF student TRG INVOF KCOS and KPUB airports. RWY 04-22 soft and rough when wet. Varmint holes near Rwy 04 end. Intensive AG OPS MAR-SEPT. RWY 04-22 ends MKD with red/green reflectors. TWY and TRML tiedown area MKD with blue reflectors. RWY 04 DEP has 8 FT fence 155' FT FM DEP end of RWY. NOTE: See Special Notices—Aerobatic Operations in Colorado.

AIRPORT MANAGER: 970-522-0417

WEATHER DATA SOURCES: AWOS-3 118.525 (970) 526-3009.

COMMUNICATIONS: CTAF/UNICOM 122.8


CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE AKO.

AKRON (VH) (H) VOR/DME 114.4 AKO Chan 91 N40°09.33' W103°10.78' 339° 27.8 NM to fld. 4623/13E.

VOR unusable;

228°-232° byd 40 NM

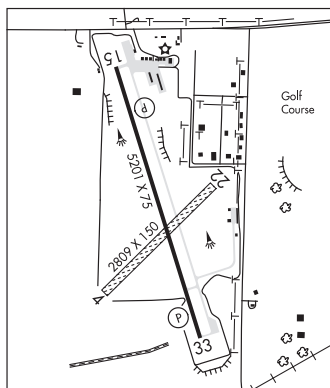

STEVENS FLD (See PAGOSA SPRINGS on page 357)

SUNLIGHT MOUNTAIN 5SM N39°25.53' W107°22.75'/10603

AWOS-3 126.075 (970) 384-3380 AWOS visibility unreliable indef.

DENVER
L-9E

TELLURIDE RGNL (TEX)(KTEX) 5 W UTC-7(-6DT) N37°57.23' W107°54.53'

9070 B TPA-10484(1414) ARFF Index—See Remarks NOTAM FILE TEX

DENVER
H-3E, L-9E
IAP, AD

RWY 09-27: H7111X100 (ASPH-GRVD) S-45, D-89 PCN 35 F/D/X/T

HIRL 0.4% up E

RWY 09: REIL. PAPI(P4L)—GA 3.55° TCH 46'. Thld dspclcd 200'. Rgt ttc.

RWY 27: REIL. PAPI(P4L)—GA 4.0° TCH 40'. Thld dspclcd 200'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-7111 TODA-7111 ASDA-7111 LDA-6911

RWY 27: TORA-7111 TODA-7111 ASDA-7111 LDA-6911

ARRESTING GEAR/SYSTEM

RWY 09: EMAS

RWY 27: EMAS

SERVICE: FUEL 100LL, JET A OX 1, 2, 3, 4 LGT Rwy 27 PAPI lgts unusable byd 2.5 NM due to terrain. ACTIVATE HIRL Rwy 09-27, PAPI Rwy 09, and Rwy 27, REIL Rwy 09 and Rwy 27—CTAF. Arpt lighting system emerg use only 0400-1300Z†.


NOISE: Noise abatement procedures in effect. For more information ctc TEX customer svc 970-728-8600.

AIRPORT REMARKS: Attended Apr-Oct 1400-0400Z†, Nov-Mar

1400-0100Z†. Arpt CLOSED 0400-1300Z†. Rising terrain all

quadrants. Arpt on 1000' mesa, strong vertical turbulence in area of mesa edge. Rwy 09-27 recommended tkf Rwy 27, land Rwy 09 and avoid populated areas. Rwy 09-27 grade -.08 on rwy ends, -.1.3 to approximately midpoint then +.75. Glider, hang glider and helicopter ops on and invof arpt. ARFF Index rstd to FAR 139 design groups AI-CIII. Cold temperature airport. Altitude correction required at or below -18C. Air carrier ops during unattended hrs must notify TEX customer svc at 970-728-8603 24 hrs in advance for provision of adequate ARFF personnel. Ldg fee.

AIRPORT MANAGER: (970) 728-8601

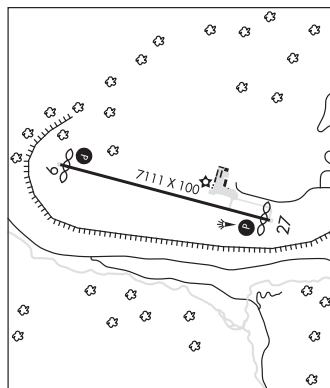

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

WEATHER DATA SOURCES: AWOS-3 118.325 (970) 728-1534.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.2 (DENVER RADIO)

® DENVER CENTER APP/DEP CON 125.35

CLEARANCE DELIVERY PHONE: For CD contact Denver ARTCC at 303-651-4814. If una to ctc Denver ARTCC, ctc Denver radio.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

CONES (VL) (L) VORW/DME 116.95 ETL Chan 116(Y) N38°02.42' W108°15.51' 095° 17.4 NM to fld.

8460/12E. VOR/DME unmonitored.

VOR unusable:

- 042°-096° byd 40 NM
- 097°-141° byd 25 NM
- 142°-147° byd 40 NM
- 148°-178° byd 15 NM
- 179°-185° byd 40 NM
- 205°-226° byd 40 NM
- 280°-040° byd 40 NM
- 349°-021° byd 35 NM blo 16,000'

DME unusable:

- 077°-088° byd 30 NM
- 097°-141° byd 25 NM
- 148°-178° byd 15 NM
- 207°-220° byd 34 NM blo 14,000'
- 349°-021° byd 35 NM blo 16,000'

LDA/DME 109.3 I-TEX Chan 30 Rwy 09. LOC unusable byd 20° either side of course centerline; within 0.9 NM, 1.0

DME, from thld. DME unusable 20° left and right of course.

THURMAN N39°41.90' W103°12.90' NOTAM FILE DEN.

WICHITA

(VL) (H) VORTACW 112.9 TXC Chan 76 208° 32.9 NM to Limon Muni. 4890/12E.

H-5A, L-10G

VOR unusable:

- 195°-224° byd 40 NM
- 225°-235° byd 40 NM blo 18,000'
- 236°-245° byd 40 NM
- 246°-256° byd 40 NM blo 8,500'
- 246°-256° byd 65 NM
- 257°-270° byd 40 NM blo 18,000'

TOBE N37°15.52' W103°36.00' NOTAM FILE DEN.

WICHITA

(VL) (DH) VORW/DME 114.05 TBE Chan 87(Y) 258° 35.5 NM to Perry Stokes. 5730/12E.

H-5A, L-15A

DME unusable:

- 150°-180° byd 30 NM blo 11,000'

VOR unusable:

- 129°-137° byd 40 NM blo 8,800'
- 129°-137° byd 82 NM blo 18,000'
- 138°-245° byd 40 NM

TRINIDAD

PERRY STOKES (TAD)(KTAD) 10 NE UTC-7(-6DT) N37°15.55' W104°20.45'

DENVER

5762 B NOTAM FILE TAD

H-5A, L-10F, 15A

RWY 03-21: H5500X75 (ASPH) S-37, D-50 MIRL 0.4% up SW

IAP

RWY 03: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

RWY 21: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Rgt tfc.

RWY 09-27: 5500X100 (TURF-GRVL)

RWY 09: Trees.

SERVICE: FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 03 and Rwy 21; PAPI Rwy 03 and Rwy 21; MIRL Rwy 03-21—CTAF. PPR.

AIRPORT REMARKS: Attended Mon 2100-0100Z†, Tue-Fri 1500-1900Z†. Alert: USAF student trng invof Colorado Springs and Pueblo Co. Twys have blue/white reflectors at pavement edge. Rwy 09-27 has +3-6 ft bushes on edge both sides alg entre len; soft when wet; prairie dog holes thrut. Rwy 09 +40 ft trees 846 ft fm thr 137 ft right; +4 ft bushes and +3 ft posts wi 100 ft of rwy end both sides of cntrln. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: (719) 859-4414

WEATHER DATA SOURCES: ASOS 119.025 (719) 845-1156.

COMMUNICATIONS: CTAF/UNICOM 122.8

TRINIDAD RCO 122.2 (DENVER RADIO)

® DENVER CENTER APP/DEP CON 128.375

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Denver ARTCC at 303-651-4257.

CONTINUED ON NEXT PAGE