

EVART MUNI (9C8) 1 SW UTC-5(-4DT) N43°53.69' W85°17.09'

1020 NOTAM FILE LAN

RWY 06-24: H3804X75 (ASPH) MIRL 0.3% up NE

RWY 06: REIL. PAPI(P2L)—GA 3.0° TCH 25'.

RWY 24: REIL. PAPI(P2L)—GA 3.0° TCH 45'.

SERVICE: LGT Actvt REIL Rwy 06 & 24; PAPI Rwy 06 & 24; MIRL Rwy 06-24—CTAF.

AIRPORT REMARKS: Unattended. Deer & Irg birds on & invof arpt. Trml bldg south door access 5-3-2-1-*

AIRPORT MANAGER: 231-372-0010

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE MOP.

MOUNT PLEASANT (L) (L) VOR/DME 110.6 MOP Chan 43


N43°37.37' W84°44.24' 310° 28.9 NM to fld. 752/5W.

DME unusable:

Byd 33 NM blo 4,000'

CHICAGO

L-281, 31B

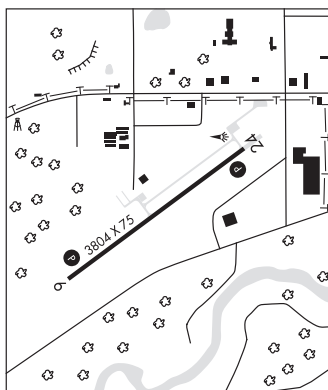

FELPS N44°57.65' W83°33.60' NOTAM FILE APN.

NDB (LOMW) 206 AP 007° 7.0 NM to Alpena Co Rgnl. 726/7W.

LAKE HURON

FIELD OF DREAMS (See HALE on page 193)

FITCH H BEACH (See CHARLOTTE on page 169)

FLINT

BISHOP INTL (FNT)(KFNT) 3 SW UTC-5(-4DT) N42°57.93' W83°44.68'

782 B LRA Class I, ARFF Index B NOTAM FILE FNT

RWY 18-36: H7852X150 (ASPH-GRVD) S-120, D-250, 2S-175, 2D-550 PCN 88 F/A/W/T HIRL

RWY 18: REIL. PAPI(P4R)—GA 3.0° TCH 47'. Thld dspcd 202'. Tree.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 55'. Tree.

RWY 09-27: H7201X150 (ASPH-GRVD) S-120, D-250, 2S-175, 2D-550 PCN 88 F/A/W/T HIRL

RWY 09: MALSR. PAPI(P4R)—GA 3.0° TCH 63'. RVR-T Trees.

RWY 27: MALSR. PAPI(P4L)—GA 3.0° TCH 56'. RVR-R Trees.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 09	18-36	4100
RWY 36	09-27	6300

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-7201 TODA-7201 ASDA-7201 LDA-7201

RWY 18: TORA-7852 TODA-7852 ASDA-7852 LDA-7650

RWY 27: TORA-7201 TODA-7201 ASDA-7201 LDA-7201

RWY 36: TORA-7852 TODA-7852 ASDA-7652 LDA-7652

SERVICE: S4 **FUEL** 100LL, JET A **LGT** When tower CLOSED ACTIVATE MALSR Rwy 09-27, REIL Rwy 18 and Rwy 36; HIRL Rwy 09-27 and Rwy 18-36—CTAF. Rwy 18 PAPI unusbl byd 8° left of cntrln.

AIRPORT REMARKS: Attended continuously. Deer and birds on and invof arpt. 100LL avbl self svc at golf tees.

AIRPORT MANAGER: 810-235-6560

WEATHER DATA SOURCES: ASOS (810) 342-7804 LAWRS.

COMMUNICATIONS: CTAF 126.3 ATIS 133.15 UNICOM 122.95

FLINT RCO 122.3 (LANSING RADIO)

® GREAT LAKES APP/DEP CON 118.8 (1030-0500Z‡)

® CLEVELAND CENTER APP/DEP CON 126.75 (0500-1030Z‡) ctc Cleveland ARTCC at 440-774-0229.

FLINT TOWER 126.3 (1045-0430Z‡)


GND CON 121.9 CLNC DEL 121.75

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd ctc Great Lakes Apch at 269-459-3345, when Apch clsd ctc Cleveland ARTCC at 440-774-0224/0490.

DETROIT

H-10G, 11A, L-28J

IAP, AD

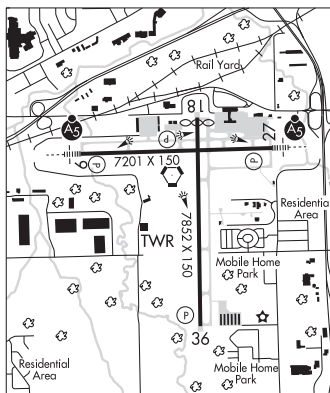

CONTINUED ON NEXT PAGE

EC, 31 OCT 2024 to 26 DEC 2024

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS C svc ctc APP CON svc 1045-0430Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE FNT.

FLINT (VH) (H) VORTACW 116.9 FNT Chan 116 N42°58.01' W83°44.82' at fld. 771/6W.

TACAN AZIMUTH unusable:

174°-184° wi 15 NM
229°-309° byd 30 NM
310°-228° blo 10,000'

VOR unusable:

070°-090° byd 40 NM
100°-125° byd 40 NM
145°-199° byd 40 NM
223°-233° byd 40 NM
Byd 30 NM blo 3,000'

DME unusable:

174°-184° wi 15 NM
Byd 30 NM blo 3,000'

ILS 109.9 I-FNT Rwy 09. Class ID. Unmonitored when ATCT clsd.

ILS 109.9 I-TUN Rwy 27. Class IB. Unmonitored when ATCT clsd.

COMM/NAV/WEATHER REMARKS: Emerg frequencies not avbl at twr.

FLUGPLATZ (See LEXINGTON on page 211)

FLUSHING

DALTON (3DA) 2 E UTC-5(-4DT) N43°03.41' W83°48.28'

DETROIT

733 B NOTAM FILE LAN

RWY 18-36: H2510X50 (ASPH) LIRL

RWY 18: Thld dspcld 771'. Tree.

RWY 36: Thld dspcld 771'. Trees.

RWY 09-27: 1633X130 (TURF)

RWY 09: Tree.

RWY 27: Thld dspcld 293'. Road.

SERVICE: FUEL 100LL LGT Actvt LIRL Rwy 18-36—CTAF.

AIRPORT REMARKS: Attended irregularly. Rwy 09-27 clsd Oct-Mar. Fuel available via credit card. Deer & Irg birds on & invof arpt. Rwy end 09 mkg type: 3 ft yellow cones. Rwy 27 rwy & dthr mkd with 3 ft yellow cones.

AIRPORT MANAGER: 810-736-7231

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Great Lakes Apch at 269-459-3345, when Apch clsd ctc Cleveland ARTCC at 440-774-0224/0490.

FLYING-A-RANCH (See FRUITPORT on page 187)

FORD (See IRON MOUNTAIN KINGSFORD on page 203)

FOREST HILL (See WESTPHALIA on page 252)

FOWLerville

MAPLE GROVE (65G) 3 N UTC-5(-4DT) N42°43.08' W84°03.64'

DETROIT
COPTER

906 NOTAM FILE LAN

RWY 09-27: 3050X110 (TURF) LIRL

RWY 09: Thld dspcld 200'. Ground.

RWY 27: Thld dspcld 300'. Road.

RWY 18-36: 2000X113 (TURF) LIRL

RWY 18: Thld dspcld 550'. Fence.

RWY 36: Thld dspcld 275'. Road.

SERVICE: S4

AIRPORT REMARKS: Attended Jun-Oct irregularly. Deer and Irg birds on and invof arpt. Parachute Jumping. Ficons unmon Nov-May. No snow removal. Arpt is collocated with E66 hlp, be alert for rotary wing acft. Extsv acft trg, two-way rdo coms rqrd. Rwy end 09: rwy & dthr mkd with 3 ft yellow cones. Rwy end 27: rwy & dthr mkd with 3 ft yellow cones. Rwy end 18: rwy & dthr mkd with 3 ft yellow cones. Rwy end 36: rwy & dthr mkd with 3 ft yellow cones.

AIRPORT MANAGER: 517-245-4387

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Great Lakes Apch at 269-459-3345, when Apch clsd ctc Cleveland ARTCC at 440-774-0224/0490.