

TRI-STATE/MILTON J FERGUSON FLD (HTS)(KHTS) 3 S UTC-5(-4DT) N38°22.11' W82°33.62'

CINCINNATI

H-10G, 12H, L-26H

IAP, AD

828 B LRA Class I, ARFF Index B NOTAM FILE HTS

RWY 12-30: H7017X150 (ASPH-GRVD) S-110, D-140, 2S-175,

2D-230 PCN 81 F/C/X/T HIRL

RWY 12: MALSR. PAPI(P4L)—GA 3.0° TCH 56'. RVR-T Trees.

RWY 30: REIL. PAPI(P4L)—GA 3.0° TCH 49'. RVR-R Thld dsplcd 501'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 12: TORA-7017 TODA-7017 ASDA-6516 LDA-6516

RWY 30: TORA-7017 TODA-7017 ASDA-7017 LDA-6516

SERVICE: S4 FUEL 100LL, JET A OX 3, 4 LGT PAPI Rwy 30 unusable byd 7° left of centerline.

AIRPORT REMARKS: Attended continuously. Birds and deer on and invof arpt.

Pilots report possibility of mistaking fuel burning stack located

approximately 2 miles west Rwy 12 for apch lgtg sequenced flashing

lghts. Rwy 12 obstruction twr located 5100' west and 600' north end

rwy. Ldg fee: fee for acft unless fuel purchased. Flight Notification

Service (ADCUS) available.

AIRPORT MANAGER: 304-453-6165**WEATHER DATA SOURCES:** ASOS (304) 453-3408**COMMUNICATIONS:** ATIS 125.2 UNICOM 122.95

HUNTINGTON RCO 122.2 (ELKINS RADIO)

Ⓡ HUNTINGTON APP/DEP CON 119.75 (South) 128.4 (North)

HUNTINGTON TOWER 118.5 GND CON 121.9 CLNC DEL 118.05

AIRSPACE: CLASS D.


TRSA svc ctc APP CON

RADIO AIDS TO NAVIGATION: NOTAM FILE LOU.

NEWCOMBE (L) DME 110.4 ECB Chan 41 N38°09.50' W82°54.60' 053° 20.8 NM to fld. 1070.

ILS/DME 109.9 I-HTS Chan 36 Rwy 12. Class IC.

ILS/DME 108.7 I-TUU Chan 24 Rwy 30. Class IB.

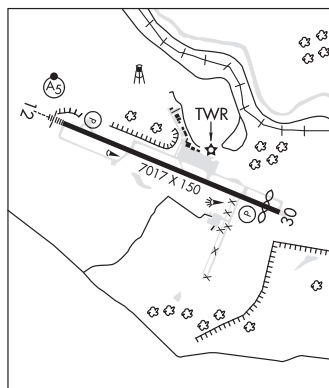

IVY KNOB N37°47.17' W81°31.12'
RCO 122.4 (ELKINS RADIO)

CINCINNATI

L-26H

JACKSON CO (See RAVENSWOOD on page 409)

KEE FLD (See PINEVILLE on page 408)

KESSEL N39°13.53' W78°59.37' NOTAM FILE EKN.
(L) (L) VORW/DME 110.8 ESL Chan 45 214° 15.6 NM to Grant Co. 2590/6W.
DME unusable:
260°-270° byd 10 NM blo 6,500'
288°-295° byd 10 NM blo 6,500'

CINCINNATI

H-10H, L-29D

LAWRENCE CO AIRPARK (See CHESAPEAKE/HUNTINGTON WVA on page 397)