

BILLINGS LOGAN INTL (BIL)(KBIL) 2 NW UTC-7(-6DT) N45°48.47' W108°32.61'

BILLINGS
H-1E, L-13D
IAP, AD

3662 B TPA—See Remarks ARFF Index—See Remarks NOTAM FILE BIL

RWY 10L-28R: H10518X150 (ASPH-GRVD) S-120, D-214, 2S-175,

2D-365 PCR 745 F/B/X/T HIRL

RWY 10L: MALSR. PAPI(P4L)—GA 3.0° TCH 51'. RVR-T 0.8% down.

RWY 28R: REIL. PAPI(P4R)—GA 3.0° TCH 56'. RVR-R Ground. 1.0% up.

RWY 07-25: H5501X75 (ASPH-GRVD) S-12.5 PCR 303 F/B/X/T

MIRL 1.9% up SW

RWY 07: PAPI(P4L)—GA 3.0° TCH 31'. Ground.

RWY 25: REIL. PAPI(P4R)—GA 3.0° TCH 36'.

RWY 10R-28L: H3800X75 (ASPH) S-12.5 PCR 107 F/B/X/T MIRL

1.3% up NW

RWY 10R: Ground.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 07: TORA-5501 TODA-5501 ASDA-5501 LDA-5501

RWY 10L: TORA-10518 TODA-10518 ASDA-10518 LDA-10518

RWY 10R: TORA-3801 TODA-3801 ASDA-3801 LDA-3801

RWY 25: TORA-5501 TODA-5501 ASDA-5501 LDA-5501

RWY 28L: TORA-3801 TODA-3801 ASDA-3801 LDA-3801

RWY 28R: TORA-10518 TODA-10518 ASDA-10518 LDA-10518

SERVICE: S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT For MIRL Rwy

10R-28L and Rwy 07-25, HIRL Rwy 10L-28R, MALSR Rwy 10L and REIL Rwy 25 and Rwy 28R ctc twr.

AIRPORT REMARKS: Attended continuously. Migratory waterfowl invof arpt. Rwy 07-25 and Rwy 10R-28L clsd to acct over 12,500 lbs. No cstrms, remote acct parking, ltd gnd handling svc. Twy D 35' wide clsd to acct over 12,500 lbs. Class I, ARFF Index C. PPR unscheduled air carrier ops with more than 30 pax seats ctc arpt ops 406-657-8496. ARFF Index B from 0900-1200Z. 180° turns prohibited on all sfcs. TPA—Single engine acct 4500 (838), multi engine/turbojet acct 5000 (1338).

AIRPORT MANAGER: (406) 657-8484

WEATHER DATA SOURCES: ASOS 126.3 (406) 255-2790. LLWAS.

COMMUNICATIONS: ATIS 126.3 UNICOM 122.95

RCO 122.3 (GREAT FALLS RADIO)

Ⓡ APP/DEP CON 119.2 EAST 120.5 WEST

TOWER 127.2 GND CON 121.9

PRE TAXI CLNC 121.9

AIRSPACE: CLASS C svc ctc APP CON.

RADIO AIDS TO NAVIGATION: NOTAM FILE BIL.

(VH) (H) VORTACW 114.5 BIL Chan 92 N45°48.51' W108°37.48' 077° 3.4 NM to fld. 3811/14E.

VOR unusable:

146°-154° byd 40 NM


155°-165° byd 40 NM blo 11,000'

155°-165° byd 49 NM blo 18,000'

166°-173° byd 40 NM

ILS/DME 111.5 I-BIL Chan 52 Rwy 10L. Class IT.

ILS/DME 111.5 I-BMO Chan 52 Rwy 28R. Class IA. Localizer unusable beyond 20 degrees left and right of course.

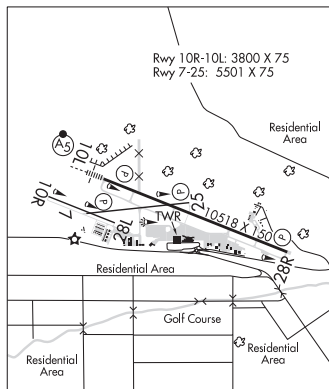

BLACK BUTTE NORTH (See WINIFRED on page 151)

BOLDER (3U9) 2 S UTC-7(-6DT) N46°12.70' W112°06.46'

GREAT FALLS

4968 NOTAM FILE GTF

RWY 11-29: 3675X72 (TURF) 1.6% up W

AIRPORT REMARKS: Unattended. No snow removal. Rwy 11-29 NSTD markings, thlds and edges marked with white cones. -2' drainage ditch +1' berm west side of rwy full length, 43' from Rwy 11-29 cntrln.

AIRPORT MANAGER: (406) 431-7519

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Helena Apch at 406-449-5756/5761, when Apch clsd ctc Salt Lake ARTCC at 801-320-2568.

BOWMAN FLD (See ANACONDA on page 92)