

KINGSTON

LAKE TEXOMA STATE PARK (F31) 4 E UTC-6(-5DT) N33°59.46' W96°38.56'

DALLAS-FORT WORTH

693 B NOTAM FILE MLC

L-17C

RWY 18-36: H3000X50 (ASPH) S-4 MIRL

RWY 36: Trees.

SERVICE: LGT Actvt MIRL Rwy 18-36—CTAF. MIRL Rwy 18-36 preset low intst; incr intst—CTAF. Rotating bcn OTS indef.

AIRPORT REMARKS: Unattended. Deer and geese on and invof rwy. After hrs contact: 580-564-5515.

AIRPORT MANAGER: 580-564-2566

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE ADM.

ARDMORE (VH) (H) VORTACW 116.7 ADM Chan 114 N34°12.70' W97°10.09' 111° 29.3 NM to fld. 937/6E.

VOR unusable:

150°-160° byd 40 NM

150°-160° byd 6 NM blo 14,000'

297°-306° byd 40 NM blo 15,000'

307°-314° blo 3,500'

307°-314° byd 15 NM

314°-333°


TACAN AZIMUTH unusable:

314°-333°

DME unusable:

314°-333°

334°-011° byd 39 NM blo 3,100'

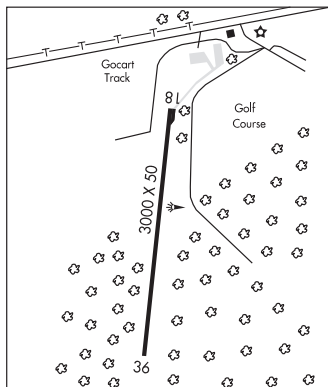

LAKE TEXOMA STATE PARK (See KINGSTON on page 212)

LAWTON-FORT SILL RGNL (LAW)(KLAW) 2 S UTC-6(-5DT) N34°34.06' W98°25.00'

DALLAS-FORT WORTH

1110 B ARFF Index—See Remarks NOTAM FILE LAW MON Airport

H-6H, L-17C

RWY17-35: H8599X150 (CONC-WC) S-45, D-179, 2S-175, 2D-344

IAP, AD

PCR 610 R/B/W/T HIRL

RWY 17: REIL. PAPI(P4R)—GA 3.0° TCH 47'. Pole. 0.3% down.

RWY 35: MALSR. 0.6% up.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 17: TORA-8599 TODA-8599 ASDA-8599 LDA-8599

RWY 35: TORA-8599 TODA-8599 ASDA-8599 LDA-8599

SERVICE: S4 FUEL 100LL, JET A1+ OX 1, 2 LGT ATCT ctis all rwy and twy lgtg when open; when ATCT clsd, MALSR Rwy 35; REIL Rwy 17; HIRL Rwy 17-35; twy lgtg on med intst. Incr/dcr intst—CTAF. PAPI Rwy 17 on consly, vrb1 intst—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1130-0200Z† Sat-Sun 1130-0100Z†. Birds on and invof arpt. When twr clsd ARFF avbl through Fort Sill apch control. ARFF Index PPR for unsked Part 121 acf ops with more than 30 pax seats—AMGR.

AIRPORT MANAGER: 580-353-4869

WEATHER DATA SOURCES: ASOS 120.75 (580) 581-1351.


COMMUNICATIONS: CTAF 119.9 ATIS 120.75 UNICOM 122.95

® FORT SILL APP/DEP CON 120.55

TOWER 119.9 (1400-0100Z†) GND CON 121.9

CLEARANCE DELIVERY PHONE: When ATCT clsd, for CD ctc Fort Worth ARTCC at 817-858-7584.

AIRSPACE: CLASS D svc 1400-0100Z†; other times CLASS E.

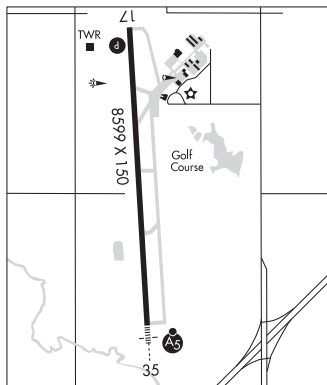

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE LAW.(VL) (L) **VOR/DME** 116.85 LAW Chan 115(Y) N34°29.77' W98°24.79' 349° 4.3 NM to fld. 1105/9E.**VOR unusable:**

000°-031° byd 40 NM

032°-042° byd 40 NM blo 4,000'

032°-042° byd 49 NM

043°-153° byd 40 NM

154°-164° byd 40 NM blo 3,000'

154°-164° byd 49 NM

165°-359° byd 40 NM

270°-305° byd 10 NM blo 3,900'

ILS 109.1 I-LAW Rwy 35. Class IB. Unmonitored when ATCT clsd. Glideslope unusable for coupled apchs blo 2,000' MSL.**ASR****COMM/NAV/WEATHER REMARKS:** When twr clsd weather avbl through Fort Sill apch control.**LEXINGTON****MC CASLIN** (O44) 4 N UTC-6(-5DT) N35°05.54' W97°20.19'**DALLAS-FT WORTH**

1135 NOTAM FILE MLC

RWY 17-35: 2135X80 (TURF)**RWY 17:** Fence.**RWY 35:** Bldg.**AIRPORT REMARKS:** Unattended. +35' powerline 145' east of rwy, full length. 30 ft power line 478 ft fm Rwy 35 thr both sides.**AIRPORT MANAGER:** (214) 642-6570**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Oke City Apch at 405-681-5683.**LINDSAY MUNI** (1K2) 2 NE UTC-6(-5DT) N34°50.97' W97°35.12'**DALLAS-FT WORTH**

968 B NOTAM FILE MLC

L-17C**RWY 01-19:** H3010X60 (ASPH) S-4 MIRL**SERVICE:** LGT ACTIVATE MIRL Rwy 01-19—CTAF.**AIRPORT REMARKS:** Unattended. 660' AGL antenna 3.2 miles north.**AIRPORT MANAGER:** 405-756-2019**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE OKC.**WILL ROGERS (H) (H) VORTACW** 114.1 IRW Chan 88 N35°21.52'

W97°36.55' 171° 30.5 NM to fld. 1240/7E.

TACAN AZIMUTH unusable:

297°-315°

