

MOULTRIE

MOULTRIE MUNI (MGR)(KMGR) 6 S UTC-5(-4DT) N31°05.13' W83°48.17'

JACKSONVILLE
H-9B, 12F, L-22J
IAF

297 B NOTAM FILE MCN

RWY 04-22: H6000X100 (ASPH-GRVD) S-30, D-49, 2D-98 MIRL

0.5% up NE

RWY 04: PAPI(P2L)—GA 3.0° TCH 45'. Trees.

RWY 22: PAPI(P2L)—GA 3.0° TCH 25'. Thld dspcd 372'. Trees.

RWY 16-34: H3878X75 (ASPH) S-12.5 0.5% up N

RWY 16: Trees.

RWY 34: Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-6000 TODA-6000 ASDA-6000 LDA-6000

RWY 22: TORA-6000 TODA-6000 ASDA-6000 LDA-5628

SERVICE: S4 **FUEL** 100LL, JET A+ **OX** 3, 4 **LGT** MIRL Rwy 04-22

preset on low instst dusk-0300Z‡; to incr instst and ACTVT after 0300Z‡—CTAF. ACTVT PAPI Rwy 04 and 22—CTAF. Twy lgts Rwy 04-22 only.

AIRPORT REMARKS: Attended 1230Z‡—dusk.

AIRPORT MANAGER: (229) 873-4278

WEATHER DATA SOURCES: AWOS-3PT 118.925 (229) 890-5320.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **VALDOSTA APP/DEP CON** 126.6 (east of VAD R-360 — R-180 radials)

132.375 (west of VAD R-360 radial) (Opr 1300-0600Z‡ Mon-Thu,

1300-0300Z‡ Fri, 1400-2200Z‡ Sat, Sun and

hol) other times ctc

Ⓡ **JACKSONVILLE CENTER APP/DEP CON** 127.575

CLEARANCE DELIVERY PHONE: For CD ctc Valdosta Apch at 229-257-2207, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE MCN.

(L) **DME** 108.8 MGR Chan 25 N31°04.94' W83°48.25' at fld. 286.

VALDOSTA (VH) (H) VOR/DME 114.8 OTK Chan 95 N30°46.83' W83°16.78' 306° 32.6 NM to fld.

199/2W. NOTAM FILE VLD.

VOR unusable:

175°-205° byd 40 NM

206°-216° byd 40 NM blo 3,000'


206°-216° byd 71 NM

217°-224° byd 40 NM

225°-235° byd 40 NM blo 7,000'

225°-235° byd 80 NM

236°-245° byd 40 NM

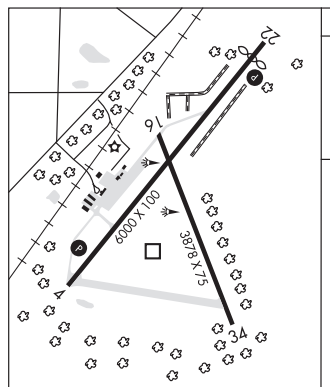

SPENCE (MUL)(KMUL) 4 SE UTC-5(-4DT) N31°08.26' W83°42.24'

JACKSONVILLE
L-22J

292 NOTAM FILE MCN

RWY 14-32: H4500X75 (CONC) S-65, D-90

SERVICE: S4

AIRPORT REMARKS: Unattended. Rwy condition poor. Farm and construction eqpt crossing rwy. Extsv mil tfc, 200 kts, sfc to 3500' wi 5 NM. To avoid potential tfc conflict with MOODY AFB T-6A acft and rec adzst, all acft are requested to annc their arr or dep intnts on CTAF. Acft manufacturer located on arpt, acft testing and demonstration with lgds and departure from apron. Parking apron has loose grvl throughout. Rwy 14-32 rwy slabs have joint seal DMG and spalling, with corner BRKs in places.

AIRPORT MANAGER: 229-985-1974

COMMUNICATIONS: CTAF/UNICOM 123.0

CLEARANCE DELIVERY PHONE: For CD ctc Valdosta Apch at 229-257-2207, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE VLD.

VALDOSTA (VH) (H) VOR/DME 114.8 OTK Chan 95 N30°46.83' W83°16.78' 316° 30.6 NM to fld. 199/2W.

VOR unusable:

175°-205° byd 40 NM

206°-216° byd 40 NM blo 3,000'

206°-216° byd 71 NM

217°-224° byd 40 NM

225°-235° byd 40 NM blo 7,000'

225°-235° byd 80 NM

236°-245° byd 40 NM