

SISKIYOU CO (SIY)(KSIY) 3 NE UTC-8(-7DT) N41°46.89' W122°28.09'

2651 B NOTAM FILE SIY

RWY 17-35: H7490X150 (ASPH) S-60, D-180, 2S-175, 2D-270

MIRL

RWY 17: REIL. PAPI(P2L)—GA 3.0° TCH 50'. Road.

RWY 35: REIL. PAPI(P2L)—GA 3.0° TCH 50'. Rgt tfc.

SERVICE: FUEL JET A LGT ACTIVATE MIRL Rwy 17-35, PAPI Rwy 17 and Rwy 35, REIL Rwy 17 and Rwy 35—CTAF.

AIRPORT REMARKS: Attended Sun-Fri 1600-0100Z±. Migratory flocks of waterfowl invof arpt during spring and fall. Wildlife invof arpt. Farming activities and equipment invof rwys and twys. Sensitive AG crops adjacent to rwy/twy. Rotocraft should avoid operating in these areas. Be alert for glider ops May-Sept. US Forest Svc fire ops May-Sep. Ldg fee.

AIRPORT MANAGER: 530-842-8259

WEATHER DATA SOURCES: ASOS 121.125 (530) 459-0267.

COMMUNICATIONS: CTAF/UNICOM 123.0

ANTELOPE MTN RCO 122.4 (RANCHO MURIETA RADIO)

Ⓡ SEATTLE CENTER APP/DEP CON 124.85

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIU.

FORT JONES (VL) (DH) VORW/DME 116.25 FJS Chan 109(Y)

N41°26.98' W122°48.39' O18° 25.1 NM to fld. 4900/19E.

VOR unusable:

015°-073° byd 40 NM

018°-025° byd 22 NM blo 14,000'

074°-117° byd 33 NM

118°-127° byd 40 NM

128°-146° byd 33 NM

147°-292° byd 11 NM

293°-310° byd 40 NM

316°-326° byd 40 NM blo 10,000'

316°-326° byd 61 NM

327°-331° byd 40 NM

332°-342° byd 40 NM blo 11,500'

332°-342° byd 67 NM

343°-002° byd 40 NM

DME unusable:

018°-025° byd 22 NM blo 14,000'

074°-117° byd 33 NM

128°-146° byd 33 NM


147°-292° byd 11 NM

MONTAGUE NDB (MHW) 404 MOG N41°43.64' W122°28.90' 356° 3.3 NM to fld. 2629/15E. NOTAM FILE SIY.

NDB unmonitored.

NDB unusable:

190°-200° byd 10 NM

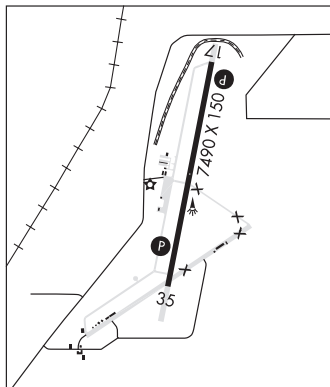

KLAMATH FALLS

H-3B, L-21

IAP